


SOKKIA
GREEN LABEL

SET62
SET65
Electronic Total Station

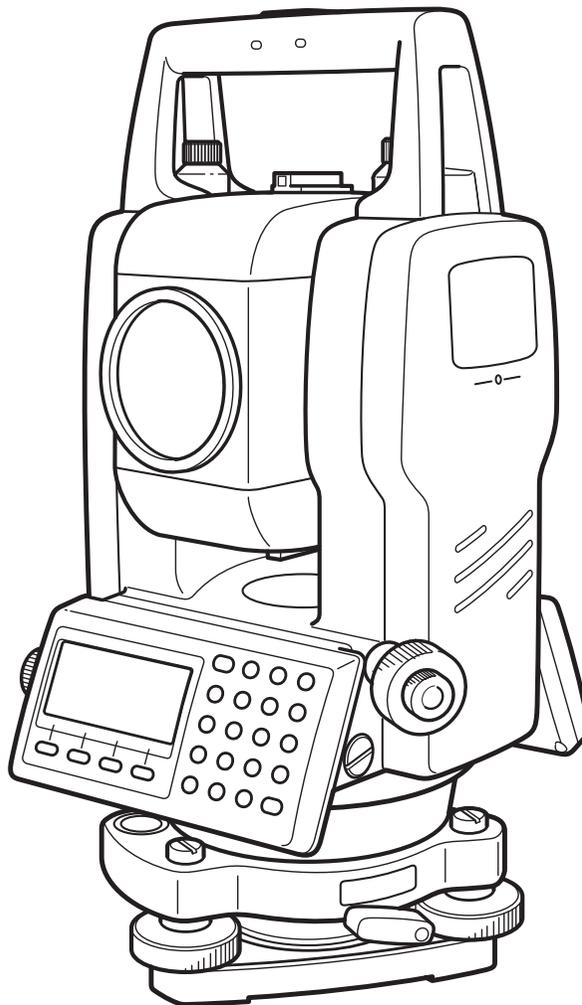

OPERATOR'S MANUAL

71015 90010



Ni-MH

[English]	CONTAIN Ni-MH BATTERY. CADMIUM-FREE. MUST BE RECYCLED OR DISPOSED OF PROPERLY.
[Deutsch]	MIT NiMH AKKU. ENTHALT KEIN KADMIUM. EFORBERT RECYCLING ODER FACHGERECHTE ENTSORGUNG.
[Français]	CONTIENT UNE BATTERIE AU Ni-MH. SANS CADMIUM. DOIT ÊTRE RECYCLÉE OU DONNÉE A UN ORGANISME DE RETRAITEMENT.
[Italiano]	CONTIENE NiMH BATTERIA. NON CONTIENE CADMIO. DEVE QUINDI ESSERE RICICLATA O ELIMINATA IN MODO APPROPRIATO.
[Nederlands]	BEVAT EEN NiMH BATTERIJ. BEVAT GEEN CADMIUM. DIENT GERECYCLEERD OF OP EEN CORRECTE MANIER VERNIETIGD TE WORDEN.
[Español]	CONTIENE UNA NiMH BATERÍA. NO CONTIENE CADMIO. DEBE RECICLARSE O ELIMINARSE ADECUADAMENTE.
[Portugulês]	CONTEM BATERIA DE NiMH. SEM CÁDMIO. DEVERÁ SER RECICLADA OU DEPARTADA CONVENIENTEMENTE.
[Svensk]	INNEHÅLLER NiMH BATTERI. KÄDMIUMFRITT. BÖR ÅTERVINNAS ELLER FÖRSTÖRAS PÅ ETT SAKERT SÄTT.
[Suomi]	SISÄLTÄÄ NiMH AKUN. HÄVITETTÄESSÄ KÄSITELTÄVÄ ONGELMAJÄTTEENÄ.
[Norsk]	NiMH BATTERIER. INNEHOLDER IKKE KADMIUM. MÅ RESIRKULERES ELLER KASTES PÅ EN FORSVARLIG MÅTE.
[Dansk]	INDEHOLDER NiMH BATTERI. KADMIUMFRIT. SKAL GENVINDES ELLER KASSERES PÅ FORSVARLIG MÅDE.
[Ελληνικός]	ΠΕΡΙΕΧΕΙ ΜΠΑΤΑΡΙΑ ΝΙΚΕΛΙΟΥ-ΜΕΤΑΛΛΟΥ ΥΔΡΙΔΙΟΥ. ΔΕΝ ΠΕΡΙΕΧΕΙ ΚΑΔΜΙΟ. ΠΡΕΠΕΙ ΝΑ ΑΝΑΚΥΚΛΩΝΕΤΑΙ Η ΝΑ ΚΑΤΑΣΤΡΕΦΕΤΑΙ ΜΕ ΤΟΝ ΚΑΤΑΛΛΗΛΟ ΤΡΟΠΟ.

For U.S.A. ATTENTION:

The product that you have purchased contains a rechargeable battery. The battery is recyclable. At the end of its useful life, under various state and local laws, it may be illegal to dispose of this battery into the municipal waste stream. Check with your local solid waste officials for details in your area for recycling options or proper disposal. Use the standard battery charger.

Die Schweiz: Nach Gebrauch der Verkaufsstelle zurückgeben.

La Suisse: Après usage à rapporter au point de vente.

Swizzera: Ritornare la pila usate al negozio.

JSIMA

This is the mark of the Japan Surveying Instruments Manufacturers Association.

FOREWORD

Thank you for purchasing the SOKKIA GREEN LABEL Electronic Total Station, SET62/SET65. For the best performance of the instruments, please carefully read these instructions and keep them in a convenient location for future reference.

* Except where stated, "SET" means SET62/SET65 in this manual.
Screens and illustrations appearing in this manual are of SET62.

General Handling Precautions

Before starting work or operation, be sure to check that the instrument is functioning correctly with normal performance.

Do not submerge the instrument into water.

The instrument can not be submerged underwater.

The instrument is designed based on the International Standard IP54, therefore it is protected from the normal rainfall.

Setting the instrument on a tripod

When mounting the instrument on a tripod, use a wooden tripod when possible. The vibrations that may occur when using a metallic tripod can effect the measuring precision.

Installing the tribrach

If the tribrach is installed incorrectly, the measuring precision could be effected.

Occasionally check the adjusting screws on the tribrach. Make sure the base fixing lever is locked and the base fixing screws are tightened.

Guarding the instrument against shocks

When transporting the instrument, provide some protection to minimize risk of shocks.

Heavy shocks may cause the measurement to be faulty.

Carrying the instrument

Always carry the instrument by its handgrip.

Exposing the instrument to extreme heat.

Do not leave the instrument in extreme heat for longer than necessary. It could adversely affect its performance.

Sudden changes of temperature

Any sudden change of temperature to the instrument or prism may result in a reduction of measuring distance range, i.e when taking the instrument out from a heated vehicle. Let instrument acclimate itself to ambient temperature.

Battery level check

Confirm battery level remaining before operating.

Taking the battery out

It is recommended not to take the battery out during the power is on. All the data stored is possible gone at that time. So please do your assembling or taking the battery out after the power is off.

Do not hold the lower part of display unit

When you take out the instrument from a carrying case, or keep into the case, please hold the hand grip and base of the instrument. Please do not hold the lower part of the display unit.

Precautions for Safe Operation

For the safe use of the product and prevention of injury to operators and other persons as well as prevention of property damage, items which should be observed are indicated herein by an exclamation point within a triangle used with WARNING and CAUTION statements in this instruction manual. The definitions of the indications are listed below. Be sure you understand them before reading the manual's main text.

Definition of Indication

	WARNING	Ignoring this display and making an operation error could possibly result in death or serious injury to the operator.
	CAUTION	Ignoring this display and making an operation error could possibly result in minor injury or property damage.

-  This symbol indicates items for which caution (hazard warnings exclusive) is urged. Specific details are printed in or near the symbol.
-  This symbol indicates items which are prohibited. Specific details are printed in or near the symbol.
-  This symbol indicates items which must always be performed. Specific details are printed in or near the symbol.

General

Warning

-  Do not use the unit in areas exposed to high amounts of dust or ash, in areas where there is inadequate ventilation, or near combustible materials. An explosion could occur.
-  Do not perform disassembly or rebuilding. Fire, electric shock or burns could result.
-  Never look at the sun through the telescope. Loss of eyesight could result.
-  Do not look at reflected sunlight from a prism or other reflecting object through the telescope. Loss of eyesight could result.
-  Direct viewing of the sun during sun observation will cause loss of eyesight. Use solar filter (option) for sun observation.
-  When securing the instrument in the carrying case make sure that all catches, including the side catches, are closed. Failure to do so could result in the instrument falling out while being carried, causing injury.

Caution

-  Do not use the carrying case as a footstool. The case is slippery and unstable so a person could slip and fall off it.
-  Do not place the instrument in a case with a damaged case or belt. The case or instrument could be dropped and cause injury.
-  Do not wield or throw the plumb bob. A person could be injured if struck.
-  Secure handle to main unit. Failure to properly secure the handle could result in the unit falling off while being carried, causing injury.
-  Tighten the adjustment tribrach clamp securely. Failure to properly secure the clamp could result in the tribrach falling off while being carried, causing injury.

Power Supply



Warning



Do not short circuit. Heat or ignition could result.



Do not place articles such as clothing on the battery charger while charging batteries. Sparks could be induced, leading to fire.



Do not use voltage other than the specified power supply voltage. Fire or electrical shock could result.



Do not use batteries other than those designated. An explosion could occur, or abnormal heat generated, leading to fire.



Do not use damaged power cords, plugs or loose outlets. Fire or electric shock could result.



Do not use power cords other than those designated. Fire could result.



Use only the specified battery charger to recharge batteries. Other chargers may be of different voltage rating or polarity, causing sparking which could lead to fire or burns.



Do not use the battery or charger for any other equipment or purpose. Fire or burns caused by ignition could result.



Do not heat or throw batteries or chargers into fire. An explosion could occur, resulting in injury.



To prevent shorting of the battery in storage, apply insulating tape or equivalent to the terminals. Otherwise shorting could occur, resulting in fire or burns.



Do not use batteries or the battery charger if wet. Resultant shorting could lead to fire or burns.



Do not connect or disconnect power supply plugs with wet hands. Electric shock could result.



Caution



Do not touch liquid leaking from batteries. Harmful chemicals could cause burns or blisters.

Tripod



Warning



When mounting the instrument to the tripod, tighten the centering screw securely. Failure to tighten the screw properly could result in the instrument falling off the tripod, causing injury.



Tighten securely the leg fixing screws of the tripod on which the instrument is mounted. Failure to tighten the screws could result in the tripod collapsing, causing injury.



Do not carry the tripod with the tripod shoes pointed at other persons. A person could be injured if struck by the tripod shoes.



Keep hands and feet away from the tripod shoes when fixing the tripod in the ground. A hand or foot stab wound could result.



Tighten the leg fixing screws securely before carrying the tripod. Failure to tighten the screws could lead to the tripod legs extending, causing injury.

User

1) This product is for professional use only!

The user is required to be a qualified surveyor or have a good knowledge of surveying, in order to understand the user and safety instructions, before operating, inspecting or adjusting.

2) Wear the required protectors (safety shoes, helmet, etc.) when operating.

Exceptions from Responsibility

1) The user of this product is expected to follow all operating instructions and make periodic checks of the product's performance.

2) The manufacturer, or its representatives, assumes no responsibility for results of a faulty or intentional usage or misuse including any direct, indirect, consequential damage, and loss of profits.

3) The manufacturer, or its representatives, assumes no responsibility for consequential damage, and loss of profits by any disaster, (an earthquake, storms, floods etc.).

A fire, accident, or an act of a third party and/or a usage any other usual conditions.

4) The manufacturer, or its representatives, assumes no responsibility for any damage, and loss of profits due to a change of data, loss of data, an interruption of business etc., caused by using the product or an unusable product.

5) The manufacturer, or its representatives, assumes no responsibility for any damage, and loss of profits caused by usage except for explained in the user manual.

6) The manufacturer, or its representatives, assumes no responsibility for damage caused by wrong movement, or action due to connecting with other products.

Contents


FOREWORD	1
General Handling Precautions	1
Precautions for Safe Operation	2
User	4
Exceptions from Responsibility	4
Contents	5
1 NOMENCLATURE AND FUNCTIONS	1-1
1.1 Nomenclature	1-1
1.2 Display	1-3
1.3 Operating Key	1-4
1.4 Function Key (Soft Key)	1-5
1.5 Star key mode	1-6
1.6 Serial signal RS-232C connector	1-7
2 PREPARATION FOR MEASUREMENT	2-1
2.1 Setting Instrument Up For Measurement	2-1
2.2 Power Switch Key ON	2-2
2.3 Battery Power Remaining Display	2-3
2.4 Vertical and Horizontal Angle Tilt Correction	2-4
2.5 How to Enter Alphanumeric characters	2-6
2.5.1 How to Enter Alphanumeric Characters	2-6
3 ANGLE MEASUREMENT	3-1
3.1 Measuring Horizontal Angle Right and Vertical Angle	3-1
3.2 Switching Horizontal Angle Right/Left	3-2
3.3 Measuring from the Required Horizontal Angle	3-2
3.3.1 Setting by Holding the Angle	3-2
3.3.2 Setting a Horizontal Angle from the Keys	3-3
3.4 Vertical Angle Percent Grade(%) Mode	3-3
3.5 Repetition Angle Measurement	3-4
3.6 Buzzer Sounding for Horizontal Angle 90° Increments	3-5
3.7 Compasses (vertical angle)	3-6
4 DISTANCE MEASUREMENT	4-1
4.1 Setting of the Atmospheric Correction	4-1
4.2 Setting of the Correction for Prism Constant	4-1
4.3 Distance Measurement (Continuous Measurement)	4-1
4.4 Distance Measurement (N-time Measurement/Single Measurement)	4-2
4.5 Fine Mode/Tracking Mode/Coarse Mode	4-3
4.6 Stake Out (S.O)	4-4
4.7 Offset Measurement	4-5
4.7.1 Angle Offset	4-6
4.7.2 Distance Offset Measurement	4-8
4.7.3 Plane Offset Measurement	4-10
4.7.4 Column Offset Measurement	4-12
5 COORDINATE MEASUREMENT	5-1
5.1 Setting Coordinate Values of Occupied Point	5-1
5.2 Setting Height of the Instrument	5-2
5.3 Setting Height of Target (Prism Height)	5-2
5.4 Execution of Coordinate Measuring	5-3
6 SPECIAL MODE (Menu Mode)	6-1
6.1 Application Measurement (PROGRAMS)	6-2
6.1.1 Remote Elevation measurement (REM)	6-2
6.1.2 Missing Line Measurement (MLM)	6-5
6.1.3 Setting Z Coordinate of Occupied Point	6-8
6.1.4 Area Calculation	6-11
6.1.5 Point to Line Measurement	6-14
6.2 Setting the GRID FACTOR	6-16


6.3	Setting Illumination of Display and Cross Hairs	6-17
6.4	Setting Mode 1	6-18
6.4.1	Setting Minimum Reading	6-18
6.4.2	Auto Power Off	6-19
6.4.3	Vertical and Horizontal Angle Tilt correction (Tilt ON/OFF)	6-19
6.4.4	Systematic Error of Instrument Correction	6-20
6.4.5	Heater ON/OFF	6-20
6.4.6	Setting RS-232C communication with external device	6-21
6.5	Setting Contrast of Display	6-22
6.6	ROAD	6-23
6.6.1	Input Start Point	6-24
6.6.2	Input Road Data	6-25
6.6.3	Search Data	6-29
6.6.4	Edit Data	6-29
6.6.5	Set OCC and BS	6-30
6.6.6	Setout Road	6-32
6.6.7	Select a File	6-33
6.6.8	Initialize ROAD data	6-33
7	DATA COLLECTION	7-1
7.1	Preparation	7-3
7.1.1	Selecting a File for Data Collection	7-3
7.1.2	Selecting a Coordinate File for Data Collection	7-4
7.1.3	Occupied Point and Backsight Point	7-4
7.2	Operational Procedure of "DATA COLLECT"	7-7
7.3	Data Collect Offset Measurement mode	7-10
7.3.1	Angle Offset Measurement	7-10
7.3.2	Distance Offset Measurement	7-12
7.3.3	Plane Offset Measurement	7-14
7.3.4	Column Offset Measurement	7-16
7.4	NEZ Auto Calculation	7-17
7.5	Point to Line Measurement	7-18
7.5.1	To change to the point to line measurement	7-18
7.5.2	Executing a point to line measurement	7-19
7.6	Editing PCODE Library [PCODE INPUT]	7-20
7.7	Setting Parameter of Data Collect [CONFIG.]	7-21
8	LAYOUT	8-1
8.1	Preparation	8-3
8.1.1	Setting the GRID FACTOR	8-3
8.1.2	Selecting Coordinate Data File	8-4
8.1.3	Setting Occupied Point	8-5
8.1.4	Setting Backsight Point	8-6
8.2	Executing a Layout	8-8
8.2.1	Layout of Coordinates of Point to Line	8-10
8.3	Setting a New Point	8-11
8.3.1	Side Shot Method	8-11
8.3.2	Resection Method	8-13
9	MEMORY MANAGER MODE	9-1
9.1	Display Internal Memory Status	9-2
9.2	Searching Data	9-3
9.2.1	Measured Data Searching	9-3
9.2.2	Coordinate Data Searching	9-5
9.2.3	PCODE LIBRARY Searching	9-6
9.3	FILE MAINTENANCE	9-7
9.3.1	Rename a File	9-8
9.3.2	Searching Data in a File	9-8
9.3.3	Deleting a File	9-9
9.4	Coordinate Data Direct Key Input	9-10

9.4.1	Coordinate data input	9-10
9.4.2	PTL (Point to Line) data input	9-11
9.5	Delete a Coordinate Data from a File	9-12
9.6	Editing PCODE Library	9-13
9.7	Data Communications	9-14
9.7.1	Sending Data	9-14
9.7.2	Loading Data	9-15
9.7.3	Setting Parameter of Data Communications	9-16
9.8	Initialization	9-17
10	SET AUDIO MODE	10-1
11	SETTING THE PRISM CONSTANT VALUE	11-1
12	SETTING ATMOSPHERIC CORRECTION	12-1
12.1	Calculation of Atmospheric Correction	12-1
12.2	Setting of Atmospheric Correction Value	12-1
13	CORRECTION FOR REFRACTION AND EARTH CURVATURE	13-1
13.1	Distance Calculation Formula	13-1
14	POWER SOURCE AND CHARGING	14-1
14.1	On-board Battery BT-G1S	14-1
15	DETACH/ATTACH OF TRIBRACH	15-1
16	SELECTING MODE	16-1
16.1	Items of the Selecting Mode	16-1
16.2	How to Set Selecting Mode	16-3
17	CHECK AND ADJUSTMENT	17-1
17.1	Checking and adjusting of instrument constant	17-1
17.2	Checking the Optical Axis	17-2
17.3	Checking/Adjusting the Theodolite Functions	17-3
17.3.1	Checking/Adjusting the Plate Level	17-4
17.3.2	Checking/Adjusting the Circular Level	17-4
17.3.3	Adjustment of the Vertical Cross-hair	17-5
17.3.4	Collimation of the Instrument	17-6
17.3.5	Checking/Adjusting the Optical Plummet Telescope	17-7
17.3.6	Adjustment of Vertical Angle 0 Datum	17-8
17.4	How to Set the Instrument Constant Value	17-9
17.5	Adjustment of Compensation Systematic Error of Instrument	17-10
17.6	Reference frequency check mode	17-12
18	PRECAUTIONS	18-1
19	OPTIONAL ACCESSORIES	19-1
20	BATTERY SYSTEM	20-1
21	TARGET SYSTEM	21-1
22	ERROR DISPLAYS	22-1
23	SPECIFICATIONS	23-1
24	REGULATIONS	24-1
APPENDIX	Appendix-1	
Dual Axis Compensation	Appendix-1	
Precaution when Charging or Storing Batteries	Appendix-3	

1 NOMENCLATURE AND FUNCTIONS

1.1 Nomenclature

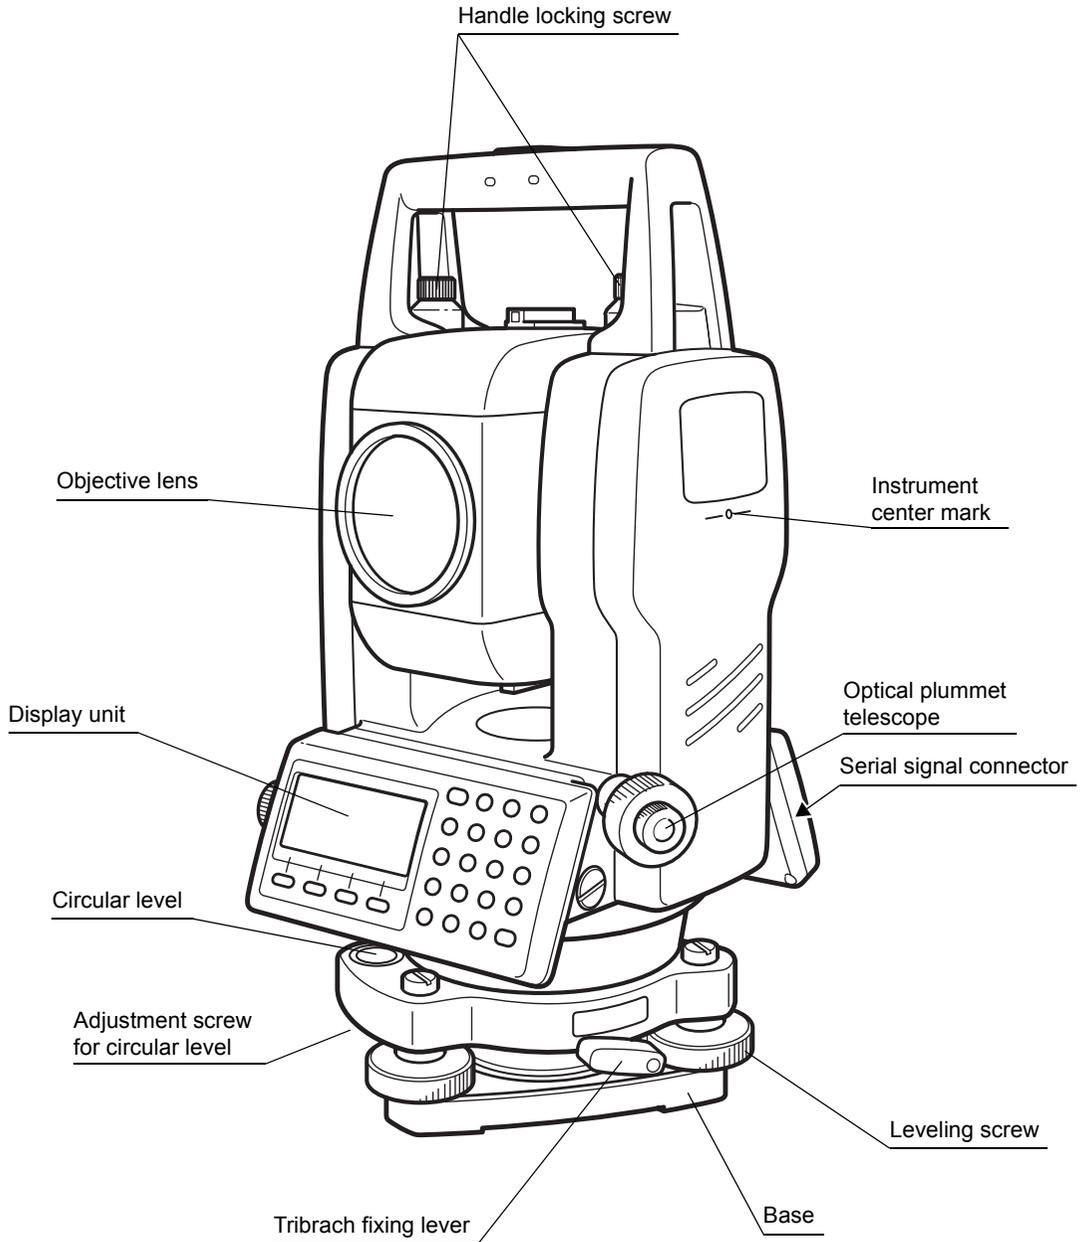

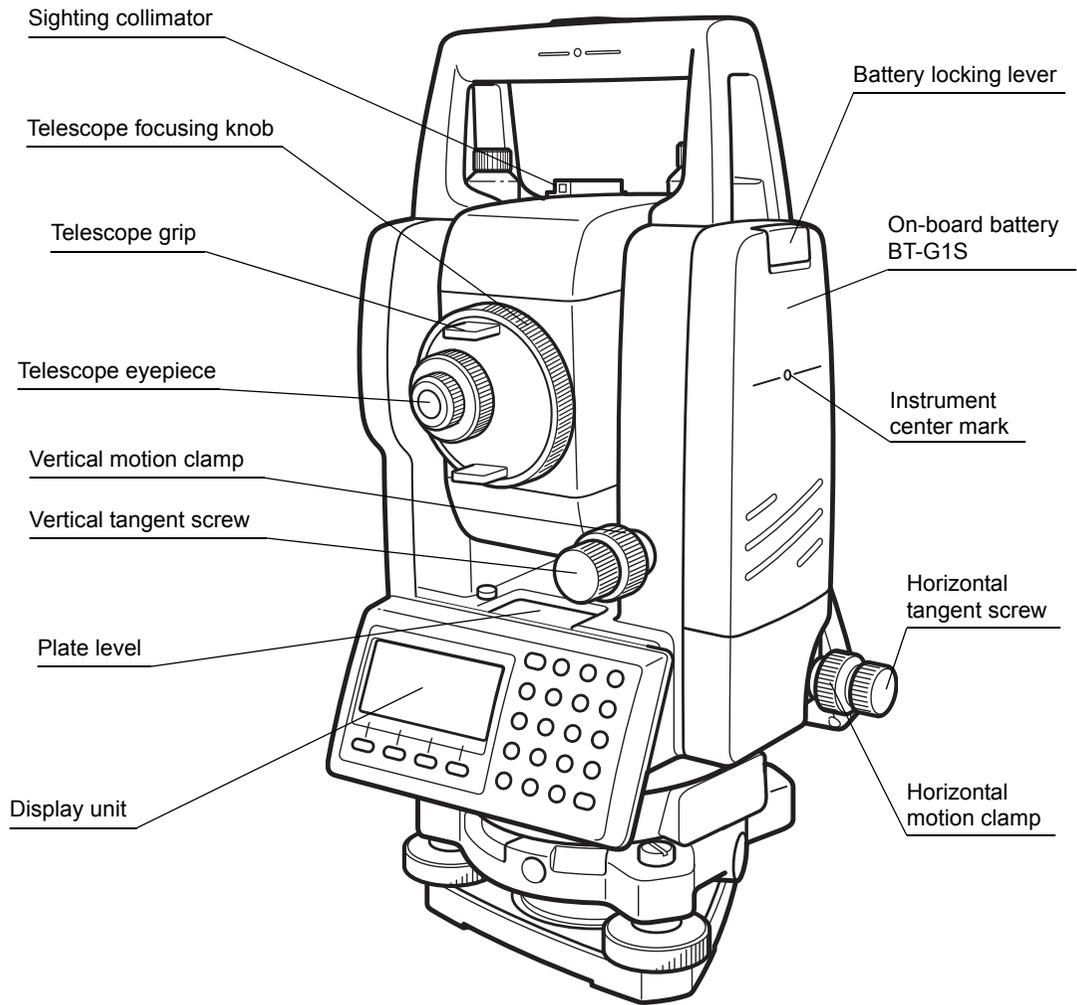

1.2 Display

- **Display**

The display uses a dot matrix LCD which has 4 lines and 20 characters per line. In general, the upper three lines display measured data, and the bottom line displays the soft key function which changes with the measuring mode.

- **Contrast and Illumination**

The contrast and illumination of display window are adjusted. see Chapter 6 "SPECIAL MODE (Menu Mode)". or section 1.5 "Star key mode".

- **Heater (Automatic)**

The built-in automatic heater functions when the temperature is below 0°C. This keeps the display's speed up at temperatures lower than 0°C. To set the heater ON/OFF, see section 6.4.5 "Heater ON/OFF". The operating time will become short if a heater is used.

- **Example**

```
V : 90°10'20"
HR: 120°30'40"

OSET HOLD HSET P1↓
```

Angle measurement mode

V-angle : 90°10'20"
H-angle : 120°30'40"

Feet unit

```
HR: 120°30'40"
HD* 123.45 f
VD: 12.34 f
MEAS MODE S/A P1↓
```

Horizontal-angle : 120°30'40"
Horizontal distance : 123.45ft
Relative elevation : 12.34ft

```
HR: 120°30'40"
HD* 65.432 m
VD: 12.345 m
MEAS MODE S/A P1↓
```

Distance measurement mode

Horizontal-angle : 120°30'40"
Horizontal distance : 65.432m
Relative elevation : 12.345m

Feet and inch unit


```
HR: 120°30'40"
HD* 123.04.6 f
VD: 12.03.4 f
MEAS MODE S/A P1↓
```

Horizontal-angle : 120°30'40"
Horizontal distance : 123ft4in6/8in
Relative elevation : 12ft3in4/8in

- **Display marks**

Display	Contents	Display	Content
V	V-angle	*	EDM working
HR	H-angle right	m	Meter unit
HL	H-angle left	f	Feet and inch unit
HD	Horizontal distance		
VD	Relative elevation		
SD	Slope distance		
N	N coordinate		
E	E coordinate		
Z	Z coordinate		


1.3 Operating Key

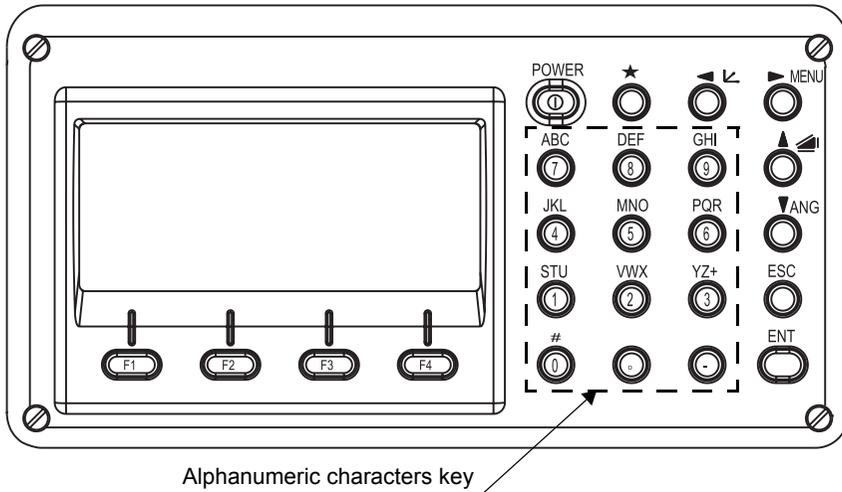

Keys	Name of Key	Function
★	Star key	Star key mode is used for each presetting or displaying as follows. 1 Contrast of the display 2 Reticle illumination 3 Back Light 4 Tilt correction 5 Set audio mode
	Coordinate meas.key	Coordinate measurement mode
	Distance meas.key	Distance measurement mode.
ANG	Angle meas.key	Angle measurement mode
POWER	Power source key	ON/OFF of power source
MENU	Menu key	Switches menu mode and normal mode. To set application measurements and adjust in the menu mode.
ESC	Escape key	<ul style="list-style-type: none"> Returning to the measurement mode or previous layer mode from the mode set. To be DATA COLLECTION mode or LAYOUT mode directly from the normal measurement mode. It is also possible to use as Record key in normal measurement mode. To select function of Escape key, see Chapter 16 “SELECTING MODE”.
ENT	Enter key	Press at the end of inputting values.
F1–F4	Soft key (Function key)	Responds to the message displayed.

1.4 Function Key (Soft Key)

The Soft Key message is displayed at the bottom line of display. The functions are according to the displayed message.

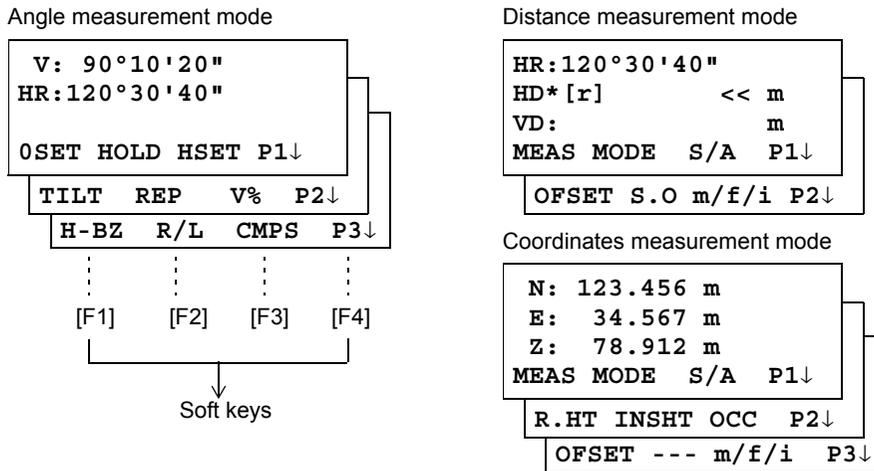

Angle measurement

Page	Soft key	Display mark	Function
1	F1	0SET	Angle of Horizontal is set to 0°00'00"
	F2	HOLD	Hold the horizontal angle
	F3	HSET	Sets a required horizontal angle by entering numerals.
	F4	P1↓	The function of soft keys is shown on next page (P2).
2	F1	TILT	Setting Tilt Correction If ON, the display shows tilt correction value.
	F2	REP	Repetition angle measurement mode
	F3	V%	Vertical angle percent grade(%) mode
	F4	P2↓	The function of soft keys is shown on next page (P3).
3	F1	H-BZ	Sets the buzzer sound for every horizontal angle 90°
	F2	R/L	Switches R/L rotation of horizontal angle.
	F3	CMPS	Switches the COMPASS ON/OFF of vertical angle.
	F4	P3↓	The function of soft keys is shown on next page (P1).

Distance measurement mode

1	F1	MEAS	Start measuring
	F2	MODE	Sets a measuring mode, Fine/Coarse/Tracking
	F3	S/A	Select set audio mode
	F4	P1↓	The function of soft keys is shown on next page (P2).
2	F1	OFSET	Select Off-set measurement mode
	F2	S.O	Select stake out measurement mode
	F3	m/f/i	Switches meter, feet or feet and inch unit.
	F4	P2↓	The function of soft keys is shown on next page (P1).

Coordinate measurement mode

1	F1	MEAS	Start measuring
	F2	MODE	Sets a measuring mode, Fine/Coarse/Tracking
	F3	S/A	Select set audio mode
	F4	P1↓	The function of soft keys is shown on next page (P2).
2	F1	R.HT	Sets a prism height by input values.
	F2	INSHT	Sets an instrument height by input values.
	F3	OCC	Sets an instrument coordinate point by input values.
	F4	P2↓	The function of soft keys is shown on next page (P3).
3	F1	OFSET	Select Off-set measurement mode
	F3	m/f/i	Switches meter, feet or feet and inch unit.
	F4	P3↓	The function of soft keys is shown on next page (P1).

1.5 Star key mode

Press the (★) key to view the instrument options.

The following instrument options can be selected from the (★):


1. Adjustment the contrast of the display (0 to 9 steps) [▲ or ▼]
2. Adjustment the reticle illumination (1 to 9 steps) [◀ or ▶]
3. Turn the backlight of the display ON/OFF [F1]
4. Setting Tilt Correction [F2]
5. S/A (set audio) mode [F4]

Note: Star key mode does not function when the same function as the function assigned to the star key mode is performed from the main routine.

```
V : 77°42'30"
HR : 120°30'40"

OSET HOLD HSET P1↓
```

Press the star (★) key.

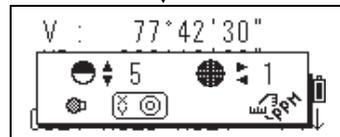

key	Display mark	Function
F1		Turn the backlight of the display ON/OFF
F2		Setting Tilt Correction If ON, the display shows tilt correction value.
F4		The light acceptance quantity level for the EDM (SIGNAL), the atmospheric correction value (PPM) and correction value of prism constant (PSM) are displayed.
▲ or ▼		Adjust the contrast of the display (0 to 9 steps)
◀ or ▶		Adjust the Reticle Illumination (1 to 9 steps) ON/OFF of the reticle illumination is linked with ON/OFF of the backlight.

- **Adjustment the contrast (0 to 9) of the display**
This enable you to adjust the contrast of the display.
Press the up or down arrow keys to adjust the contrast.
- **Adjustment the reticle illumination (1 to 9)**
This enable you to adjust the reticle illumination.
- **Turn the display back light ON/OFF**
To turn the back light ON, press the [F1] key. Press [F1] again to turn the back light OFF.
- **Tilt correction**
The tilt setting mode performed here will not be memorized after powering OFF. To set TILT correction in the initialized setting (it is memorized after powering OFF), see Section 6.4.3 "Vertical and Horizontal Angle Tilt correction (Tilt ON/OFF)".
- **Set audio mode**
The light acceptance quantity level (Signal level) is displayed in this mode.
When reflected light from the prism is received, a buzzer sounds. This function is good for easy collimation when the target is difficult to find.
Press the [F4] key to view the set audio screen.
(1) To stop the buzzer, refer to Chapter 16 "SELECTING MODE".
(2) Also, it is possible to display the signal level in Distance Measuring Mode.

The temperature, pressure, PPM, and PSM can be viewed in set audio mode.
Refer to Chapter 10 "SET AUDIO MODE", Chapter 11 "SETTING THE PRISM CONSTANT VALUE" and Chapter 12 "SETTING ATMOSPHERIC CORRECTION", for further instructions.

1.6 Serial signal RS-232C connector

The serial signal connector is used for connecting the SET with a computer or TOPCON Data Collector, which enables the computer to receive measured data from the SET or to send preset data of horizontal angle, etc. to it.

- The following data will be output at each mode.

Mode	Output
Angle mode (V, HR or HL)	V, HR (or HL)
Horizontal distance mode (HR, HD, VD)	V, HR, HD, VD
Slope distance mode (V, HR, SD)	V, HR, SD, HD
Coordinate mode	N, E, Z, HR (or V, HR, SD, N, E, Z)

- The display and the output at the coarse mode are the same as the contents above.
- Output at the tracking mode is displayed as distance data only.

The details necessary for the connection with the SET is obtained from its Interface Manual which is optionally available. Please refer to the manual.

2 PREPARATION FOR MEASUREMENT

2.1 Setting Instrument Up For Measurement

Mount the instrument to the tripod. Level and center the instrument precisely to insure the best performance. Use tripods with a tripod screw of W5/8-11 (JIS B 7907: 2002).

Reference: Leveling and Centering the Instrument

1. Setting up the Tripod


First, extend the extension legs to suitable lengths and tighten the screws on their midsections.

2. Attaching the Instrument on the Tripod Head

Place the instrument carefully on the tripod head and slide the instrument by loosening the tripod screw. If the plumb bob is positioned right over the center of the point, slightly tighten the tripod screw.

3. Roughly Leveling the Instrument by Using the Circular Level


- Turn the leveling screws A and B to move the bubble in the circular level. The bubble is now located on a line perpendicular to a line running through the centers of the two leveling screws being adjusted.

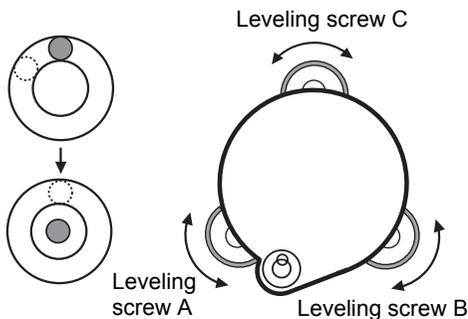


- Turn the leveling screw C to bring the bubble to the center of the circular level.

4. Centering by Using the Plate Level

- Rotate the instrument horizontally by using the Horizontal motion/clamp screw and place the plate level parallel with the line connecting leveling screws A and B, and then bring the bubble to the center of the plate level by turning leveling screws A and B.

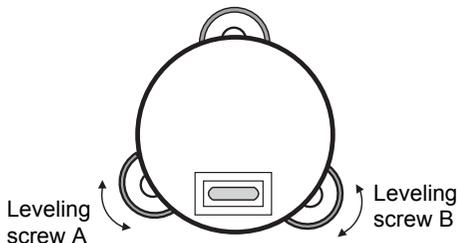

- Rotate the instrument 90° (100g) around its vertical axis and turn the remaining leveling screw or C to center the bubble once more.

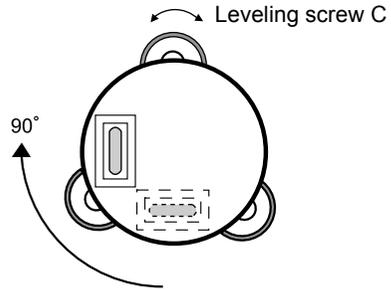


- Repeat the procedures 1 and 2 for each 90° (100g) rotation of the instrument and check whether the bubble is correctly centered for all four points.

5. Centering by Using the Optical Plummet Telescope

Adjust the eyepiece of the optical plummet telescope to your eyesight.

Slide the instrument by loosening the tripod screw, place the point on the center mark, and then tighten the tripod screw. Sliding the instrument carefully not to rotate that allows you to get the least dislocation of the bubble.

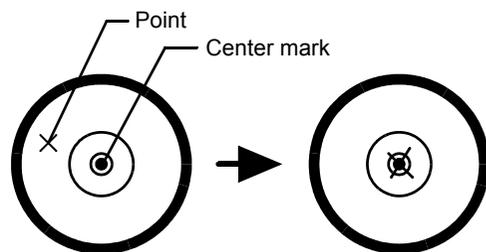


6. Completely Leveling the Instrument


Leveling the instrument precisely in a similar way to 4. Rotate the instrument and check to see that the bubble is in the center of the plate level regardless of telescope direction, then tighten the tripod screw hard.

2.2 Power Switch Key ON

- 1 Confirm the instrument is leveled.
- 2 Turn the power switch ON.

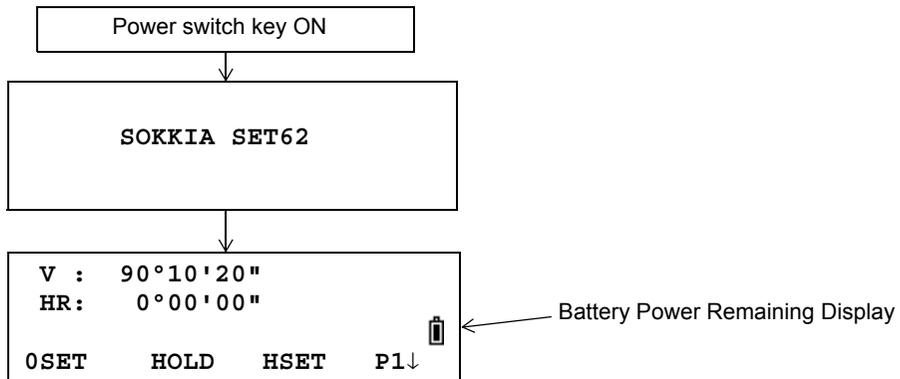


- Confirm the battery power remaining display. Replace with charged battery or charge when battery level is low or indicates "Battery empty". see Section 2.3 "Battery Power Remaining Display".
- **Contrast adjustment**
You can confirm prism constant value (PSM) , atmospheric correction value (PPM) and you can also adjust the contrast of the display when the instrument is turned on.
To display this screen, see Chapter 16 "SELECTING MODE".

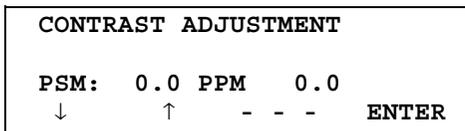

This enables you to adjust the brightness by pressing the [F1](↓) or [F2](↑) key.
To memorize the setting value after powering off, press [F4](ENTER) key.

2.3 Battery Power Remaining Display

Battery power remaining display indicates the power condition.

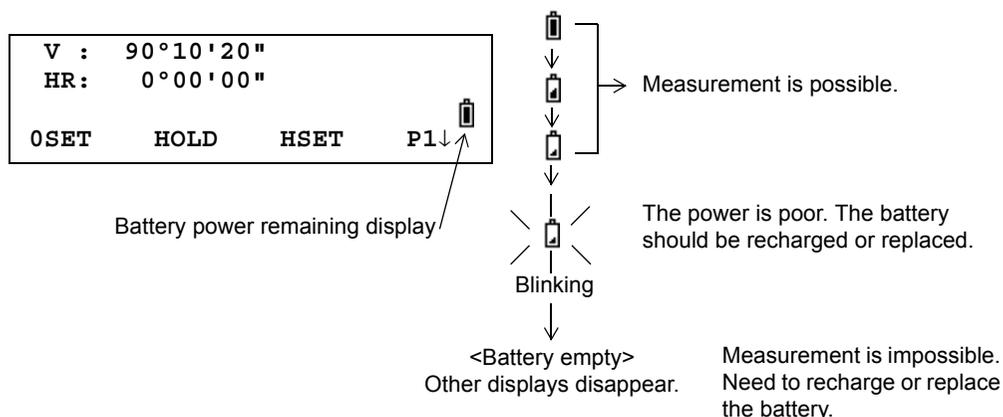


- Note:
- 1 The battery operating time will vary depending on the environmental conditions such as ambient temperature, charging time, the number of times of charging and discharging etc. It is recommended for safety to charge the battery beforehand or to prepare spare full charged batteries.
 - 2 For general usage of the battery, see Chapter 14 "POWER SOURCE AND CHARGING".
 - 3 The battery power remaining display shows the power level regarding to the measurement mode now operating.
The safety condition indicated by the battery power remaining display in the angle measurement mode does not necessarily assure the battery's ability to be used in the distance measurement mode.
It may happen that the mode change from the angle mode to the distance mode will stop the operation because of insufficient battery power for the distance mode which consumes more power than angle mode.

2.4 Vertical and Horizontal Angle Tilt Correction


When the tilt sensors are activated, automatic correction of vertical and horizontal angle for mislevelment is displayed.

To ensure a precise angle measurement, tilt sensors must be turned on. The display can also be used to fine level the instrument. If the (TILT OVER) display appears the instrument is out of automatic compensation range and must be leveled manually.

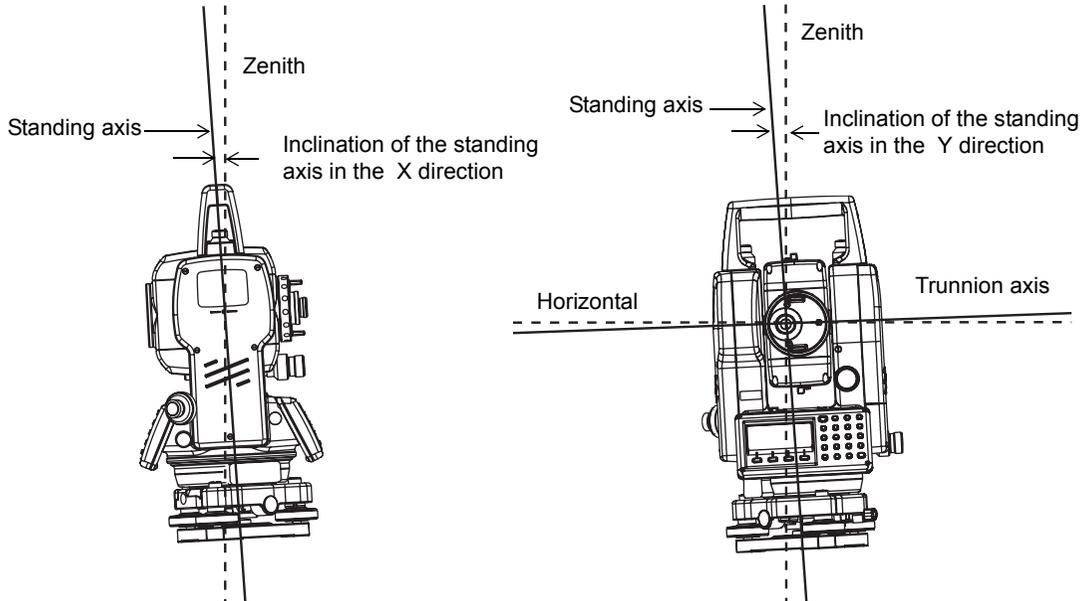

- SET compensates both the vertical angle and the horizontal angle readings due to inclination of the standing axis in the X and Y directions .
- For more information about dual axis compensation, refer to APPENDIX 1 “Dual Axis Compensation”.

When the instrument is out of compensation. (TILT OVER)

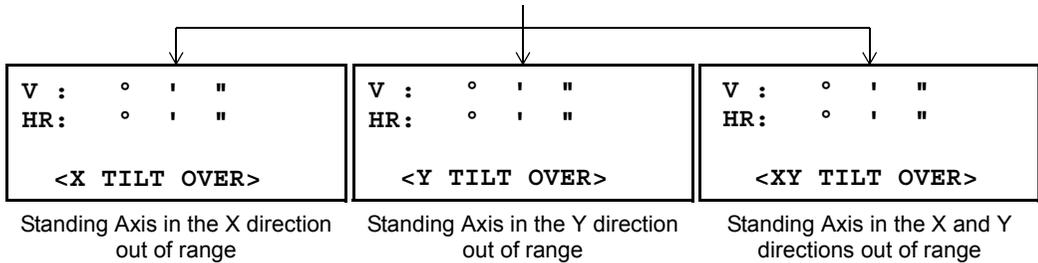

- To set auto tilt correction from the moment that power is on, see Section 6.4.3 “Vertical and Horizontal Angle Tilt correction (Tilt ON/OFF)”.
- The display of Vertical or Horizontal angle is unstable when instrument is on an unstable stage or a windy day. You can turn off the auto tilt correction function of V/H angle in this case.

- **Setting Tilt Correction by Soft Key**

To enable you to select tilt ON/OFF function. setting is not memorized after power is OFF.

[Example] Setting X Tilt OFF

Operating procedure	Option	Display
1 Press [F4] key to get the function page 2.	[F4]	<pre>V : 90°10'20" HR: 120°30'40" 0SET HOLD HSET P1↓ TILT REP V% P2↓</pre>
2 Press [F1](TILT) key. In case ON is already selected, the display shows tilt correction value.	[F1]	<pre>TILT SENSOR: [X-ON] X: -0°00'25" X-ON XY-ON OFF ---</pre>
3 Press [F3](OFF) key.	[F3]	<pre>TILT SENSOR: [OFF] X-ON XY-ON OFF ---</pre>
4 Press [ESC] key.	[ESC]	<pre>V : 90°10'20" HR: 120°30'40" 0SET HOLD HSET P1↓</pre>
<ul style="list-style-type: none"> ● The setting mode performed here will not be memorized after powering OFF. To set TILT correction in the initialized setting (it is memorized after powering OFF), see Section 6.4.3 "Vertical and Horizontal Angle Tilt correction (Tilt ON/OFF)". 		

2.5 How to Enter Alphanumeric characters

This enables you to enter alphanumeric characters such as the instrument height, prism height, occupied point, backsight point etc.

2.5.1 How to Enter Alphanumeric Characters



- **How to select a item**

[Example setting] Occupied point in the data collection mode.

The arrow indicates a item to enter.

The arrow line moves up or down when the [▼] key or [▲] key is pressed.

[▼]
or
[▲]

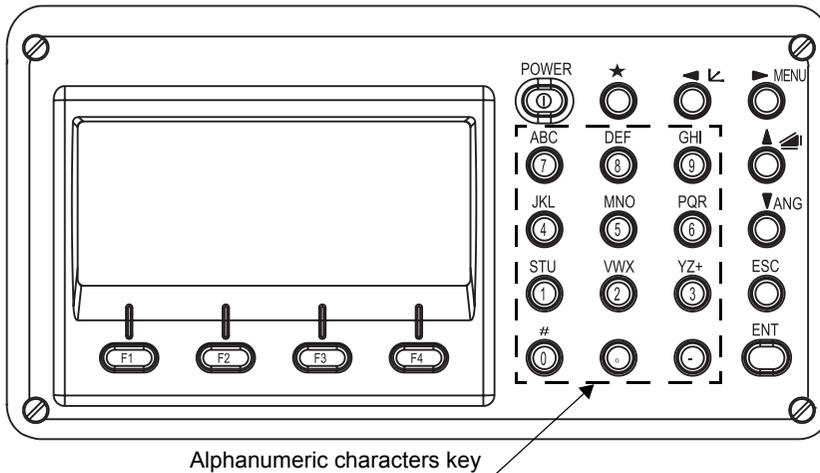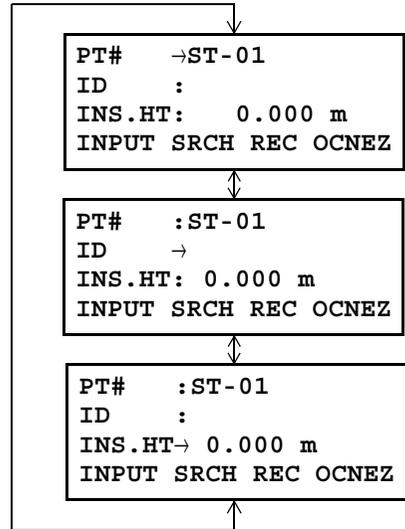

- **How to enter characters**

[Example setting] SOKKIA-1

- 1 Move the arrow to enter a item using the [▼] or [▲] key.

```
PT#   →
ID    :
INS.HT: 0.000 m
INPUT SRCH REC OCNEZ
```

- 2 Press the [F1] (INPUT) key.
The arrow changes to the equal (=).
The instrument switches to numerical input mode.

```
PT#   =
ID    :
INS.HT: 0.000 m
[ALP] [SPC] [CLR] [ENT]
```

- 3 Press the [F1] [ALP] key.
The instrument switches to alphabetical input mode.

```
PT#   =
ID    :
INS.HT: 0.000 m
[NUM] [SPC] [CLR] [ENT]
```

- 4 Enter letters of the alphabet by pressing the alphanumeric characters key.
Example: [1] (STU) key is pressed once.

```
PT#   =S
ID    :
INS.HT: 0.000 m
[NUM] [SPC] [CLR] [ENT]
```

- 5 Enter other letters of the alphabet in the same way.

```
PT#   =SOKKIA
ID    :
INS.HT: 0.000 m
[NUM] [SPC] [CLR] [ENT]
```

- 6 Press the [F1] (NUM) key, again.
The instrument switches back to numerical input mode.

```
PT#   =SOKKIA
ID    :
INS.HT: 0.000 m
[ALP] [SPC] [CLR] [ENT]
```

- 7 Enter numbers by pressing the alphanumeric characters key.

Example: [-], [1] key is pressed.

```
PT#   =SOKKIA-1
ID    :
INS.HT: 0.000 m
[ALP] [SPC] [CLR] [ENT]
```

- 8 Press [F4](ENT) key.
The arrow moves to next item.

Select next character in the same manner.

```
PT#   =SOKKIA-1
ID    →
INS.HT: 0.000 m
[NUM] [SPC] [CLR] [ENT]
```

- To correct a character, move the cursor to correct character by pressing [◀] or [▶] key and enter again.

3 ANGLE MEASUREMENT

3.1 Measuring Horizontal Angle Right and Vertical Angle


Make sure the mode is in Angle measurement.

Operating procedure	Operation	Display
1 Collimate the 1st target (A).	Collimate A	V : 90°10'20" HR: 120°30'40" 0SET HOLD HSET P1↓
2 Set horizontal angle of target A at 0° 00' 00". Press the [F1](0 set) key and press the [F3](YES) key.	[F1]	H ANGLE 0 SET > OK? --- --- [YES] [NO]
	[F3]	V : 90°10'20" HR: 0°00'00" 0SET HOLD HSET P1↓
3 Collimate the 2nd target (B). The required V/H angle to target B will be displayed.	Collimate B	V : 98°36'20" HR: 160°40'20" 0SET HOLD HSET P1↓

Reference: How to Collimate

- 1 Point the telescope toward the light. Turn the diopter ring and adjust the diopter so that the cross hairs are clearly observed.
(Turn the diopter ring toward you first and then backward to focus.)
- 2 Aim the target at the peak of the triangle mark of the sighting collimator. Allow a certain space between the sighting collimator and yourself for collimating.
- 3 Focus the target with the focusing knob.

*If parallax is created between the cross hairs and the target when viewing vertically or horizontally while looking into the telescope, focusing is incorrect or diopter adjustment is poor. This adversely affects precision in measurement or survey. Eliminate the parallax by carefully focusing and using diopter adjustment.

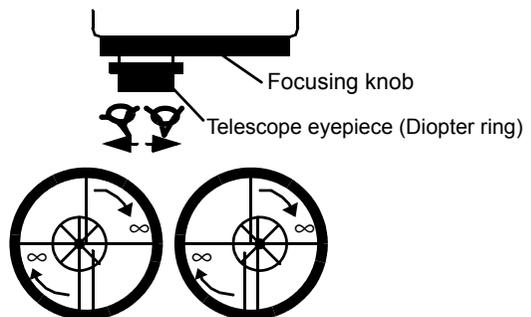

3.2 Switching Horizontal Angle Right/Left

Make sure the mode is Angle measurement.

Operating procedure	Operation	Display
1 Press the [F4](↓) key twice to get the function on page 3.	[F4] twice	<div style="border: 1px solid black; padding: 2px;"> V : 90°10'20" HR: 120°30'40" 0SET HOLD HSET P1↓ TILT REP V% P2↓ H-BZ R/L CMPS P3↓ </div>
2 Press the [F2](R/L) key. The mode Horizontal angle Right (HR) switches to Left (HL) mode.	[F2]	<div style="border: 1px solid black; padding: 2px;"> V : 90°10'20" HL: 239°29'20" H-BZ R/L CMPS P3↓ </div>
3 Measure as HL mode.		
<ul style="list-style-type: none"> • Every time pressing the [F2](R/L) key, HR/HL mode switches. 		

3.3 Measuring from the Required Horizontal Angle

3.3.1 Setting by Holding the Angle

Make sure the mode is angle measurement.

Operating procedure	Operation	Display
1 Set the required horizontal angle, using Horizontal tangent screw.	Display angle	<div style="border: 1px solid black; padding: 2px;"> V : 90°10'20" HR: 130°40'20" 0SET HOLD HSET P1↓ </div>
2 Press the [F2](HOLD) key.	[F2]	<div style="border: 1px solid black; padding: 2px;"> H ANGLE HOLD HR= 130°40'20" > SET ? --- --- [YES] [NO] </div>
3 Collimate the target.	Collimate	
4 Press the [F3](YES) key to finish holding the horizontal angle.*1) The display turns back to normal angle measurement mode.	[F3]	<div style="border: 1px solid black; padding: 2px;"> V : 90°10'20" HR: 130°40'20" 0SET HOLD HSET P1↓ </div>
<p>*1) To return to the previous mode, press the [F4](NO) key.</p>		

3.3.2 Setting a Horizontal Angle from the Keys

Make sure the mode is Angle measurement.

Operating procedure	Operation	Display
1 Collimate the target.	Collimate	V : 90°10'20" HR: 170°30'20" 0SET HOLD HSET P1↓
2 Press the [F3](HSET) key.	[F3]	H ANGLE SET HR= --- --- [CLR] [ENT]
3 Input the required horizontal angle by using keys. *1) For example: 70°40'20" When completed, normal measuring from the required Horizontal angle is possible.	70.4020 [F4]	V : 90°10'20" HR: 70°40'20" 0SET HOLD HSET P1↓
*1) To enter Alphanumeric characters, see Section 2.5 "How to Enter Alphanumeric characters".		

3.4 Vertical Angle Percent Grade(%) Mode

Make sure the mode is Angle measurement.

Operating procedure	Operation	Display
1 Press the [F4](↓) key to get the function on page 2.	[F4]	V : 90°10'20" HR: 170°30'20" 0SET HOLD HSET P1↓ TILT REP V% P2↓
2 Press the [F3](V%) key. *1)	[F3]	V : -0.30 % HR: 170°30'20" TILT REP V% P1↓
*1) Every time pressing the [F3](V%) key, the display mode switches. ● When the measurement is carried out over ±45° (±100%) from the horizontal, the display shows <OVER>.		

3.5 Repetition Angle Measurement

- Repetition angle measurement can be done by horizontal angle right measurement mode.

Make sure the mode is Horizontal Angle Right measurement.

Operating procedure	Operation	Display
1 Press the [F4](↓) key to get the function on page 2.	[F4]	<pre>V : 90°10'20" HR: 170°30'20" 0SET HOLD HSET P1↓ TILT REP V% P2↓</pre>
2 Press the [F2](REP)key.	[F2]	<pre>REPETITION ANGLE > OK? --- --- [YES] [NO]</pre>
3 Press the [F3](YES) key.	[F3]	<pre>REP-ANGLE COUNT [0] Ht: 0°00'00" Hm: 0SET V/H REL HOLD</pre>
4 Collimate the target A and press the [F1] (0SET) key.	Collimate A [F1]	<pre>REPETITION ANGLE INITIALIZE > OK? --- --- [YES] [NO]</pre>
5 Press the [F3] (YES) key.	[F3]	<pre>REP-ANGLE COUNT [0] Ht: 0°00'00" Hm: 0SET V/H REL HOLD</pre>
6 Collimate the target B using the horizontal clamp and tangent screw. Press the [F4](HOLD) key.	Collimate B [F4]	<pre>REP-ANGLE COUNT [1] Ht: 45°10'00" Hm: 45°10'00" 0SET V/H REL HOLD</pre>
7 Recollimate target A using the horizontal clamp and tangent screw, and press the [F3](REL)key.	Collimate A [F3]	<pre>REP-ANGLE COUNT [1] Ht: 45°10'00" Hm: 45°10'00" 0SET V/H REL HOLD</pre>
8 Recollimate target B using the horizontal clamp and tangent screw, and press the [F4](HOLD) key.	Collimate B [F4]	<pre>REP-ANGLE COUNT [2] Ht: 90°20'00" Hm: 45°10'00" 0SET V/H REL HOLD</pre>
9 Repeat 7 to 8 to measure the desired number of repetitions.		<pre>REP-ANGLE COUNT [4] Ht: 180°40'00" Hm: 45°10'00" 0SET V/H REL HOLD</pre>
		[Example] 4 measurement

<p>10 To return to the normal angle mode, press the [F2](V/H) key or [ESC] key.</p>	<p>[ESC] or [F2]</p>	<pre> REPETITION ANGLE Exit > OK? --- --- [YES] [NO] </pre>
<p>11 Press the [F3](YES) key.</p>	<p>[F3]</p>	<pre> V : 90°10'20" HR: 170°30'20" 0SET HOLD HSET P1↓ </pre>
<ul style="list-style-type: none"> Horizontal angle can be accumulated up to (3600°00'00" – minimum reading) (horizontal angle right). In case of 5 second reading, horizontal angle can be accumulated up to +3599°59'55". Error will be displayed when the results differ from first measurement by more than ±30". 		

3.6 Buzzer Sounding for Horizontal Angle 90° Increments

When the horizontal angle falls in the range of less than $\pm 1^\circ$ of 0° , 90° , 180° or 270° , the buzzer sounds. Buzzer stops only when the horizontal angle is adjusted to $0^\circ00'00''$, $90^\circ00'00''$, $180^\circ00'00''$ or $270^\circ00'00''$.


This setting is not memorized after powering off. Refer to 16 "SELECTING MODE" to set the initial setting (memorized after powering off).

Make sure the mode is Angle measurement.

Operating procedure	Operation	Display
<p>1 Press the [F4](↓) key twice to get the function on page 3.</p>	<p>[F4] twice</p>	<pre> V : 90°10'20" HR: 170°30'20" 0SET HOLD HSET P1↓ H-BZ R/L CMPS P3↓ </pre>
<p>2 Press the [F1](H-BZ) key. The data previously set is shown.</p>	<p>[F1]</p>	<pre> H-ANGLE BUZZER [OFF] [ON] [OFF] --- ENTER </pre>
<p>3 Press the [F1](ON) key or [F2](OFF) key to select the buzzer ON/OFF.</p>	<p>[F1] or [F2]</p>	<pre> H-ANGLE BUZZER [ON] [ON] [OFF] --- ENTER </pre>
<p>4 Press the [F4](ENTER) key.</p>	<p>[F4]</p>	<pre> V : 90°10'20" HR: 170°30'20" 0SET HOLD HSET P1↓ </pre>

3.7 Compasses (vertical angle)

Vertical angle is displayed as shown below.

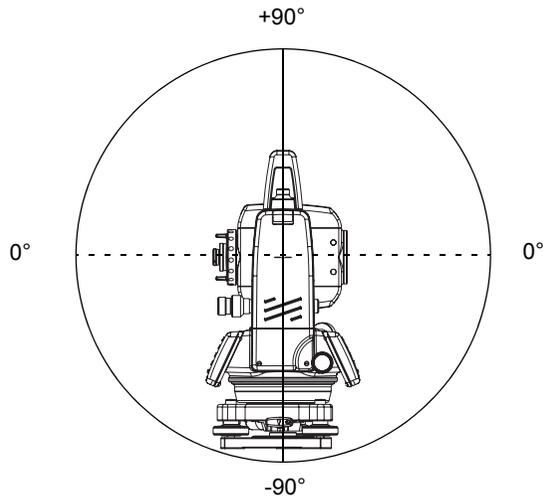

Operating procedure	Operation	Display
<p>1 Press the [F4](↓) key twice to get the function on page 3.</p>	[F4] twice	<div style="border: 1px solid black; padding: 5px;"> V : 98°10'20" HR: 170°30'20" 0SET HOLD HSET P1↓ H-BZ R/L CMPS P3↓ </div>
<p>2 Press the [F3](CMPS) key. *1)</p>	[F3]	<div style="border: 1px solid black; padding: 5px;"> V : - 8°10'20" HR: 170°30'20" H-BZ R/L CMPS P3↓ </div>
<p>*1) Every time pressing the [F3](CMPS) key, the display mode switches.</p>		

4 DISTANCE MEASUREMENT

4.1 Setting of the Atmospheric Correction

When setting the atmospheric correction, obtain the correction value by measuring the temperature and pressure. Refer to Section 12.2 "Setting of Atmospheric Correction Value".

4.2 Setting of the Correction for Prism Constant

Set the prism constant correction value of the prism used to the SET beforehand. Refer to Chapter 11 "SETTING THE PRISM CONSTANT VALUE". The setting value is kept in the memory even after power is off.

4.3 Distance Measurement (Continuous Measurement)

Make sure the mode displays angle measurement.

Operating procedure	Operation	Display
<p>1 Collimate the center of prism.</p>	Collimate P	<pre>V : 90°10'20" HR:120°30'40" 0SET HOLD HSET P1↓</pre>
<p>2 Press the  key. Distance measurement starts. *1), 2)</p> <p>The measured distances are shown. *3)~*5)</p>		<pre>HR: 120°30'40" HD* [r] << m VD: m MEAS MODE S/A P1↓</pre> <p style="text-align: center;">↓</p> <pre>HR: 120°30'40" HD* 123.456 m VD: 5.678 m MEAS MODE S/A P1↓</pre>
<p>● Pressing the  key again, the display changes to horizontal (HR) and vertical (V) angle and slope distance (SD). *6)</p>		<pre>V : 90°10'20" HR: 120°30'40" SD* 131.678 m MEAS MODE S/A P1↓</pre>
<p>*1) When EDM is working, the "*" mark appears in the display. *2) To change mode from Fine to Coarse or Tracking, refer to section 4.5 "Fine Mode/Tracking Mode/Coarse Mode". To set the distance measurement when the instrument is powered on, refer to Chapter 16 "SELECTING MODE". *3) The distance unit indicator "m" (for meter), "f" (for feet or feet inch) appears and disappears alternatively with buzzer sounds at every renewal of distance data. *4) Measurement may repeat automatically in the instrument if the result is affected by shimmer etc. *5) To return to the normal measuring angle mode from a distance measuring mode, press the [ANG] key. *6) It is possible to choose the display order (HR, HD, VD) or (V, HR, SD) for initial measuring distance mode. Refer to Chapter 16 "SELECTING MODE".</p>		

4.4 Distance Measurement (N-time Measurement/Single Measurement)

When the number of times measurement is preset, the SET measures the distance the set number of times. The average distance will be displayed.

When presetting the number of times as 1, it does not display the average distance, because of single measurement. Single measurement is set at the factory.

Make sure the mode displays angle measurement.

Operating procedure	Operation	Display
1 Collimate the center of prism.		V : 90°10'20" HR: 120°30'40" OSET HOLD HSET P1↓
2 Press the  key. Continuous measuring starts.*1)		HR: 120°30'40" HD* [r] << m VD: m MEAS MODE S/A P1↓
3 Press [F1](MEAS) key while continuous measuring is exceeding. *2) The average value is displayed and "" mark disappears.	[F1]	HR: 120°30'40" HD* [n] << m VD: m MEAS MODE S/A P1↓
<ul style="list-style-type: none"> While EDM is working, press [F1](MEAS) key again, the mode will be changed to continuous measuring mode. 		↓ HR: 120°30'40" HD: 123.456 m VD: 5.678 m MEAS MODE S/A P1↓
*1) It is possible to set the measurement mode for N-times measurement mode or continuous measurement mode when the power is turned on. Refer to Chapter 16 "SELECTING MODE". *2) For setting the number of times (N-times) in the measurement, refer to Chapter 16 "SELECTING MODE".		

● **Choose meter /feet / feet+inch unit by soft key**

It is possible to change the unit for distance measurement mode by soft key.

This setting is not memorized after power off. Refer to 16 "SELECTING MODE" to set at the initial setting (memorized after power off).

Operating procedure	Operation	Display
1 Press the [F4](P1↓) key to get the function on page 2	[F4]	<div style="border: 1px solid black; padding: 2px;"> HR: 120°30'40" HD* 2.000 m VD: 3.000 m MEAS MODE S/A P1↓ OFSET S.O m/f/i P2↓ </div>
2 Every time pressing the [F3](m/f/i) key, the display unit will be changed. ● Every time pressing the [F3](m/f/i) key, the unit mode switches.	[F3]	<div style="border: 1px solid black; padding: 2px;"> HR: 120°30'40" HD* 6.560 f VD: 9.845 f OFSET S.O m/f/i P2↓ </div>

4.5 Fine Mode/Tracking Mode/Coarse Mode

This setting is not memorized after power is off. Refer to Chapter 16"SELECTING MODE" to set at the initial setting (memorized after power is off).

- Fine Mode : This is a normal distance measuring mode.
The unit to be displayed: 0.2mm or 1mm. (0.001ft or 0.005ft)
Measurement time 0.2mm mode : approx. 2.8 sec.
1mm mode : approx. 1.2 sec.
- Tracking Mode : This mode measures in shorter time than in fine mode.
It is very useful when tailing the moving object or carrying out stake-out work.
The unit to be displayed: 10mm
Measuring time: approx. 0.4 sec.
- Coarse Mode : This mode measures in shorter time than in fine mode.
The unit to be displayed: 10mm or 1mm
Measuring time: approx. 0.7 sec.

Operating procedure	Operation	Display
1 Press the [F2](MODE) key from the distance measuring mode.*1) The initial character (F/T/C) of set mode is displayed. (F: Fine, T: Tracking, C: Coarse)	[F2]	<div style="border: 1px solid black; padding: 2px;"> HR: 120°30'40" HD* 123.456m VD: 5.678m MEAS MODE S/A P1↓ HR: 120°30'40" HD* 123.456m VD: 5.678m FINE TRACK COARSE F </div>
2 Press the [F1](FINE) key, [F2](TRACK) key, or [F3](COARSE) key.	[F1]~[F3]	<div style="border: 1px solid black; padding: 2px;"> HR: 120°30'40" HD* 123.456m VD: 5.678m MEAS MODE S/A P1↓ </div>

*1) To cancel the setting, press the [ESC] key.

4.6 Stake Out (S.O)

The difference between the measured distance and the input stake out distance is displayed.

Measured distance — Stake out distance = Displayed value

- In stake out operation, you can select either horizontal distance (HD), relative elevation (VD) and slope distance (SD)

Operating procedure	Operation	Display
1 Press the [F4](↓) key in the distance measuring mode to get the function on page 2.	[F4]	<pre>HR: 120°30'40" HD* 123.456 m VD: 5.678 m MEAS MODE S/A P1↓ OFSET S.O m/f/i P2↓</pre>
2 Press the [F2](S.O) key. The data previously set is shown.	[F2]	<pre>STAKE OUT HD : 0.000 m HD VD SD ---</pre>
3 Select the measuring mode by pressing the [F1] to [F3] key. Example: Horizontal distance	[F1]	<pre>STAKE OUT HD = 0.000 m --- --- [CLR] [ENT]</pre>
4 Enter the distance for stake out. *1)	Enter data [F4]	<pre>STAKE OUT HD : 100.000 m INPUT --- --- ENTER</pre>
5 Collimate the target (Prism). Measuring starts. The difference between the measured distance and the stake out distance is displayed.	Collimate P	<pre>HR: 120°30'40" dHD* [r] << m VD: m MEAS MODE S/A P1↓</pre> <p style="text-align: center;">↓</p> <pre>HR: 120°30'40" dHD* 23.456 m VD: 5.678 m MEAS MODE S/A P1↓</pre>
6 Move the target until the difference becomes 0m.		
<p>*1) Refer to section 2.5 "How to Enter Alphanumeric characters".</p> <ul style="list-style-type: none"> ● To return to normal distance measurement mode, stake out distance to "0" m or turn the power off. 		



4.7 Offset Measurement

There are four offset measurement modes in the Offset Measurement.


- Angle offset
- Distance offset
- Plane offset
- Column offset

To show the offset measurement menu, press the [OFFSET] soft key from distance or coordinate measurement mode.

Example:

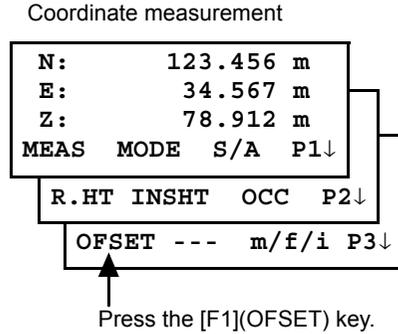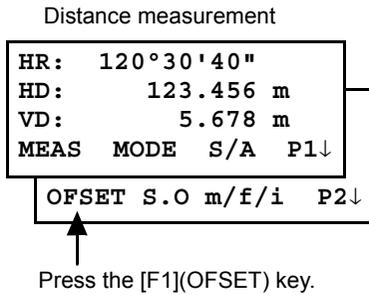

Offset Measurement Menu

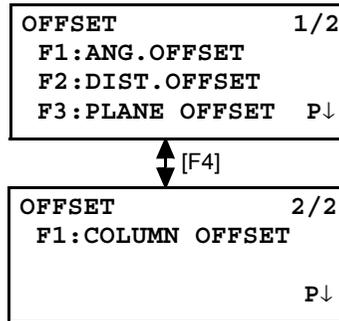


● Outputting the Measurement Data

The results of offset measurement can be output to external device.

Setting the function of the [ESC] key to (REC), the [F3] soft key which assigned (REC) will appear in measured result display.

Refer to Chapter 16 "SELECTING MODE" to set this option.

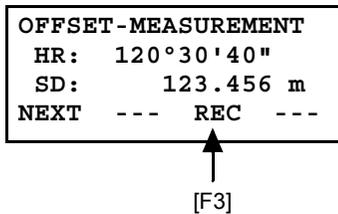


● Distance measurement mode of the offset measurement

Offset measurement will be done by N-time fine measurement mode.

For setting measuring times refer to Chapter 16 "SELECTING MODE".

4.7.1 Angle Offset

This mode is useful when it is difficult to set up the prism directly, for example at the center of a tree. Place the prism at the same horizontal distance from the instrument as that of point A₀ to measure. To measure the coordinates of the center position, operate the offset measurement after setting the instrument height/prism height.

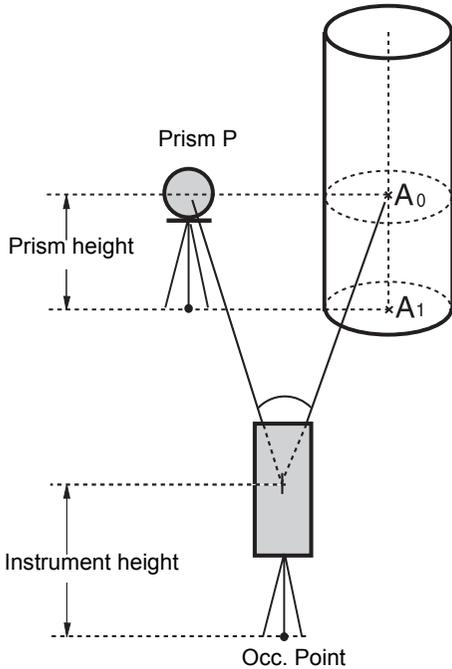

When measuring coordinates of ground point A₁:
Set the instrument height/prism height.

When measuring coordinates of point A₀: Set the instrument height only. (Set the prism height to 0).

When sighting to A₀, you can select one of two ways. One is to fix vertical angle to the prism position even updown the telescope position, and the other is to gear vertical angle to the updown of telescope movement. In case following the vertical angle to the movement of telescope, SD (Slope Distance) and VD (Vertical Distance) will be changed according to the movement of telescope. To set this option, refer to Chapter 16 "SELECTING MODE".

- Set the instrument height/prism height before proceeding to the offset measurement mode.
- When setting the coordinate value for the occupied station, refer to Section 5.1 "Setting Coordinate Values of Occupied Point".

Operating procedure	Operation	Display
1 Press the [F4](P1↓) key from distance measuring mode to get the function on page 2.	[F4]	<pre> HR: 120°30'40" HD: 123.456 m VD: 5.678 m MEAS MODE S/A P1↓ OFFSET S.O m/f/i P2↓ </pre>
2 Press the [F1](OFFSET) key.	[F1]	<pre> OFFSET 1/2 F1:ANG.OFFSET F2:DIST.OFFSET F3:PLANE OFFSET P1↓ </pre>
3 Press the [F1](ANG. OFFSET) key.	[F1]	<pre> OFFSET-MEASUREMENT HR: 120°30'40" HD: --- m MEAS --- --- --- </pre>
4 Collimate prism P, and press the [F1](MEAS) key.	Collimate P [F1]	<pre> OFFSET-MEASUREMENT HR: 110°20'30" HD* [n] << m >Measuring... </pre> <p style="text-align: center;">↓</p>

The horizontal distance from the instrument to the prism will be measured.

After measuring, the result added offset value will be shown.

5 Collimate point A_0 using the horizontal motion clamp and horizontal tangent screw.

Collimate A_0

6 Show the relative elevation of point A_0 .



7 Show the slope distance of point A_0 .



- Each time pressing the [] key, horizontal distance, relative elevation and slope distance are shown in sequence.

8 Show N coordinate of point A_0 or A_1 .



- Each time pressing [] key, N, E and Z coordinate are shown in sequence.

```

OFFSET-MEASUREMENT
HR: 110°20'30"
HD* 56.789 m
>Measuring...
    
```

```

OFFSET-MEASUREMENT
HR: 110°20'30"
HD: 56.789 m
NEXT --- --- ---
    
```

```

OFFSET-MEASUREMENT
HR: 113°30'50"
HD: 56.789 m
NEXT --- --- ---
    
```

```

OFFSET-MEASUREMENT
HR: 113°20'30"
VD: 3.456 m
NEXT --- --- ---
    
```

```

OFFSET-MEASUREMENT
HR: 113°20'30"
SD: 56.894 m
NEXT --- --- ---
    
```


```

OFFSET-MEASUREMENT
HR: 113°20'30"
N : -12.345 m
NEXT --- --- ---
    
```

- To return to procedure **4**, press [F1](NEXT) key.
- To return to the previous mode, press [ESC] key.

4.7.2 Distance Offset Measurement

The measurement of a place apart from a prism is possible by inputting offset horizontal distance of front and back/right and left.

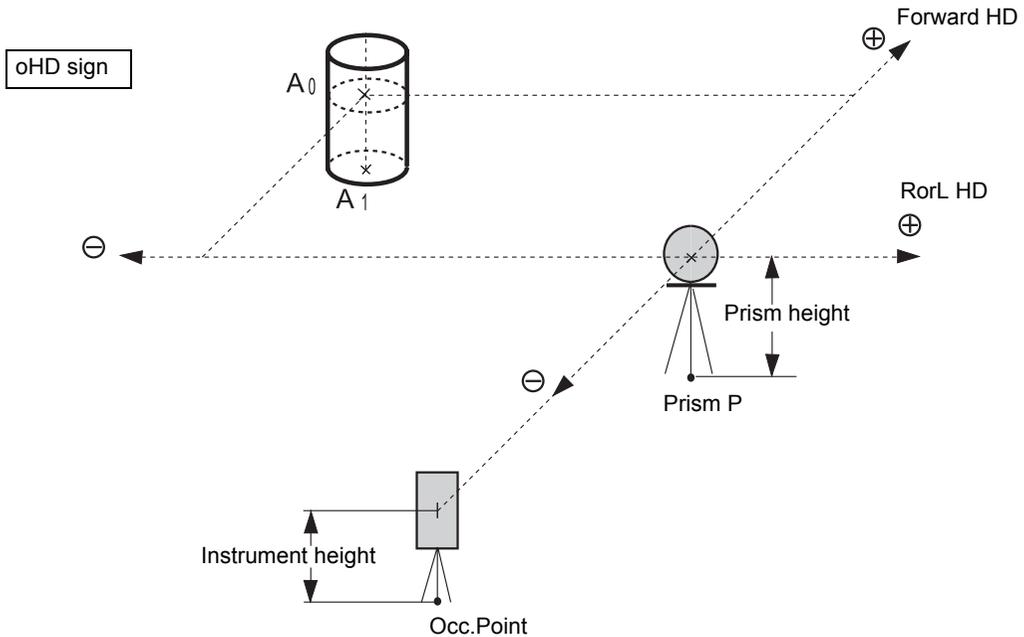

When measuring coordinates of ground point A₁: Set the instrument height/prism height.

When measuring coordinates of point A₀: Set the instrument height only.
(Set the prism height to 0).

Operating procedure	Operation	Display
1 Press the [F4](P1↓) key from distance measuring mode to get the function on page 2.	[F4]	<pre> HR: 120°30'40" HD: 123.456 m VD: 5.678 m MEAS MODE S/A P1↓ OFFSET S.O m/f/i P2↓ </pre>
2 Press the [F1](OFFSET) key.	[F1]	<pre> OFFSET 1/2 F1:ANG.OFFSET F2:DIST.OFFSET F3:PLANE OFFSET P↓ </pre>
3 Press the [F2](DIST. OFFSET) key.	[F2]	<pre> DISTANCE OFFSET INPUT RorL HD oHD= m --- --- [CLR] [ENT] </pre>
4 Enter Right and Left direction offset value, and press the [F4](ENTER) key.	Enter HD [F4]	<pre> DISTANCE OFFSET INPUT FORWARD HD oHD= m --- --- [CLR] [ENT] </pre>
5 Enter a Forward direction offset value, and press the [F4](ENTER) key.	Enter HD [F4]	<pre> DISTANCE OFFSET HR: 80°30'40" HD: m MEAS --- --- --- </pre>

6 Collimate prism P, and press the [F1](MEAS) key. Measuring will start.

After measuring, the result added offset value will be shown.

7 Show the relative elevation of point P0.
 ● Each time pressing the [▲] key, horizontal distance, relative elevation and slope distance are shown in sequence.

● Show coordinate of point P0.

Collimate P
[F1]

```
DISTANCE OFFSET
HR: 80°30'40"
HD* [n] << m
>Measuring...
```



```
DISTANCE OFFSET
HR: 80°30'40"
HD: 10.000 m
NEXT --- --- ---
```

[▲]

```
DISTANCE OFFSET
HR: 80°30'40"
VD: 11.789 m
NEXT --- --- ---
```

```
DISTANCE OFFSET
HR: 80°30'40"
SD: 11.789 m
NEXT --- --- ---
```

[↖]


```
N : 12.345 m
E : 23.345 m
Z : 1.345 m
NEXT --- --- ---
```

- To return to procedure **4**, press [F1](NEXT) key.
- To return to the previous mode, press [ESC] key.

4.7.3 Plane Offset Measurement

Measuring will be taken for the place where direct measuring can not be done, for example distance or coordinate measuring for a edge of a plane.

Three random prism points (P1, P2, P3) on a plane will be measured at first in the plane offset measurement to determine the measured plane. Collimate the measuring target point (P0) then the instrument calculates and displays coordinate and distance value of cross point between collimation axis and of the plane.

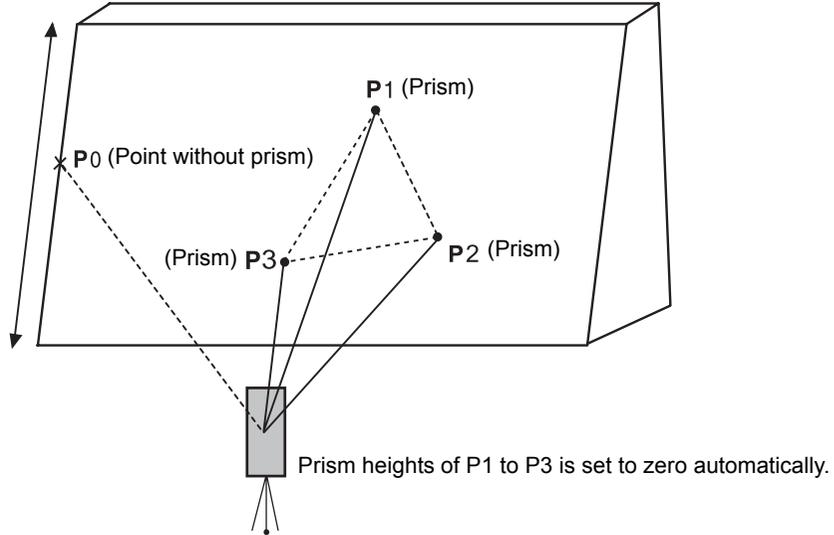


- When setting the coordinate value for the occupied station, refer to Section 5.1 "Setting Coordinate Values of Occupied Point".

Operating procedure	Operation	Display
<p>1 Press the [F4](P1↓) key from distance measuring mode to get the function on page 2.</p>	[F4]	<pre> HR: 120°30'40" HD: 123.456 m VD: 5.678 m MEAS MODE S/A P1↓ OFFSET S.O m/f/i P2↓ </pre>
<p>2 Press the [F1](OFFSET) key.</p>	[F1]	<pre> OFFSET 1/2 F1:ANG.OFFSET F2:DIST.OFFSET F3:PLANE OFFSET P↓ </pre>
<p>3 Press the [F3](PLANE OFFSET) key.</p>	[F3]	<pre> PLANE N001#: SD: m MEAS --- --- --- </pre>
<p>4 Collimate prism P1, and press the [F1](MEAS) key. N-time measuring will start. After measuring, the display will show the second point measurement.</p>	Collimate P1 [F1]	<pre> PLANE N001#: SD* [n] << m >Measuring... </pre>
<p>5 Measure the second and third points in the same way.</p>	Collimate P2 [F1]	<pre> PLANE N002#: SD: m MEAS --- --- --- </pre>

4.7.4 Column Offset Measurement

If it is possible to measure circumscription point (P1) of column directly, the distance to the center of the column (P0), coordinate and direction angle can be calculated by measured circumscription points (P2) and (P3).

The direction angle of the center of the column is 1/2 of total direction angle of circumscription points (P2) and (P3).

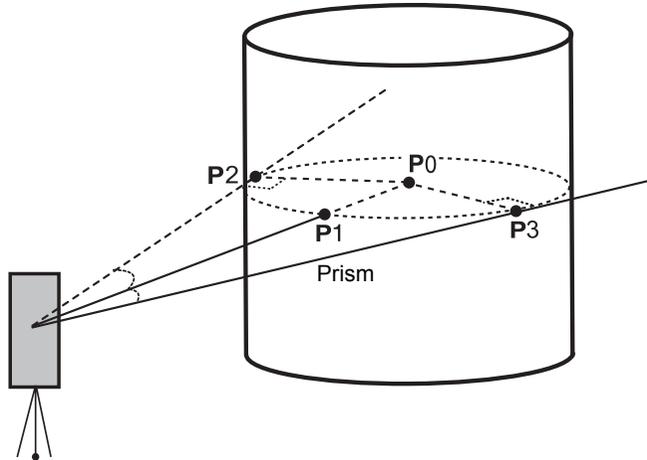

- When setting the coordinate value for the occupied station, refer to Section 5.1 "Setting Coordinate Values of Occupied Point".

Operating procedure	Operation	Display
1 Press the [F4](P1↓) key from distance measuring mode to get the function on page 2.	[F4]	<pre> HR: 120°30'40" HD: 123.456 m VD: 5.678 m MEAS MODE S/A P1↓ OFFSET S.O m/f/i P2↓ </pre>
2 Press the [F1](OFFSET) key.	[F1]	<pre> OFFSET 1/2 F1:ANG.OFFSET F2:DIST.OFFSET F3:PLANE OFFSET P↓ </pre>
3 Press the [F4](P↓) key.	[F4]	<pre> OFFSET 2/2 F1:COLUMN OFFSET P↓ </pre>
4 Press the [F1](COLUMN OFFSET) key.	[F1]	<pre> COLUMN OFFSET Center HD: m MEAS --- --- --- </pre>
5 Collimate the center of the column (P1) and press the [F1](MEAS) key. N-time measuring will start.	Collimate P1 [F1]	<pre> COLUMN OFFSET Center HD* [n] << m >Measuring... </pre> <p style="text-align: center;">↓</p>

After the measurement, angle measuring display of the left side (P2) will be shown.

- 6** Collimate the left side of the column (P2) and press the [F4](SET) key.
After the measurement, angle measuring display of the right side (P3) will be shown.

- 7** Collimate the right side of the column (P3) and press the [F4](SET) key.

The distance between the instrument and center of the column (P0) will be calculated.

- 8** To show the relative elevation (VD), press the [] key.
Each time pressing the [] key, horizontal distance, relative elevation and slope distance are shown in sequence.
- To show coordinate of point P0, press the [] key.
- 9** To escape the measuring, press the [ESC] key.
The display returns to the previous mode.

Collimate
P2
[F4]

Collimate
P3
[F4]

[]

```
COLUMN OFFSET
Left
HR: 120°30'40"
--- --- --- SET
```



```
COLUMN OFFSET
Right
HR: 180°30'40"
--- --- --- SET
```



```
COLUMN OFFSET
HR: 150°30'40"
HD: 43.321 m
NEXT --- --- ---
```


```
COLUMN OFFSET
HR: 150°30'40"
VD: 2.321 m
NEXT --- --- ---
```

5 COORDINATE MEASUREMENT

5.1 Setting Coordinate Values of Occupied Point

Set the coordinates of the instrument (occupied point) according to coordinate origin, and the instrument automatically converts and displays the unknown point (prism point) coordinates following the origin.

It is possible to retain the coordinates of the occupied point after turning the power off. Refer to Chapter 16 "SELECTING MODE".

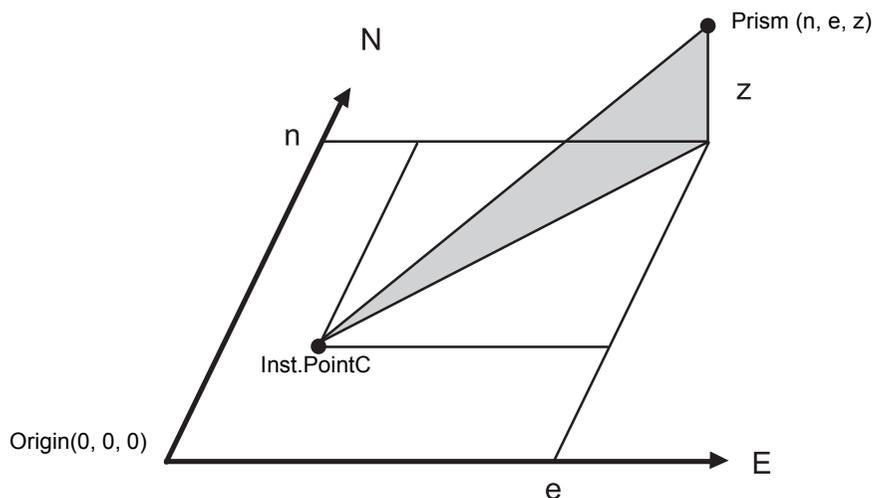

Operating procedure	Operation	Display
1 Press the [F4](↓) key from the coordinate measurement mode to get the function on page 2.	[F4]	<pre> N: 123.456 m E: 34.567 m Z: 78.912 m MEAS MODE S/A P1↓ R.HT INSHT OCC P2↓ </pre>
2 Press the [F3](OCC) key.	[F3]	<pre> N= 0.000 m E= 0.000 m Z: 0.000 m --- --- [CLR] [ENT] </pre>
3 Enter N coordinate value. *1)	Enter data [F4]	<pre> N: -72.000 m E= 0.000 m Z: 0.000 m --- --- [CLR] [ENT] </pre>
4 Enter E and Z coordinate values in the same manner. After entering the values, the display returns coordinate measuring display.		<pre> N: 51.456 m E: 34.567 m Z: 78.912 m MEAS MODE S/A P1↓ </pre>
<p>*1) Refer to Section 2.5 "How to Enter Alphanumeric characters".</p> <ul style="list-style-type: none"> ● Input range $-9999999.9990 \leq N, E, Z \leq +99999999.9990\text{m}$ $-9999999.999 \leq N, E, Z \leq +99999999.999 \text{ft.}$ $-9999999.11.7 \leq N, E, Z \leq +99999999.11.7 \text{ft.+inch}$ 		

5.2 Setting Height of the Instrument

It is possible to retain the height of instrument after turning the power off. Refer to Chapter 16 "SELECTING MODE".

Operating procedure	Operation	Display										
1 Press the [F4](↓) key from the coordinate measurement mode to get the function on page 2.	[F4]	<table border="1"> <tr><td>N:</td><td>123.456 m</td></tr> <tr><td>E:</td><td>34.567 m</td></tr> <tr><td>Z:</td><td>78.912 m</td></tr> <tr><td>MEAS</td><td>MODE S/A P1↓</td></tr> <tr><td>R.HT</td><td>INSHT OCC P2↓</td></tr> </table>	N:	123.456 m	E:	34.567 m	Z:	78.912 m	MEAS	MODE S/A P1↓	R.HT	INSHT OCC P2↓
N:	123.456 m											
E:	34.567 m											
Z:	78.912 m											
MEAS	MODE S/A P1↓											
R.HT	INSHT OCC P2↓											
2 Press the [F2](INSHT) key. The current value is displayed.	[F2]	<table border="1"> <tr><td colspan="2">INSTRUMENT HEIGHT INPUT</td></tr> <tr><td>INS.HT=</td><td>0.000 m</td></tr> <tr><td>---</td><td>--- [CLR] [ENT]</td></tr> </table>	INSTRUMENT HEIGHT INPUT		INS.HT=	0.000 m	---	--- [CLR] [ENT]				
INSTRUMENT HEIGHT INPUT												
INS.HT=	0.000 m											
---	--- [CLR] [ENT]											
3 Enter the instrument height. *1)	Enter Inst.HT [F4]	<table border="1"> <tr><td>N:</td><td>123.456 m</td></tr> <tr><td>E:</td><td>34.567 m</td></tr> <tr><td>Z:</td><td>78.912 m</td></tr> <tr><td>MEAS</td><td>MODE S/A P1↓</td></tr> </table>	N:	123.456 m	E:	34.567 m	Z:	78.912 m	MEAS	MODE S/A P1↓		
N:	123.456 m											
E:	34.567 m											
Z:	78.912 m											
MEAS	MODE S/A P1↓											
<p>*1) Refer to Section 2.5 "How to Enter Alphanumeric characters".</p> <ul style="list-style-type: none"> Input range $-999.9999 \leq$ Instrument height $\leq +999.9999$ m $-999.999 \leq$ Instrument height $\leq +999.999$ ft. $-999.11.7 \leq$ Instrument height $\leq +999.11.7$ ft.+inch 												

5.3 Setting Height of Target (Prism Height)

This mode can be used to obtain Z coordinate values . It is possible to retain the height of target after turning the power off. Refer to Chapter 16 "SELECTING MODE".

Operating procedure	Operation	Display										
1 Press the [F4](↓) key from the coordinate measurement mode to get the function on page 2.	[F4]	<table border="1"> <tr><td>N:</td><td>123.456 m</td></tr> <tr><td>E:</td><td>34.567 m</td></tr> <tr><td>Z:</td><td>78.912 m</td></tr> <tr><td>MEAS</td><td>MODE S/A P1↓</td></tr> <tr><td>R.HT</td><td>INSHT OCC P2↓</td></tr> </table>	N:	123.456 m	E:	34.567 m	Z:	78.912 m	MEAS	MODE S/A P1↓	R.HT	INSHT OCC P2↓
N:	123.456 m											
E:	34.567 m											
Z:	78.912 m											
MEAS	MODE S/A P1↓											
R.HT	INSHT OCC P2↓											
2 Press the [F1](R.HT) key. The current value is displayed.	[F1]	<table border="1"> <tr><td colspan="2">REFLECTOR HEIGHT INPUT</td></tr> <tr><td>R.HT=</td><td>0.000 m</td></tr> <tr><td>---</td><td>--- [CLR] [ENT]</td></tr> </table>	REFLECTOR HEIGHT INPUT		R.HT=	0.000 m	---	--- [CLR] [ENT]				
REFLECTOR HEIGHT INPUT												
R.HT=	0.000 m											
---	--- [CLR] [ENT]											
3 Enter the prism height. *1)	Enter R.HT [F4]	<table border="1"> <tr><td>N:</td><td>123.456 m</td></tr> <tr><td>E:</td><td>34.567 m</td></tr> <tr><td>Z:</td><td>78.912 m</td></tr> <tr><td>MEAS</td><td>MODE S/A P1↓</td></tr> </table>	N:	123.456 m	E:	34.567 m	Z:	78.912 m	MEAS	MODE S/A P1↓		
N:	123.456 m											
E:	34.567 m											
Z:	78.912 m											
MEAS	MODE S/A P1↓											
<p>*1) Refer to Section 2.5 "How to Enter Alphanumeric characters".</p> <ul style="list-style-type: none"> Input range $-999.9999 \leq$ Prism height $\leq +999.9999$ m $-999.999 \leq$ Prism height $\leq +999.999$ ft. $-999.11.7 \leq$ Prism height $\leq +999.11.7$ ft.+inch 												

5.4 Execution of Coordinate Measuring

Measure the coordinates by entering the instrument height and prism height, coordinates of unknown point will be measured directly.

- When setting coordinate values of occupied point, see Section 5.1 “Setting Coordinate Values of Occupied Point”
- When setting the instrument height and prism height, see Section 5.2 “Setting Height of the Instrument” and 5.3 “Setting Height of Target (Prism Height)”.

- The coordinates of the unknown point are calculated as shown below and displayed:

Coordinates of occupied point : (N_0, E_0, Z_0)

Instrument height : INS.HT

Prism height : R.HT

Vertical distance (Relative elevation) : z (VD)

Coordinates of the center of the prism,
originated from the center point of the instrument : (n, e, z)


Coordinates of unknown point : (N_1, E_1, Z_1)

$$N_1 = N_0 + n$$

$$E_1 = E_0 + e$$

$$Z_1 = Z_0 + \text{INS.HT} + z - \text{R.HT}$$

Coordinates of the center of the prism, originated from the center point of the instrument (n, e, z)

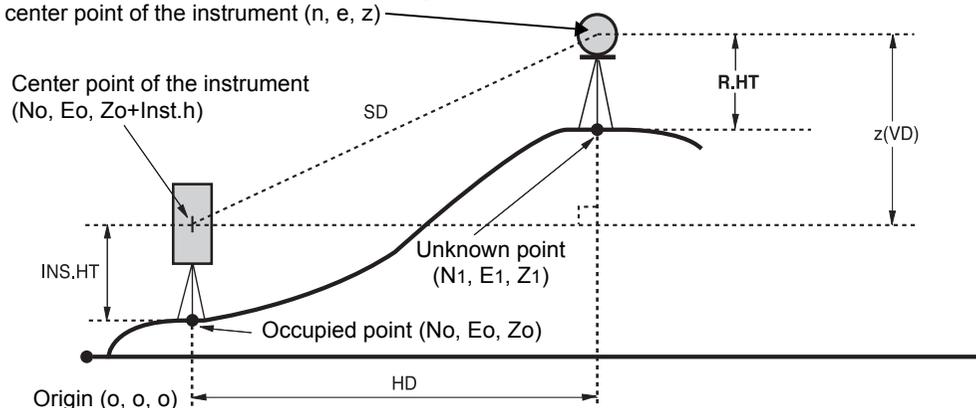


Operating procedure	Operation	Display
1 Set the direction angle of known point A. *1)	Set direction angle	V : 90°10'20" HR: 120°30'40"
2 Collimate target prism.	Collimate P	0SET HOLD HSET P1↓
3 Press the [↖] key. Measuring starts.	[↖]	N* [r] << m E: m Z: m MEAS MODE S/A P1↓
The result will be shown.		↓ N* 123.456 m E: 34.567 m Z: 78.912 m MEAS MODE S/A P1↓

*1) Refer to Section 3.3 “Measuring from the Required Horizontal Angle”.

- In case the coordinate of instrument point is not entered, $(0, 0, 0)$ will be used as the default for the instrument point.
- The instrument height will be calculated as 0 when the instrument height is not entered.
- The prism height will be calculated as 0 when the prism height is not set.

6 SPECIAL MODE (Menu Mode)


By pressing the [MENU] key, the instrument will be in MENU mode.
 In this mode, special measuring , setting and adjustment are possible.

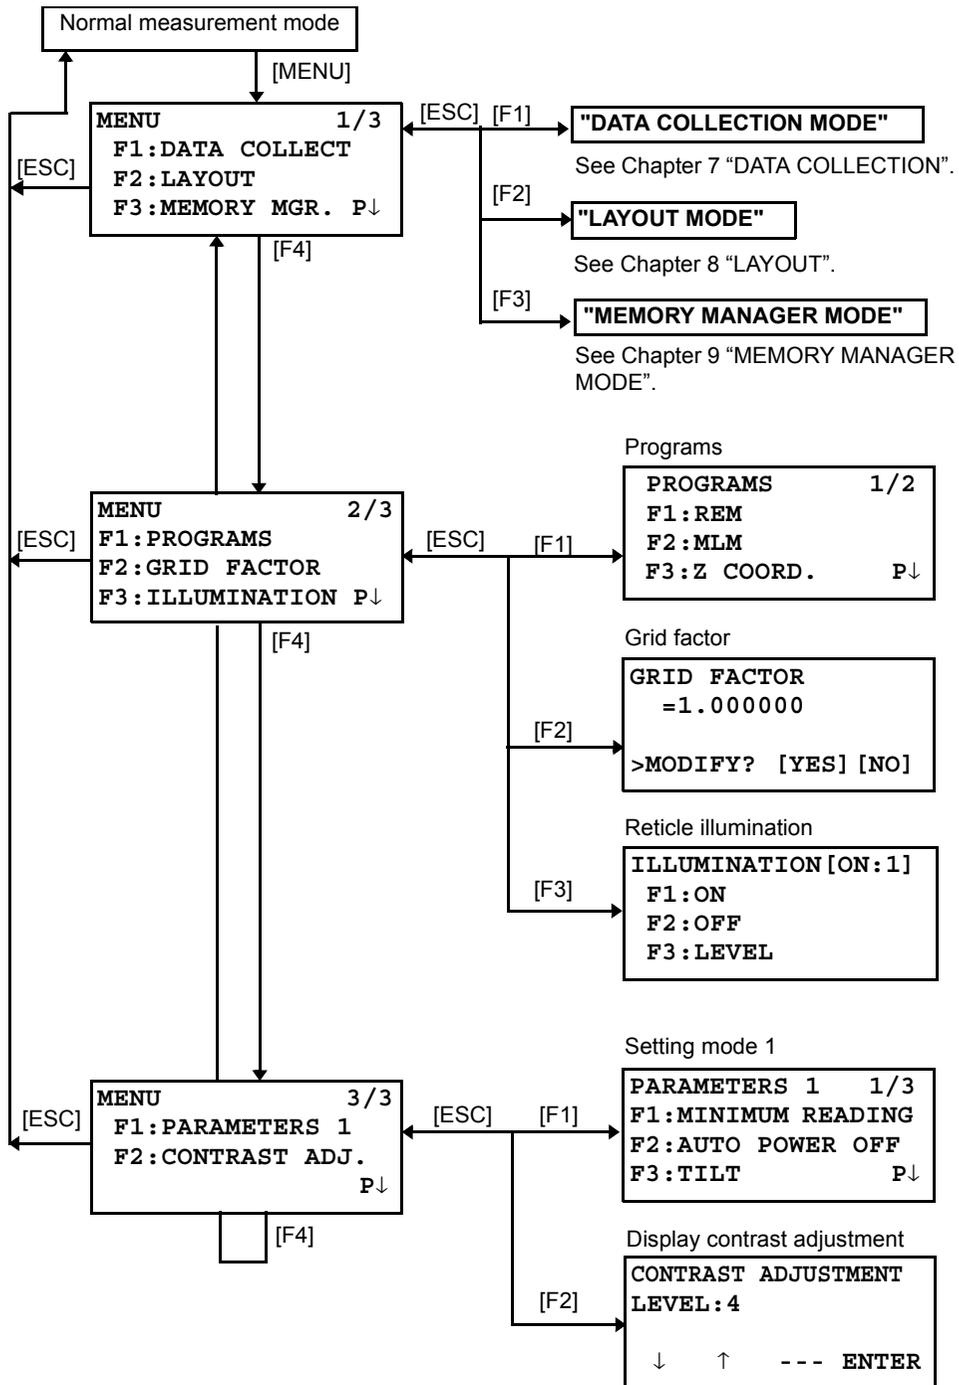

6.1 Application Measurement (PROGRAMS)

6.1.1 Remote Elevation measurement (REM)

To obtain elevation of the point at which setting the target prism is not possible, place the prism at any point on the vertical line from the target then carry out REM procedure as follows.

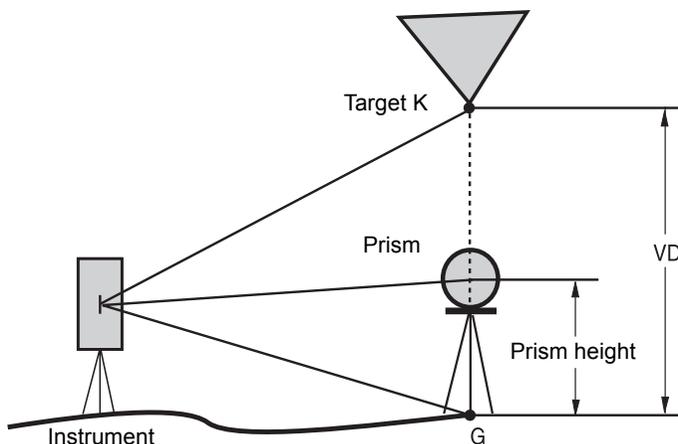

1) With prism height (h) input (Example: h=1.5m)

Operating procedure	Operation	Display
1 After pressing the [MENU] key, press the [F4](P↓) key to get the menu on page 2.	[MENU] [F4]	<pre>MENU 2/3 F1:PROGRAMS F2:GRID FACTOR F3:ILLUMINATION P↓</pre>
2 Press the [F1] key.	[F1]	<pre>PROGRAMS 1/2 F1:REM F2:MLM F3:Z COORD. P↓</pre>
3 Press the [F1](REM) key.	[F1]	<pre>REM F1:INPUT R.HT F2:NO R.HT</pre>
4 Press the [F1] key.	[F1]	<pre>REM-1 <STEP-1> R.HT = 0.000 m --- --- [CLR] [ENT]</pre>
5 Enter prism height. *1)	Enter R.HT [F4]	<pre>REM-1 <STEP-2> HD: m MEAS --- --- SET</pre>
6 Collimate prism.	Collimate P	
7 Press the [F1](MEAS) key. Measuring starts.	[F1]	<pre>REM-1 <STEP-2> HD*[n] << m >Measuring...</pre>

Horizontal distance (HD) between the instrument and prism will be shown.		<pre>REM-1 <STEP-2> HD* 123.456 m >Measuring...</pre>
8 After measuring, the prism position will be decided. *2)		<pre>REM-1 VD: 1.500 m --- R.HT HD ---</pre>
9 Collimate target K. Vertical distance (VD) will be shown. *3)	Collimate K	<pre>REM-1 VD: 10.456 m --- R.HT HD ---</pre>
<p>*1) Refer to Section 2.5 "How to Enter Alphanumeric characters". *2) To return to procedure 5, press the [F2](R.HT) key. To return to procedure 6, press the [F3](HD) key. *3) To return to PROGRAMS Menu, press the [ESC] key.</p>		

2) Without prism height input

Operating procedure	Operation	Display
1 After pressing the [MENU] key, press the [F4](P↓) key to get the menu on page 2.	[MENU] [F4]	<pre>MENU 2/3 F1:PROGRAMS F2:GRID FACTOR F3:ILLUMINATION P↓</pre>
2 Press the [F1] key.	[F1]	<pre>PROGRAMS 1/2 F1:REM F2:MLM F3:Z COORD. P↓</pre>
3 Press the [F1](REM) key.	[F1]	<pre>REM F1:INPUT R.HT F2:NO R.HT</pre>
4 Press the [F2] key.	[F2]	<pre>REM-2 <STEP-1> HD: m MEAS --- --- ---</pre>
5 Collimate prism.	Collimate P	
6 Press the [F1](MEAS) key. Measuring starts.	[F1]	<pre>REM-2 <STEP-1> HD* [n] << m >Measuring...</pre>
Horizontal distance (HD) between the instrument and prism will be shown.		<p style="text-align: center;">↓</p> <pre>REM-2 <STEP-1> HD* 123.456 m >Measuring...</pre>

<p>7 After measuring, the prism position will be decided.</p>		<pre> REM-2 <STEP-2> V : 60°45'50" --- --- --- SET </pre>
<p>8 Collimate ground point G.</p>	Collimate G	<pre> REM-2 <STEP-2> V : 123°45'50" --- --- --- SET </pre>
<p>9 Press the [F4](SET) key. The position of point G will be decided. *1)</p>	[F4]	<pre> REM-2 VD: 0.000 m --- V HD --- </pre>
<p>10 Collimate target K. Vertical distance (VD) will be shown. *2)</p>	Collimate K	<pre> REM-2 VD: 10.456 m --- V HD --- </pre>
<p>*1) To return to procedure 5, press the [F3](HD) key. To return to procedure 8, press the [F2](V) key. *2) To return to PROGRAMS Menu, press the [ESC] key.</p>		


6.1.2 Missing Line Measurement (MLM)

Measurement for horizontal distance (dHD), slope distance (dSD), elevation (dVD) and horizontal bearing (HR) between two target prisms.

It is possible to enter the coordinate value directly or calculate from coordinate data file.

MLM mode has two modes.

1. MLM-1 (A-B, A-C): Measurement is A-B, A-C, A-D,.....
2. MLM-2 (A-B, B-C): Measurement is A-B, B-C, C-D,.....

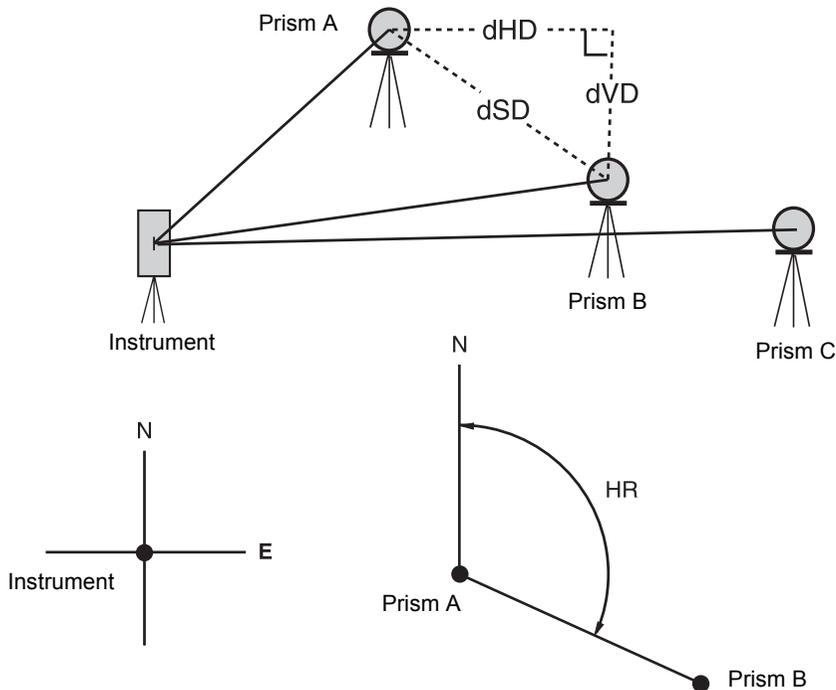

- It is necessary to set the direction angle of the instrument.

[Example] MLM-1 (A-B, A-C)

- Procedure of MLM-2 (A-B, B-C) mode is completely same as MLM-1 mode

Operating procedure	Operation	Display
1 After pressing the [MENU] key, press the [F4](P↓) key to get the menu on page 2.	[MENU] [F4]	MENU 2/3 F1: PROGRAMS F2: GRID FACTOR F3: ILLUMINATION P↓
2 Press the [F1] key.	[F1]	PROGRAMS 1/2 F1: REM F2: MLM F3: Z COORD. P↓
3 Press the [F2](MLM) key.	[F2]	MLM F1: USE FILE F2: DON'T USE
4 Press the [F1] or [F2] key to select using coordinate file. [Example: F2: DON'T USE]	[F2]	GRID FACTOR F1: USE G.F. F2: DON'T USE

<p>5 Press the [F1] or [F2] key to select using GRID FACTOR. [Example: F2: DON'T USE]</p>	[F2]	<pre>MLM F1:MLM-1 (A-B, A-C) F2:MLM-2 (A-B, B-C)</pre>
<p>6 Press the [F1] key.</p>	[F1]	<pre>MLM-1 (A-B, A-C) <STEP-1> HD: m MEAS R.HT NEZ ---</pre>
<p>7 Collimate prism A, and press the [F1](MEAS) key. Horizontal distance (HD) between the instrument and prism A will be shown.</p>	Collimate A [F1]	<pre>MLM-1 (A-B, A-C) <STEP-1> HD* [n] << m >Measuring...</pre>
<p>8 After measuring, the prism position will be decided.</p>		<p style="text-align: center;">↓</p> <pre>MLM-1 (A-B, A-C) <STEP-2> HD: m MEAS R.HT NEZ ---</pre>
<p>9 Collimate prism B and press the [F1](MEAS) key. Horizontal distance (HD) between the instrument and prism B will be shown.</p>	Collimate B [F1]	<pre>MLM-1 (A-B, A-C) <STEP-2> HD* [n] << m MEAS R.HT NEZ ---</pre>
<p>10 After measuring, the horizontal distance (dHD) and relative elevation (dVD) between prism A and B will be shown.</p>	[F4]	<p style="text-align: center;">↓</p> <pre>MLM-1 (A-B, A-C) dHD : 123.456 m dVD : 12.345 m --- --- HD ---</pre>
<p>11 To show slope distance (dSD), press [] key.</p>	[]	<pre>MLM-1 (A-B, A-C) dSD : 234.567 m HR : 12°34'40" --- --- HD ---</pre>
<p>12 To measure the distance between points A and C, press the [F3](HD). *1)</p>	[F3]	<pre>MLM-1 (A-B, A-C) <STEP-2> HD: m MEAS R.HT NEZ ---</pre>
<p>13 Collimate point C (Prism C) and press the [F1](MEAS) key. Horizontal distance (HD) between the instrument and prism C will be shown.</p>	Collimate prism C [F1]	<p style="text-align: center;">⋮</p>
<p>14 After measuring, the horizontal distance (dHD) and relative elevation (dVD) between prism A and C will be shown.</p>	[F4]	<pre>MLM-1 (A-B, A-C) dHD : 234.567 m dVD : 23.456 m --- --- HD ---</pre>
<p>15 To measure the distance between points A and D, repeat procedure 12 to 14. *1)</p>		

*1) To return to previous mode, press the [ESC] key.

6.1.3 Setting Z Coordinate of Occupied Point

Occupied point coordinate data and known point actual measuring data are utilized, z coordinate of occupied point is calculated and reset again.

Known point data and coordinate data can use the coordinate data file.

1) Setting occupied coordinate

[Example setting] Using coordinate data file.

Operating procedure	Operation	Display
1 After pressing [MENU] key, press [F4](P↓) key to get the menu on page 2.	[MENU] [F4]	MENU 2/3 F1: PROGRAMS F2: GRID FACTOR F3: ILLUMINATION P↓
2 Press the [F1] key.	[F1]	PROGRAMS 1/2 F1: REM F2: MLM F3: Z COORD. P↓
3 Press the [F3](Z COORD.) key.	[F3]	Z COORD.SETTING F1: USE FILE F2: DON'T USE
4 Press the [F1](USE FILE) key.	[F1]	SELECT A FILE FN: _____ INPUT LIST --- ENTER
5 Press the [F1](INPUT) key and enter the File Name.	[F1] Enter FN [F4]	Z COORD.SETTING F1: OCC.PT INPUT F2: REF.MEAS
6 Press the [F1] key.	[F1]	OCC.PT PT#: _____ INPUT LIST NEZ ENTER
7 Press the [F1](INPUT) key and enter the Point number. Instrument height setting display will be shown.	[F1] Enter PT# [F4]	INSTRUMENT HEIGHT INPUT INS.HT= 0.000 m --- --- [CLR] [ENT]
8 Enter the height. The display returns to Z coordinate menu.	Enter HT [F4]	Z COORD.SETTING F1: OCC.PT INPUT F2: REF.MEAS

● For more information about data file, see Chapter 9 "MEMORY MANAGER MODE".

2) Z Coordinate Calculation from Known Point Measuring Data

[Example setting] Using coordinate data file

Operating procedure	Operation	Display
1 After pressing [MENU] key, press [F4](P↓) key to get the menu on page 2.	[MENU] [F4]	MENU 2/3 F1:PROGRAMS F2:GRID FACTOR F3:ILLUMINATION P↓
2 Press the [F1] key.	[F1]	PROGRAMS 1/2 F1:REM F2:MLM F3:Z COORD. P↓
3 Press the [F3](Z COORD.) key.	[F3]	Z COORD.SETTING F1:USE FILE F2:DON'T USE
4 Press the [F1](USE FILE) key.	[F1]	SELECT A FILE FN: _____ INPUT LIST --- ENTER
5 Press the [F1](INPUT) key and enter the File Name.	[F1] Enter FN [F4]	Z COORD.SETTING F1:OCC.PT INPUT F2:REF.MEAS
6 Press the [F2] key.	[F2]	NOO1# PT#: _____ INPUT LIST NEZ ENTER
7 Press the [F1](INPUT) key and enter the Point Number in coordinate data file.	[F1] Enter PT# [F4]	N: 4.356 m E: 16.283 m Z: 1.553 m >OK ? [YES] [NO]
8 Press the [F3](YES) key and enter the Point Number in coordinate data file.	[F3]	REFLECTOR HEIGHT INPUT R.HT= 0.000 m --- --- [CLR] [ENT]
9 Enter the height.	Enter R. HT [F4]	REFLECTOR HEIGHT INPUT R.HT: 0.000 m >Sight? [YES] [NO]
10 Collimate a prism on the point and press the [F3](YES) key. Measuring starts. *1)	Collimate P [F3]	HR: 120°30'40" HD*[n] << m VD: m >Measuring...



<p>11 Press the [F4](CALC) key. *2) Z : Z coordinate dZ: Standard deviation</p>	[F4]	<pre>HR: 120°30'40" HD: 12.345 m VD: 23.456 m NEXT --- --- CALC</pre>
<p>12 Press the [F4](SET) key. *3) Z coordinate of the occupied point will be set.</p>	[F4]	<pre>Z COORD. SETTING Z : 1.234 m dZ : 0.002 m --- --- BS SET</pre>
<p>Bascksight point measuring screen will be shown.</p>		<pre>BACKSIGHT HR: 23°20'40" >OK? [YES] [NO]</pre>
<p>13 Press the [F3](YES) key. Horizontal angle will be set. The display returns to Programs 1/2 menu.</p>	[F3]	<pre>PROGRAMS 1/2 F1:REM F2:MLM F3:Z COORD. P↓</pre>
<p>*1) Measurement is Fine N-times measurement mode. *2) To measure other points, press the [F1](NEXT) key. *3) Pressing the [F3] key, the display will be changed alternately.</p>		

6.1.4 Area Calculation

This mode calculate the area of a closed figure.
 There are two area calculation methods as follows.
 1) Area Calculation from Coordinate data file
 2) Area Calculation from Measured data

- Area is not calculated correctly if enclosed lines cross each other.
- It is impossible to calculate what a mix of coordinate file data and measured data.
- If the coordinate data file does not exist, the area calculation from measured data is done automatically.
- The numbers of points used to calculate are not limited.

1) Area Calculation from Coordinate Data File

Operating procedure	Operation	Display
1 After pressing the [MENU] key, press the [F4](P↓) key to get the menu on page 2/3.	[MENU] [F4]	MENU 2/3 F1: PROGRAMS F2: GRID FACTOR F3: ILLUMINATION P↓
2 Press the [F1] key.	[F1]	PROGRAMS 1/2 F1: REM F2: MLM F3: Z COORD. P↓
3 Press the [F4](P↓) key to get the PROGRAMS menu on page 2/2.	[F4]	PROGRAMS 2/2 F1: AREA F2: POINT TO LINE P↓
4 Press the [F1](AREA) key.	[F1]	AREA F1: FILE DATA F2: MEASUREMENT
5 Press the [F1](FILE DATA) key.	[F1]	SELECT A FILE FN: _____ INPUT LIST --- ENTER
6 Press the [F1](INPUT) key and enter the File Name. Initial display will be shown.	[F1] Enter FN [F4]	AREA 0000 m.sq NEXT# :DATA-01 PT# LIST UNIT NEXT
7 Press the [F4](NEXT) key. *1), 2) The top of the file data (DATA-01) will be set and the second point number will be shown.	[F4]	AREA 0001 m.sq NEXT# :DATA-02 PT# LIST UNIT NEXT
8 Repeat pressing the [F4](NEXT) key to set required number of points.	[F4]	⋮

When 3 or more points are set, the area surrounded by the points is calculated and the result will be shown.

```

AREA          0021
          123.456 m.sq
NEXT# :DATA-22
PT# LIST UNIT NEXT
  
```

*1) To set specify point, press the [F1](PT#) key.

*2) To show the list of the coordinate data in the file, press the [F2](LIST) key.

2) Area Calculation from Measured Data

Operating procedure	Operation	Display
1 After pressing the [MENU] key, press the [F4](P↓) key to get the menu on page 2/3.	[MENU] [F4]	<pre> MENU 2/3 F1:PROGRAMS F2:GRID FACTOR F3:ILLUMINATION P↓ </pre>
2 Press the [F1] key.	[F1]	<pre> PROGRAMS 1/2 F1:REM F2:MLM F3:Z COORD. P↓ </pre>
3 Press the [F4](P↓) key to get the PROGRAMS menu on page 2/2.	[F4]	<pre> PROGRAMS 2/2 F1:AREA F2:POINT TO LINE P↓ </pre>
4 Press the [F1](AREA) key.	[F1]	<pre> AREA F1:FILE DATA F2:MEASUREMENT </pre>
5 Press the [F2](MEASUREMENT) key.	[F2]	<pre> AREA F1:USE G.F. F2:DON'T USE </pre>
6 Press the [F1] or [F2] key to select using GRID FACTOR. [Example: F2: DON'T USE]	[F2]	<pre> AREA 0000 m.sq MEAS --- UNIT --- </pre>
7 Collimate a prism and press the [F1](MEAS) key. Measuring starts. *1)	Collimate P [F1]	<pre> N* [n] <<< m E: m Z: m >Measuring... </pre> <p style="text-align: center;">↓</p> <pre> AREA 0001 m.sq MEAS --- UNIT --- </pre>
8 Collimate next point and press the [F1](MEAS) key.	Collimate [F1]	<pre> : : : </pre>

When 3 or more points are measured, the area surrounded by the points is calculated and the result will be shown.

```

AREA          0003
      234.567 m.sq
MEAS  ---  UNIT  ---
    
```

*1) Measurement is Fine N-times measurement mode.

● **To change the display unit**


It is possible to change the displayed area unit.

Operating procedure	Operation	Display
1 Press the [F3](UNIT) key.	[F3]	<pre> AREA 0003 100.000 m.sq MEAS --- UNIT --- </pre>
		<pre> AREA 0003 100.000 m.sq m.sq ha ft.sq acre </pre>
2 Select a unit by pressing the [F1] to [F4] key. Example: [F2](ha) key.	[F2]	<pre> AREA 0003 0.010 ha MEAS --- UNIT --- </pre>
● m.sq: square meter ha: hectare ft.sq: square feet acre: acre.		

6.1.5 Point to Line Measurement

This mode is used to obtain the coordinate data with the origin point A(0, 0, 0) and the line AB as N axis.

Place the 2 prisms at the points A and B on the line, and place the instrument at unknown point C. After measuring the 2 prisms, the coordinate data and the direction angle of the instrument will be calculated and restored.

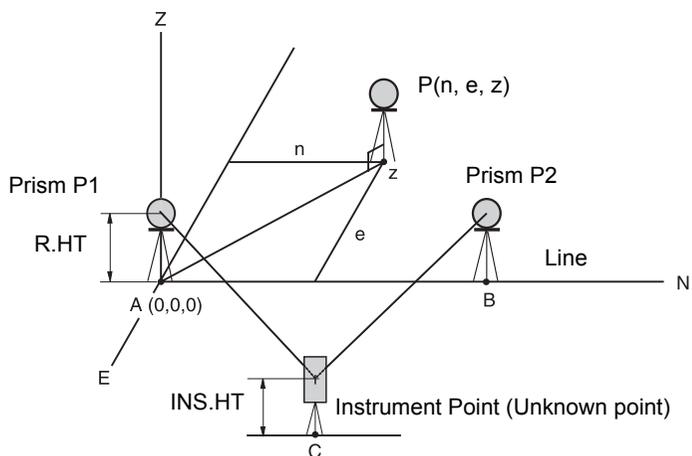

Operating procedure	Operation	Display
1 After pressing the [MENU] key, press the [F4](P↓) key to get the menu on page 2/3.	[MENU] [F4]	MENU 2/3 F1: PROGRAMS F2: GRID FACTOR F3: ILLUMINATION P↓
2 Press the [F1] key.	[F1]	PROGRAMS 1/2 F1: REM F2: MLM F3: Z COORD. P↓
3 Press the [F4](P↓) key to get the PROGRAMS menu on page 2/2.	[F4]	PROGRAMS 2/2 F1: AREA F2: POINT TO LINE P↓
4 Press the [F2] key.	[F2]	INSTRUMENT HEIGHT INPUT INS.HT= 0.000 m --- --- [CLR] [ENT]
5 Enter instrument height.	Enter INS.HT [F4]	REFLECTOR HEIGHT INPUT R.HT= 0.000 m --- --- [CLR] [ENT]
6 Enter reflector A(P1) height.	Enter R.HT [F4]	POINT TO LINE MEAS.P1 HD: m >Sight? [YES] [NO]

<p>7 Collimate prism P1 (Origin) and press [F3](YES) key. Measuring starts. *1)</p> <p>Input display of reflector B(P2) height will be shown.</p>	<p>Collimate P1 [F3]</p>	<pre> POINT TO LINE MEAS.P1 HD*[n] << m >Measuring... ↓ REFLECTOR HEIGHT INPUT R.HT= 0.000 m --- --- [CLR] [ENT] </pre>
<p>8 Enter reflector B(P2) height.</p>	<p>Enter R. HT [F4]</p>	<pre> POINT TO LINE MEAS.P2 HD: m >Sight? [YES] [NO] </pre>
<p>9 Collimate prism B (P2)(Origin) and press the [F3](YES) key. Measuring starts. *1)</p> <p>The coordinate data and the direction angle of the instrument are calculated and restored. The result (The distance between A and B) will be displayed. dHD: Horizontal distance dVD: Vertical distance dSD: Slope distance *2), 3)</p>	<p>Collimate P2 [F3]</p>	<pre> POINT TO LINE MEAS.P2 HD*[n] << m >Measuring... ↓ DIST. (P1-P2) 1/2 dHD: 10.000 m dVD: 0.000 m NEZ S.CO --- P↓ </pre>
<p>10 Press [F1](NEZ) key to measure other points.</p>	<p>[F1]</p>	<pre> N: 0.000 m E: 0.000 m Z: 0.000 m EXIT --- HT MEAS >Measuring... </pre>
<p>11 Collimate a prism and press [F4](MEAS) key. Coordinate measurement starts. *4) The result will be shown. *5)</p>	<p>Collimate P [F4]</p>	<pre> N: 3.456 m E: 5.432 m Z: 0.000 m EXIT --- HT MEAS </pre>
<p>*1) Measurement is Fine N-times measurement mode. *2) To show dSD, press [F4](P↓) key. *3) To show the new occupied data, press [F2](S.CO) key. *4) Measurement is Fine N-times measurement mode. *5) To return to previous mode, press [F1](EXIT) key.</p>		

6.2 Setting the GRID FACTOR

GRID FACTOR can reset in this menu mode.

For more information, refer to Section 8.1.1 "Setting the GRID FACTOR".

Grid Factor can be applied to the following application programs.

It is also possible to cancel the Grid factor function by selecting "DON'T USE" in "SELECTING MODE". At this time the setting and selecting screens for Grid Factor will be omitted.

- **Data collection mode**

When the NEZ automatic calculation (NEZ AUTO. CALC) is ON, Grid factor will be applied to the coordinate data (Including PTL data) recorded into a coordinate data file when the RAW data is measured and recorded. (In this case, Grid Factor is not applied to the RAW data recorded into the measured data file.)

- **PTL (Point To Line measurement)**

When executing PTL measurement mode, the NEZ Auto Calculation will be turned on compulsorily and Grid factor will be applied to the coordinate data.

- **Layout**

Execution Layout (Including PTL measurement mode)

1. When displaying the difference (dHD) between grid horizontal distance to a layout point (HDg) on the projection plane and measured ground horizontal distance to a prism point (HD), Grid factor will be applied to grid distance (HDg) in order to reverse-convert grid distance to ground distance.

2. After completion of a layout point, the displayed coordinate data will be applied to grid factor in order to compare with surveying data and calculated data on the projection plane.

(NEW POINT-Side Shot)

In side shot method, a new point coordinate data will be applied to grid factor and the new point coordinate data will be recorded into a coordinate data file.

(NEW POINT - Resection)

In resection method, when a new point calculated coordinate data is displayed or recorded, the new point coordinate data will be applied to grid factor and the coordinate data will be recorded into a coordinate data file.

- **MLM (Missing Line Measurement)**

When selecting grid factor "USE G.F.", measured data will be applied to grid factor. At this time, horizontal distance (dHD) and slope distance (dSD) will be on the projection plane.

- **AREA (Area calculation/Measured method)**

When selecting grid factor "USE G.F.", measured data will be applied to grid factor. At this time, the calculated area will be on the projection plane.

Note: Calculation of Z coordinate is not influenced even if it is applied to grid factor.

Operating procedure	Operation	Display
1 After pressing the [MENU] key, press the [F4](P↓) key to get the menu on page 2.	[MENU] [F4]	<pre> MENU 2/3 F1: PROGRAMS F2: GRID FACTOR F3: ILLUMINATION P↓ </pre>
2 Press the [F2](GRID FACTOR) key.	[F2]	<pre> GRID FACTOR =0.998843 >MODIFY? [YES] [NO] </pre>

<p>3 Press the [F3](YES) key.</p> <p>4 Enter Elevation. *1) Press the [F4](ENT) key.</p> <p>5 Enter Scale Factor in the same way.</p> <p>Grid Factor is displayed for 1 to 2 second and display returns to menu.</p>	<p>[F3]</p> <p>Enter ELEV. [F4]</p> <p>Enter Scale [F4]</p>	<div style="border: 1px solid black; padding: 5px; margin-bottom: 5px;"> <p>GRID FACTOR ELEV.=1000 m SCALE:0.999000 --- --- [CLR] [ENT]</p> </div> <div style="border: 1px solid black; padding: 5px; margin-bottom: 5px;"> <p>GRID FACTOR ELEV.:2000 m SCALE=1.001000 --- --- [CLR] [ENT]</p> </div> <div style="border: 1px solid black; padding: 5px;"> <p>GRID FACTOR =1.000686</p> </div>
<p>*1) Refer to Section 2.5 “How to Enter Alphanumeric characters”.</p> <ul style="list-style-type: none"> ● Input Range: Elevation : -9,999 to +9,999 meter (-32,805 to +3,2805 ft, ft+in) Scale Factor: 0.990000 to 1.010000 		

6.3 Setting Illumination of Display and Cross Hairs

Setting ON/OFF/LEVEL (1 to 9) for illumination of display (LCD) and reticle.

- Setting LEVEL (1 to 9) is only for reticle.

[Example setting] LEVEL: 2 and turn on the illumination.

Operating procedure	Operation	Display
<p>1 After pressing the [MENU] key, press the [F4](P↓) key to get the menu on page 2.</p>	<p>[MENU] [F4]</p>	<div style="border: 1px solid black; padding: 5px;"> <p>MENU 2/3 F1:PROGRAMS F2:GRID FACTOR F3:ILLUMINATION P↓</p> </div>
<p>2 Press the [F3] key. The data previously set is shown.</p>	<p>[F3]</p>	<div style="border: 1px solid black; padding: 5px;"> <p>ILLUMINATION [OFF:1] F1:ON F2:OFF F3:LEVEL</p> </div>
<p>3 Press the [F3](LEVEL) key.</p>	<p>[F3]</p>	<div style="border: 1px solid black; padding: 5px;"> <p>ILLUMINATION [OFF:1] [LEVEL MODE]</p> <p>↓ ↑ --- ENTER</p> </div>
<p>4 Press the [F2](↑) key, and then press the [F4](ENTER) key.</p>	<p>[F2] [F4]</p>	<div style="border: 1px solid black; padding: 5px;"> <p>ILLUMINATION [OFF:2] F1:ON F2:OFF F3:LEVEL</p> </div>
<p>5 Press the [F1](ON) key.</p>	<p>[F1]</p>	<div style="border: 1px solid black; padding: 5px;"> <p>ILLUMINATION [ON:2] F1:ON F2:OFF F3:LEVEL</p> </div>
<ul style="list-style-type: none"> ● To return to previous mode, press the [ESC] key. 		

6.4 Setting Mode 1

In this mode, the following settings are possible.

1. Setting Minimum Reading
 2. Auto Power off
 3. Vertical and Horizontal Angle Tilt Correction (Tilt ON/OFF)
 4. Systematic Error of Instrument Correction
 5. Heater ON/OFF
 6. Setting for RS-232C communication
- This setting is memorized after power off.

6.4.1 Setting Minimum Reading

Select minimum display unit for angle measurement, coarse distance measurement mode.

- To select minimum display for fine measurement mode, see Chapter 16 "SELECTING MODE".

Angle Unit			Coarse mode Distance unit
Degree	GON	MIL	
5"/1"	1mgon/0.2mgon	0.1mil/0.01mil	10mm (0.02ft)/ 1mm (0.005ft)

[Example] Minimum angle: 5", Coarse: 1mm

Operating procedure	Operation	Display
1 After pressing the [MENU] key, press the [F4](P↓) key twice to get the menu on page 3.	[MENU] [F4] [F4]	MENU 3/3 F1: PARAMETERS 1 F2: CONTRAST ADJ. P↓
2 Press the [F1] key.	[F1]	PARAMETERS 1 1/2 F1: MINIMUM READING F2: AUTO POWER OFF F3: TILT P↓
3 Press the [F1] key.	[F1]	MINIMUM READING F1: ANGLE F2: COARSE
4 Press the [F1] key.	[F1]	MINIMUM ANGLE [F1: 1"] F2: 5" ENTER
5 Press the [F2](5") key and press the [F4](ENTER) key.	[F2] [F4]	MINIMUM READING F1: ANGLE F2: COARSE
6 Press the [F2] key.	[F2]	COARSE READING F1: 1mm [F2: 10mm] ENTER
7 Press the [F1] key and press the [F4](ENTER) key.	[F1] [F4]	MINIMUM READING F1: ANGLE F2: COARSE

● To return to previous mode, press the [ESC] key.

6.4.2 Auto Power Off

If no key operation is given or no process of measurement is performed for more than 30 minutes (No change exceeding 30" has occurred during horizontal angle or vertical angle measurement.), the power turns off automatically. If the instrument is set at distance measurement mode (No change in distance exceeding 10cm has occurred during distance measurement), the mode changes to angle measurement automatically in case that the instrument does not operate for approximately 10 minutes, and the power turns off after 20 minutes.

Operating procedure	Operation	Display
1 After pressing the [MENU] key, press the [F4](P↓) key twice to get the menu on page 3.	[MENU] [F4] [F4]	MENU 3/3 F1:PARAMETERS 1 F2:CONTRAST ADJ. P↓
2 Press the [F1] key.	[F1]	PARAMETERS 1 1/3 F1:MINIMUM READING F2:AUTO POWER OFF F3:TILT P↓
3 Press the [F2] key. The data previously set is shown.	[F2]	AUTO POWER OFF [OFF] F1:ON F2:OFF ENTER
4 Press the [F1](ON) key or [F2](OFF) key, and press the [F4](ENTER) key.	[F1] or [F2] [F4]	

6.4.3 Vertical and Horizontal Angle Tilt correction (Tilt ON/OFF)

In case the instrument is used in an unstable situation, constant indexing of vertical and horizontal angle may be impossible. In this case, the function of tilt correction can be stopped by selecting TILT OFF. It has been set to X,Y (V/H) TILT ON at the factory.

- This setting is memorized after powering off.

Operating procedure	Operation	Display
1 After pressing the [MENU] key, press the [F4](P↓) key twice to get the menu on page 3.	[MENU] [F4] [F4]	MENU 3/3 F1:PARAMETERS 1 F2:CONTRAST ADJ. P↓
2 Press the [F1] key.	[F1]	PARAMETERS 1 1/3 F1:MINIMUM READING F2:AUTO POWER OFF F3:TILT P↓
3 Press the [F3] key. The data previously set is shown. If already ON, the display shows tilt correction value.	[F3]	TILT SENSOR: [XY-ON] X: 0°02'10" Y: 0°03'00" X-ON XY-ON OFF ENTER
4 Press the [F1](X-ON) key or [F2](XY-ON) or [F3](OFF) key, and press the [F4](ENTER) key.	[F1]~[F3] [F4]	

6.4.4 Systematic Error of Instrument Correction

Setting ON/OFF for error correction of collimation and horizontal axis for angle measurement.

Note: Perform this item after complete Section 17.5 "Adjustment of Compensation Systematic Error of Instrument".

Operating procedure	Operation	Display
1 After pressing the [MENU] key, press the [F4](P↓) key twice to get the menu on page 2.	[MENU] [F4] [F4]	MENU 3/3 F1:PARAMETERS 1 F2:CONTRAST ADJ. P↓
2 Press the [F1] key.	[F1]	PARAMETERS 1 1/3 F1:MINIMUM READING F2:AUTO POWER OFF F3:TILT P↓
3 Press the [F4] key.	[F4]	PARAMETERS 1 2/3 F1:ERROR CORRECTION F2:BATTERY TYPE F3:HEATER P↓
4 Press the [F1] key. The data previously set is shown.	[F1]	ERROR CORR. [OFF] F1:ON F2:OFF ENTER
5 Press the [F1](ON) key or [F2](OFF) key, and press the [F4](ENTER) key.	[F1] or [F2] [F4]	

6.4.5 Heater ON/OFF

The heater option for both display units can be turned OFF or ON.

Operating procedure	Operation	Display
1 After pressing the [MENU] key, press the [F4](P↓) key twice to get the menu on page 2.	[MENU] [F4] [F4]	MENU 3/3 F1:PARAMETERS 1 F2:CONTRAST ADJ. P↓
2 Press the [F1] key.	[F1]	PARAMETERS 1 1/3 F1:MINIMUM READING F2:AUTO POWER OFF F3:TILT P↓
3 Press the [F4] key.	[F4]	PARAMETERS 1 2/3 F1:ERROR CORRECTION F2:BATTERY TYPE F3:HEATER P↓
4 Press the [F3] key. The data previously set is shown.	[F3]	HEATER [OFF] F1:ON F2:OFF ENTER
5 Press the [F1](ON) key or [F2](OFF) key, and press the [F4](ENTER) key.	[F1] or [F2] [F4]	

6.4.6 Setting RS-232C communication with external device

You can set the parameters for RS-232C communication with external device from parameters setting menu.

The following parameters can be set.

Item	Selecting items
Baud rate	1200, 2400, 4800, 9600, 19200, 38400
Character bit/Parity	7/Even, 7/Odd, 8/None
Stop bit	1, 2
ACK mode	Standard, Omitted
CR, LF	ON, OFF
REC type	REC-A, REC-B
Factory setting	Baud rate: 1200 baud, Character bit/Parity: 7/Even, CRLF: OFF, REC type: REC-A, ACK: Standard

ACK mode, CRLF and REC type are interlocked with the same items in the selecting mode. Refer to 16 "SELECTING MODE".

Sample setting

STOP BITS: 2

Operating procedure	Operation	Display
1 After pressing the [MENU] key, press the [F4](P↓) key twice to get the menu on page 2.	[MENU] [F4] [F4]	MENU 3/3 F1:PARAMETERS 1 F2:CONTRAST ADJ. P↓
2 Press the [F1] key.	[F1]	PARAMETERS 1 1/3 F1:MINIMUM READING F2:AUTO POWER OFF F3:TILT P↓
3 Press the [F4] key twice.	[F4] [F4]	PARAMETERS 1 3/3 F1:RS-232C P↓
4 Press the [F1] key. The data previously set is shown.	[F1]	RS-232C 1/3 F1:BAUD RATE F2:CHAR./PARITY F3:STOP BITS P↓
5 Press the [F3] key to select STOP BITS. The data previously set is marked.	[F3]	STOP BITS [F1:1] F2:2 ENTER
6 Press the [F2](2) key to select stop bit 2, and press the [F4](ENTER) key.	[F2] [F4]	STOP BITS F1:1 [F2:2] ENTER


6.5 Setting Contrast of Display

Setting level for contrast of display (LCD)

Operating procedure	Operation	Display
1 After pressing the [MENU] key, press the [F4](P↓) key twice to get the menu on page 3.	[MENU] [F4] [F4]	<pre> MENU 3 / 3 F1 : PARAMETERS 1 F2 : CONTRAST ADJ. P↓ </pre>
2 Press the [F2] key.	[F2]	<pre> CONTRAST ADJUSTMENT LEVEL: 4 ↓ ↑ --- ENTER </pre>
3 Press the [F1](↓) key or [F2](↑) key, and press the [F4](ENTER) key.	[F1] or [F2] [F4]	

6.6 ROAD

● Road menu operation

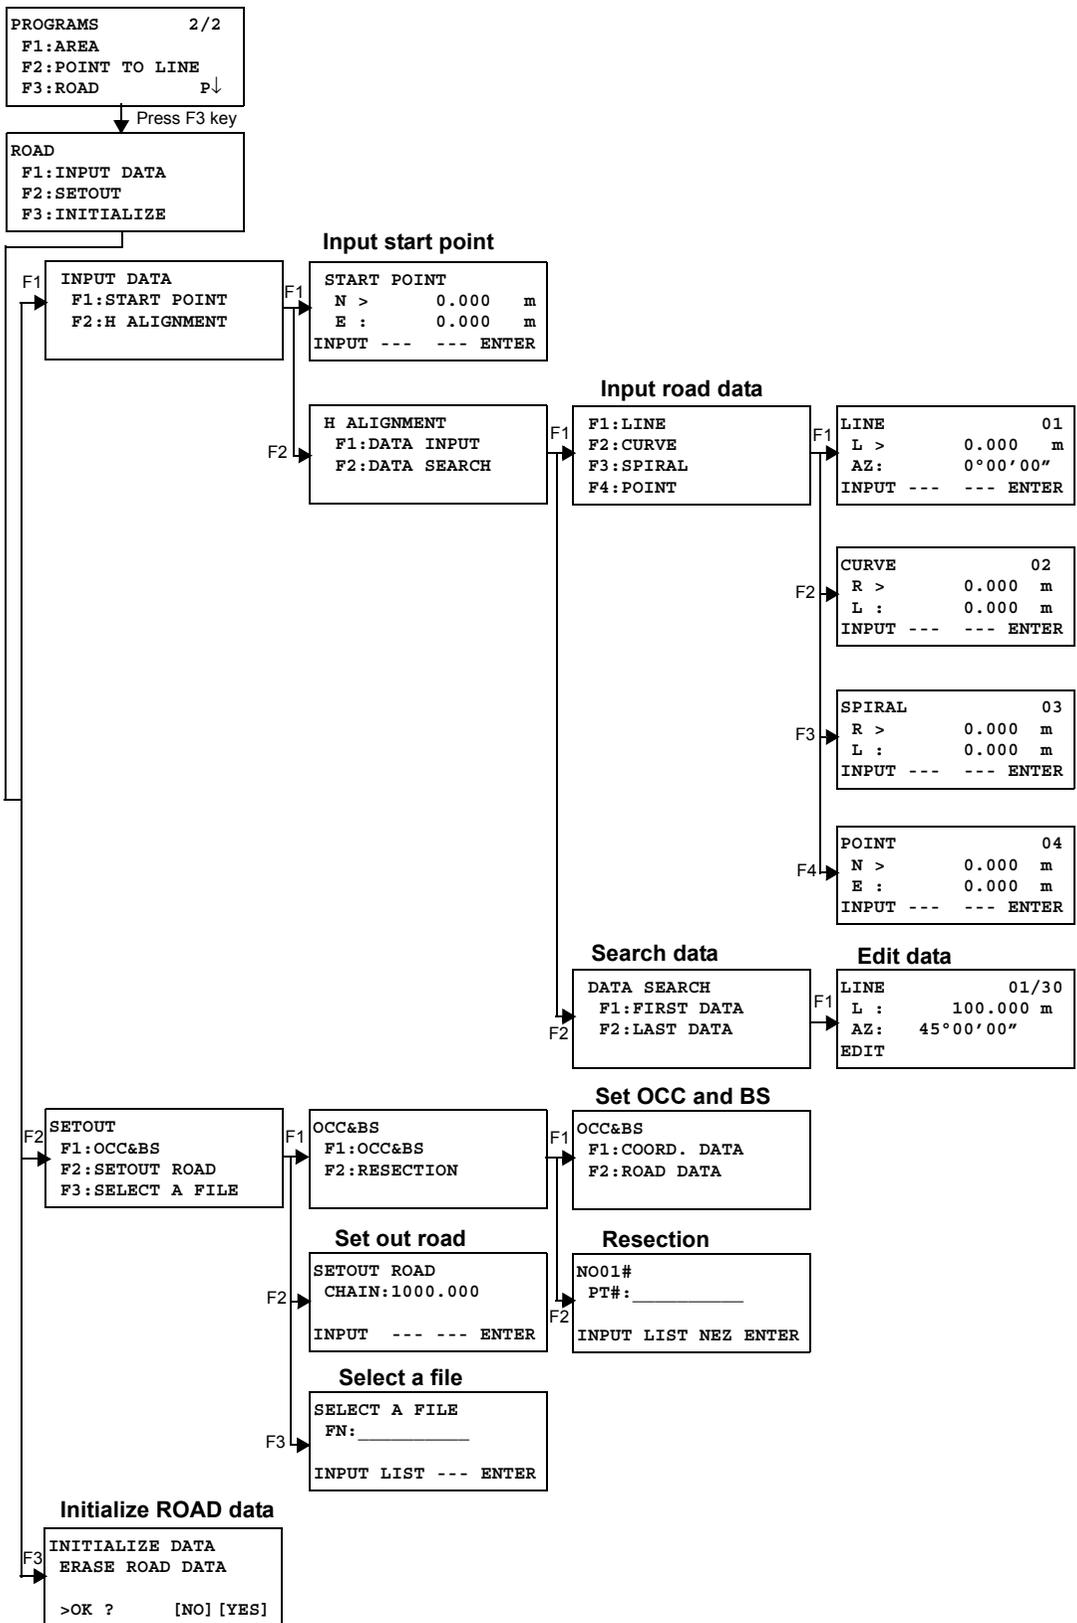

6.6.1 Input Start Point

To input the start point, carry out the following operating procedure.

Operating procedure	Operation	Display
1 After pressing the [MENU] key, press the [F4](P↓), [F1], [F4]key to get the programs menu on page 2/2.	[MENU] [F4] [F1] [F4]	PROGRAMS 2/2 F1: AREA F2: POINT TO LINE F3: ROAD P↓
2 Press the [F3], [F1], [F1] key. (Refer to "Input start point" on page 6-23.)	[F3] [F1] [F1]	START POINT N = 0.000 m E : 0.000 m --- --- [CLR] [ENT]
3 Input coord N, E. 4 Press the [ENT] key.	Input coord [ENT]	START POINT CHAIN = 0.000 m INTERVAL: 100.000 m --- --- [CLR] [ENT]
5 Input value data CHAIN, INTERVAL. 6 Press the [ENT] key.	Input data [ENT]	<SET!> INPUT DATA F1: START POINT F2: H ALIGNMENT
<ul style="list-style-type: none"> ● For [ROAD], in addition to the "Start Point" and "Road Data" input files, other files necessary for the calculations are created. Consequently, if the free area of the memory reaches 10% or less, a "MEMORY POOR" warning message is displayed. (In this case, the instrument can still be operated.) ● CHAIN and INTERVAL input range $-50,000\text{m} \leq \text{CHAIN} \leq +500,000\text{m}$ $0\text{m} < \text{INTERVAL} \leq +5,000\text{m}$ 		

6.6.2 Input Road Data

[ROAD] is made up of four types of components: LINE, CURVE, SPIRAL and POINT.
To input the required components, carry out the following operating procedure.

Operating procedure	Operation	Display
1 After pressing the [MENU] key, press the [F4](P↓), [F1], [F4]key to get the programs menu on page 2/2.	[MENU] [F4] [F1] [F4]	PROGRAMS 2/2 F1: AREA F2: POINT TO LINE F3: ROAD P↓
2 Press the [F3], [F1], [F2],[F1] key. (Refer to "Input road data" on page 6-23.)	[F3] [F1] [F2] [F1]	F1: LINE F2: CURVE F3: SPIRAL F4: POINT
<ul style="list-style-type: none"> The amount of input data varies depending on the type of data, up to a maximum of 30. (In the case of POINT input only, the maximum is 9 points including end point.) An error may occur when entering a combination of POINT and other components if the amount of data entered exceeds the maximum amount allowed for internal calculations. If this happens, please reduce the amount of input data. 		

- Input LINE data

Operating procedure	Operation	Display
1 To input LINE data, press the [F1] key. *1)	[F1]	F1: LINE F2: CURVE F3: SPIRAL F4: POINT
2 Input LENGTH. 3 Press the [ENT] key.	Input LENGTH [ENT]	LINE 01 L = 0.000 m AZ: 0°00'00" --- --- [CLR] [ENT]
4 Input AZIMUTH. 5 Press the [ENT] key.	Input AZIMUTH [ENT]	LINE 01 L : 100.000 m AZ= 0°00'00" --- --- [CLR] [ENT] : : : <SET! >
*1) The number at the top right of the screen shows the amount of data currently entered.		

- Input CURVE data

Operating procedure	Operation	Display
1 To input CURVE data, press the [F2] key. *1)	[F2]	<div style="border: 1px solid black; padding: 5px;"> F1: LINE F2: CURVE F3: SPIRAL F4: POINT </div> <div style="border: 1px solid black; padding: 5px; margin-top: 5px;"> CURVE 02 R = 0.000 m L : 0.000 m --- --- [CLR] [ENT] </div>
2 Input RADIUS. 3 Press the [ENT] key.	Input RADIUS [ENT]	<div style="border: 1px solid black; padding: 5px; margin-top: 5px;"> CURVE 02 R : 100.000 m L = 0.000 m --- --- [CLR] [ENT] </div>
4 Input LENGTH. 5 Press the [ENT] key.	Input LENGTH [ENT]	<div style="border: 1px solid black; padding: 5px; margin-top: 5px;"> CURVE 02 TURN > RIGHT LEFT RIGHT --- ENTER </div>
6 Select TURN(direction of turn): RIGHT or LEFT. 7 Press the [ENT] key.	Select [F1](LEFT) or [F2](RIGHT) [ENT]	<div style="border: 1px solid black; padding: 5px; margin-top: 5px; text-align: center;"> <SET!> </div>
*1) CURVE cannot be input as the first data.		

- Input SPIRAL data

Operating procedure	Operation	Display
1 To input SPIRAL data, press the [F3] key. *1)	[F3]	<pre> F1:LINE F2:CURVE F3:SPIRAL F4:POINT SPIRAL 03 R = 0.000 m L : 0.000 m --- --- [CLR] [ENT] </pre>
2 Input RADIUS. 3 Press the [ENT] key.	Input RADIUS [ENT]	<pre> SPIRAL 03 R : 100.000 m L = 0.000 m --- --- [CLR] [ENT] </pre>
4 Input LENGTH. 5 Press the [ENT] key.	Input LENGTH [ENT]	<pre> </pre>
6 Select TURN(direction of turn): RIGHT or LEFT. 7 Press the [ENT] key.	Select [F1](LEFT) or [F2](RIGHT) [ENT]	<pre> SPIRAL 03 TURN > RIGHT DIR : IN LEFT RIGHT --- ENTER </pre>
8 Select DIR(direction): IN(entrance) or OUT(exit). 9 Press the [ENT] key.	Select [F1](IN) or [F2](OUT) [ENT]	<pre> SPIRAL 03 TURN : LEFT DIR > IN IN OUT --- ENTER </pre> <pre> <SET!> </pre>
*1) SPIRAL cannot be input as the first data.		

6.6.5 Set OCC and BS

To set the Occupied Point and Backsight Point, carry out the following operating procedure.

Operating procedure	Operation	Display
<p>1 After pressing the [MENU] key, press the [F4](P↓), [F1], [F4] key to get the programs menu on page 2/2.</p>	[MENU] [F4] [F1] [F4]	<pre>PROGRAMS 2 / 2 F1: AREA F2: POINT TO LINE F3: ROAD P↓</pre>
<p>2 Press the [F3], [F2], [F1] key. (Refer to "Set OCC and BS" on page 6-23.)</p>	[F3] [F2] [F1]	<pre>OCC&BS F1: OCC&BS F2: RESECTION</pre>
<p>3 Press the [F1] key. *1)</p>	[F1]	<pre>OCC&BS F1: COORD. DATA F2: ROAD DATA</pre>
<p>4 To input OCC. PT, press the [F1](COORD. DATA) or [F2](ROAD DATA) key.</p> <p>COORD. DATA: Choose the data from Coord Data and set the Occupied Point.</p> <p>ROAD DATA: Create the data from Road Data and set the Occupied Point.</p> <p>(Example: ROAD DATA)</p>	[F2]	<pre>OCC. PT CHAIN= --- --- [CLR] [ENT]</pre>
<p>5 Input OCC. PT, press the [ENT] key.</p>	Input OCC. PT [ENT]	<pre>CHAIN: 1000.000 >CENTER LEFT RIGHT --- ENTER</pre>
<p>6 Press the [ENT] key.</p> <p>LEFT or RIGHT: Use the offset point. CENTER: Use the center point.</p> <p>(Example: CENTER)</p>	[ENT]	<pre>CHAIN: 1000.000 N : 0.000 m E : 0.000 m >OK ? [YES] [NO]</pre>
<p>7 Press the [F3](YES) key.</p>	[F3]	<pre>BACKSIGHT CHAIN= --- --- [CLR] [ENT]</pre>
<p>8 Input the backsight.</p>	Input Backsight	
<p>9 Press the [ENT] key.</p>	[ENT]	<pre>CHAIN: 0.000 >CENTER LEFT RIGHT --- ENTER</pre>

6.6.6 Setout Road

To setout the road, carry out the following operating procedure.

Operating procedure	Operation	Display
1 After pressing the [MENU] key, press the [F4](P↓), [F1], [F4] key to get the programs menu on page 2/2.	[MENU] [F4] [F1] [F4]	PROGRAMS 2/2 F1: AREA F2: POINT TO LINE F3: ROAD P↓
2 Press the [F3], [F2], [F2] key. (Refer to "Set out road" on page 6-23.)	[F3] [F2] [F2]	SETOUT ROAD CHAIN= --- --- [CLR] [ENT]
3 Input data.	Input data	SETOUT ROAD CHAIN=1200 --- --- [CLR] [ENT]
4 Press the [ENT] key.	[ENT]	CHAIN:1200 > CENTER LEFT RIGHT --- ENTER
5 Select offset. (Example: RIGHT) Press the [F2] key. *1)	[F2]	CHAIN:1200 : RIGHT = m --- --- [CLR] [ENT]
6 Input the offset value.	Input offset value	
7 Press the [ENT] key. The setout point coordinates are displayed.	[ENT]	CHAIN:1200 N : 0.000 m E : 0.000 m >OK ? [YES] [NO]
8 Press the [F3](YES) key. The distance to the setout point and the backsight are displayed. HR: Calculated horizontal angle of the layout point HD: Calculated horizontal distance from the instrument to the layout point	[F3]	CALCULATED HR= 60°00'00" HD= 100.000 m ANG DIST --- ---
9 Press the [F1](ANG) key. CHAIN: Layout point HR: Measured (Actual) horizontal angle. dHR: Horizontal angle to be turned to the layout point = Actual horizontal angle - Calculated horizontal angle. Correct direction when dHR = 0°00'00"	[F1]	CHAIN:1200 HR: 60°00'00" dHR: 0°00'00" DIST --- NEZ ---
10 Press the [F1](DIST) key. HD: Measuring (Actual) horizontal distance dHD: Horizontal distance to be turned to the layout point = Actual horizontal distance - Calculated horizontal distance.	[F1]	HD* 100.000 m dHD: 0.000 m MODE ANG NEZ NEXT

11 Press the [F3](NEZ) key. The coordinate data is shown.	[F3]	<table border="1"> <tr> <td>N *</td> <td>70.000 m</td> </tr> <tr> <td>E :</td> <td>50.000 m</td> </tr> <tr> <td>MODE</td> <td>ANG --- NEXT</td> </tr> </table>	N *	70.000 m	E :	50.000 m	MODE	ANG --- NEXT
N *	70.000 m							
E :	50.000 m							
MODE	ANG --- NEXT							
12 Press the [F4](NEXT) key to set next layout point.	[F4]							
*1) If not selecting offset, press the [ENT] key.								

6.6.7 Select a File

To set the coordinates to be used for the Occupied Point and Backsight Point, carry out the following operating procedure.

Operating procedure	Operation	Display								
1 After pressing the [MENU] key, press the [F4](P↓), [F1], [F4]key to get the programs menu on page 2/2.	[MENU] [F4] [F1] [F4]	<table border="1"> <tr> <td>PROGRAMS</td> <td>2 / 2</td> </tr> <tr> <td>F1: AREA</td> <td></td> </tr> <tr> <td>F2: POINT TO LINE</td> <td></td> </tr> <tr> <td>F3: ROAD</td> <td>P↓</td> </tr> </table>	PROGRAMS	2 / 2	F1: AREA		F2: POINT TO LINE		F3: ROAD	P↓
PROGRAMS	2 / 2									
F1: AREA										
F2: POINT TO LINE										
F3: ROAD	P↓									
2 Press the [F3], [F2] key. (Refer to "Select a file" on page 6-23.)	[F3] [F2]	<table border="1"> <tr> <td>SETOUT</td> <td></td> </tr> <tr> <td>F1: OCC&BS</td> <td></td> </tr> <tr> <td>F2: SETOUT ROAD</td> <td></td> </tr> <tr> <td>F3: SELECT A FILE</td> <td></td> </tr> </table>	SETOUT		F1: OCC&BS		F2: SETOUT ROAD		F3: SELECT A FILE	
SETOUT										
F1: OCC&BS										
F2: SETOUT ROAD										
F3: SELECT A FILE										
3 Press the [F3] key.	[F3]	<table border="1"> <tr> <td>SELECT A FILE</td> <td></td> </tr> <tr> <td>FN: _____</td> <td></td> </tr> <tr> <td>INPUT LIST --- ENTER</td> <td></td> </tr> </table>	SELECT A FILE		FN: _____		INPUT LIST --- ENTER			
SELECT A FILE										
FN: _____										
INPUT LIST --- ENTER										
4 Enter the name of the file being used (or select it from the list).	Select a file									
5 Press the [ENT] key.	[ENT]									

6.6.8 Initialize ROAD data

To initialize the data, carry out the following operating procedure.

Operating procedure	Operation	Display								
1 After pressing the [MENU] key, press the [F4](P↓), [F1], [F4]key to get the programs menu on page 2/2.	[MENU] [F4] [F1] [F4]	<table border="1"> <tr> <td>PROGRAMS</td> <td>2 / 2</td> </tr> <tr> <td>F1: AREA</td> <td></td> </tr> <tr> <td>F2: POINT TO LINE</td> <td></td> </tr> <tr> <td>F3: ROAD</td> <td>P↓</td> </tr> </table>	PROGRAMS	2 / 2	F1: AREA		F2: POINT TO LINE		F3: ROAD	P↓
PROGRAMS	2 / 2									
F1: AREA										
F2: POINT TO LINE										
F3: ROAD	P↓									
2 Press the [F3], [F3] key. (Refer to "Initialize ROAD data" on page 6-23.)	[F3] [F3]	<table border="1"> <tr> <td>INITIALIZE DATA</td> <td></td> </tr> <tr> <td>ERASE ROAD DATA</td> <td></td> </tr> <tr> <td>>OK ?</td> <td>[NO] [YES]</td> </tr> </table>	INITIALIZE DATA		ERASE ROAD DATA		>OK ?	[NO] [YES]		
INITIALIZE DATA										
ERASE ROAD DATA										
>OK ?	[NO] [YES]									
3 When the [F4] (YES) key is pressed, all ROAD DATA with the exception of the coordinate data file is erased. Press the [F4] key.	[F4]									

7 DATA COLLECTION

The SET are able to store the measured data into the internal memory. The internal memory is shared by the measured data files and the coordinate data files. Maximum 30 files can be generated.

- **Measured data**
The collected data is memorized into a files.
- **The number of measurement points**
(In case not using the internal memory in layout mode)


MAX. 24,000 points

Because the internal memory covers both data collection mode and layout mode, the number of measurement points will be decreased when the layout mode is used. For the internal memory, refer to Chapter 9 "MEMORY MANAGER MODE".

- | |
|---|
| <ol style="list-style-type: none">1) When turning off the power, ensure that you are in the main menu screen or main angle measurement mode.
This ensures completion of the memory access process and avoids possible damage to the stored data.2) It is recommended for safety to charge the battery (BT-G1S) beforehand and prepare fully charged spare batteries. |
|---|

● Data collect menu operation

By pressing the [MENU] key, the instrument will be in MENU 1/3 mode.
 Press the [F1](DATA COLLECT) key, the menu of data collect 1/2 will be shown.

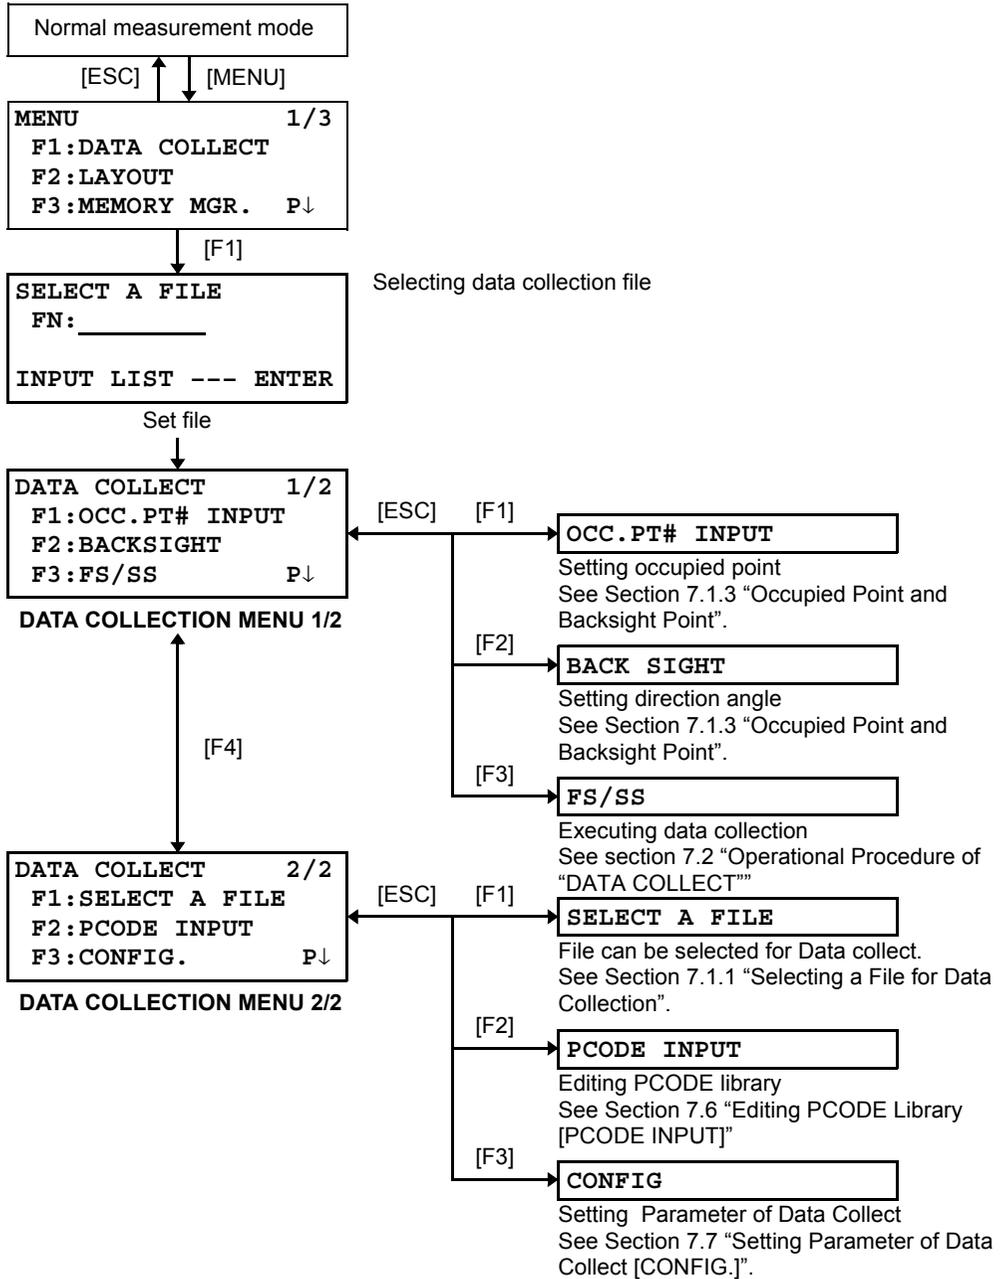

7.1 Preparation

7.1.1 Selecting a File for Data Collection

A file used by data collection mode must be selected at first.

Select a file before beginning data collection mode because selection screen of a file is displayed. And a selection from data collection menu is possible in the mode.

Operating procedure	Operation	Display
1 Press [F1](DATA COLLECT) key from menu 1/3.	[F1]	<pre> MENU 1/3 F1:DATA COLLECT F2:LAYOUT F3:MEMORY MGR. P↓ </pre>
2 Press [F2](LIST) key to display the list of file. *1)	[F2]	<pre> SELECT A FILE FN: _____ INPUT LIST --- ENTER </pre>
3 Scroll file list by pressing [▼] or [▲] key and select a file to use. *2), 3)	[▼] or [▲]	<pre> AMIDATA /M0123 →*HILDATA /M0345 TOPDATA /M0789 --- SRCH --- ENTER </pre>
4 Press [F4](ENTER) key. The file will be set and data collect 1/2 menu will be shown.	[F4]	<pre> TOPDATA /M0789 →RAPDATA /M0564 SATDATA /M0456 --- SRCH --- ENTER </pre>
		<pre> DATA COLLECT 1/2 F1:OCC.PT# INPUT F2:BACKSIGHT F3:FS/SS P↓ </pre>
<p>*1) If you want to make a new file or input file name directly, press [F1](INPUT) key and enter a file name. *2) When a file has been selected already, "*" mark is indicated on left of current file name. *3) Data in a file shown with arrow can be searched by pressing [F2](SRCH) key.</p>		
<ul style="list-style-type: none"> It is possible to select a file from DATA COLLECT 2/2 menu in the same way. 		<pre> DATA COLLECT 2/2 F1:SELECT A FILE F2:PCODE INPUT F3:CONFIG. P↓ </pre>

7.1.2 Selecting a Coordinate File for Data Collection

When coordinate data in a coordinate data file are used for occupied point or backsight point, select a coordinate file from the data collect menu 2/2 beforehand.

Operating procedure	Operation	Display
1 Press the [F1](SELECT A FILE) key from DATA COLLECT menu 2/2.	[F1]	<pre>DATA COLLECT 2/2 F1:SELECT A FILE F2:PCODE INPUT F3:CONFIG. P↓</pre>
2 Press the [F2](COORD.DATA) key.	[F2]	<pre>SELECT A FILE F1:MEAS.DATA F2:COORD.DATA</pre>
3 Select a coordinate file in the same manner as Section 7.1.1 "Selecting a File for Data Collection".		<pre>SELECT A FILE FN: _____ INPUT LIST --- ENTER</pre>

7.1.3 Occupied Point and Backsight Point

The occupied point and direction angle in the data collect mode are linked with the occupied point and direction angle in normal coordinate measurement.

It is possible to set or change the occupied point and direction angle from the data collect mode.

Occupied point can be set by two setting methods as follow.

- 1) Setting from the coordinate data stored in the internal memory.
- 2) Direct key input.

The following three setting methods for backsight point can be selected.

- 1) Setting from the coordinate data stored in the internal memory.
- 2) Direct key input of coordinate data.
- 3) Direct key input of setting angle.

Note: See 9.4 "Coordinate Data Direct Key Input" and 9.7.2 "Loading Data" for how to store coordinate into the internal memory.

- Example for setting the occupied point:

In case of setting occupied point from the coordinate data stored in the internal memory.

Operating procedure	Operation	Display
1 Press the [F1](OCC.PT# INPUT) key from the data collect menu 1/2. The previous data is shown.	[F1]	<pre>PT# →PT-01 ID : INS.HT: 0.000 m INPUT SRCH REC OCNEZ</pre>
2 Press the [F4] (OCNEZ) key.	[F4]	<pre>OCC.PT PT#:PT-01 INPUT LIST NEZ ENTER</pre>
3 Press the [F1](INPUT) key.	[F1]	<pre>OCC.PT PT#=PT-01 [ALP] [SPC] [CLR] [ENT]</pre>

<p>4 Enter PT#, press [F4](ENT) key. *1)</p>	<p>Enter PT# [F4]</p>	<pre>PT# →PT-11 ID : INS.HT: 0.000 m INPUT SRCH REC OCNEZ</pre>
<p>5 Enter ID, INS.HT in the same way. *2), 3)</p>	<p>Enter ID, INS.HT</p>	<pre>PT# :PT-11 ID : INS.HT→ 1.335 m INPUT SRCH REC OCNEZ</pre>
<p>6 Press [F3](REC) key.</p>	<p>[F3]</p>	<pre>>REC ? [YES] [NO]</pre>
<p>7 Press [F3](YES) key. The display returns to the data collect menu 1/2.</p>	<p>[F3]</p>	<pre>DATA COLLECT 1/2 F1:OCC.PT# INPUT F2:BACKSIGHT F3:FS/SS P↓</pre>
<p>*1) Refer to Section 2.5 "How to Enter Alphanumeric characters". *2) ID can be input by inputting a register number linked with PCODE Library. To show the list of PCODE library, press the [F2](SRCH) key. *3) Press the [F3](REC) key when you do not input the INS.HT.</p> <ul style="list-style-type: none"> ● The data recorded in data collect is PT#, ID and INS.HT. ● If point is not found in internal memory "PT# DOES NOT EXIST" is displayed. 		

- Example for setting the direction angle:

The following is to memorize the data of the backsight after setting the backsight point from point number.

Operating procedure	Operation	Display
1 Press the [F2](BACKSIGHT) key from the data collect menu 1/2. The previous data is shown.	[F2]	BS# → PCODE : R.HT : 0.000 m INPUT OSET MEAS BS
2 Press the [F4] (BS) key. *1)	[F4]	BACKSIGHT PT#: INPUT LIST NE/AZ ENT
3 Press the [F1](INPUT) key.	[F1]	BACKSIGHT PT#= [ALP] [SPC] [CLR] [ENT]
4 Enter PT#, press the [F4](ENT) key. *2) Enter PCODE,R.HT in the same way. *3), 4)	Enter PT# [F4]	BS# →PT-22 PCODE : R.HT : 0.000 m INPUT OSET MEAS BS
5 Press the [F3](MEAS) key.	[F3]	BS# →PT-22 PCODE : R.HT : 0.000 m *VH SD NEZ ---
6 Collimate back sight point. Select one of the measuring mode and press the soft key. EXAMPLE: [F2](Slope Distance) key. Measuring starts. Horizontal circle is set to calculated direction angle. Measuring result is memorized and the display returns to the data collect menu 1/2.	Collimate BS [F2]	V : 90°00'00" HR: 0°00'00" SD*[n] <<< m > Measuring... ↓ DATA COLLECT 1/2 F1:OCC.PT# INPUT F2:BACKSIGHT F3:FS/SS P↓
<p>*1) Pressing each time the [F3] key, the input method changes as Coordinate value, Angle, Coordinate point name alternatively.</p> <p>*2) Refer to Chapter 2.5 "How to Enter Alphanumeric characters".</p> <p>*3) PCODE can be input by inputting a register number linked with PCODE Library. To show the list of PCODE library, press the [F2](SRCH) key.</p> <p>*4) Data collect sequence can be set to [MEAS→EDIT]. Refer to Section 7.7 "Setting Parameter of Data Collect [CONFIG.]".</p> <ul style="list-style-type: none"> ● If point is not found in internal memory " PT# DOES NOT EXIST" is displayed. 		

7.2 Operational Procedure of “DATA COLLECT”

Operating procedure	Operation	Display
		<pre>DATA COLLECT 1/2 F1:OCC.PT# INPUT F2:BACKSIGHT F3:FS/SS P↓</pre>
<p>1 Press the [F3](FS/SS) key from the data collect menu 1/2. The previous data is shown.</p>	[F3]	<pre>PT# → PCODE : R.HT : 0.000 m INPUT SRCH MEAS ALL</pre>
<p>2 Press the [F1](INPUT) key and enter PT#. Press the [F4](ENT) key. *1)</p>	[F1] Enter PT# [F4]	<pre>PT# =PT-01 PCODE : R.HT : 0.000 m [ALP] [SPC] [CLR] [ENT]</pre>
		<pre>PT# :PT-01 PCODE → R.HT : 0.000 m INPUT SRCH MEAS ALL</pre>
<p>3 Enter PCODE, R.HT in the same way. *2), 3)</p>	[F1] Enter PCODE [F4] [F1]	<pre>PT# →PT-01 PCODE :SOKKIA R.HT : 1.200 m INPUT SRCH MEAS ALL</pre>
<p>4 Press the [F3](MEAS) key.</p>	Enter R.HT [F4] [F3]	<pre>VH *SD NEZ OFSET</pre>
<p>5 Collimate the target point.</p>	Collimate	
<p>6 Press one of the [F1] to [F3] key. *4) Example: [F2](SD) key. Measuring starts.</p> <p>The measuring data is memorized and the display changes to the next point. *5) PT# is automatically incremented.</p>	[F2]	<pre>V : 90°10'20" HR: 120°30'40" SD*[n] < m > Measuring... < complete ></pre> <p style="text-align: center;">↓</p> <pre>PT# →PT-02 PCODE :SOKKIA R.HT : 1.200 m INPUT SRCH MEAS ALL</pre>
<p>7 Enter the next point data and collimate the next point.</p>	Collimate	
<p>8 Press [F4](ALL) key. Measuring starts in the same measuring mode of the previous point. Data is recorded.</p> <p>Continue the measuring in the same way. To finish the mode , press [ESC] key.</p>	[F4]	<pre>V : 90°10'20" HR: 120°30'40" SD*[n] < m > Measuring... < complete ></pre> <p style="text-align: center;">↓</p> <pre>PT# →PT-03 PCODE :SOKKIA R.HT : 1.200 m INPUT SRCH MEAS ALL</pre>

- *1) Refer to Section 2.5 "How to Enter Alphanumeric characters".
- *2) PCODE can be input by inputting a register number linked with PCODE Library.
To show the list of PCODE library, press the [F2](SRCH) key.
- *3) Data collect sequence can be set to [MEAS→EDIT]. See to Section 7.7 "Setting Parameter of Data Collect [CONFIG.]".
- *4) The mark "*" indicates the previous measuring mode.
- *5) You can confirm the measured data as follows. Refer to Section 7.7 "Setting Parameter of Data Collect [CONFIG.]".

```
V : 90°10'20"
HR: 120°30'40"
SD: 98.765 m
> OK ? [YES] [NO]
```

● Searching the recorded data

While executing the DATA COLLECT mode, you can search the recorded data.

Operating procedure	Operation	Display
<p>1 While executing the DATA COLLECT mode, press [F2](SRCH) key. *1)</p> <p>The using file name will appear on the top of the right side of the display.</p>	[F2]	<pre>PT# →PT-02 PCODE : R.HT : 1.200 m INPUT SRCH MEAS ALL</pre> <pre>SEARCH [SOKKIA] F1:FIRST DATA F2:LAST DATA F3:PT# DATA</pre>
<p>2 Select one of three search methods by pressing [F1] to [F3] key. *2)</p>	[F1] to [F3]	
<p>*1) It is possible to see the PCODE list when the arrow is located beside PCODE or ID.</p> <p>*2) The operation is same as the "SEARCH" in the MEMORY MANAGER mode. For more information, refer to Section 9.2 "Searching Data".</p>		

● Entering PCODE/ID using PCODE Library

While executing the DATA COLLECT mode, you can enter PCODE/ID from PCODE Library.

Operating procedure	Operation	Display
1 Move the arrow to the PCODE or ID in the DATA COLLECT mode, press the [F1](INPUT) key. 2 Enter a register number linked with PCODE library and press the [F4](ENT) key. (Example) Register number, 32 = SOKKIA	[F1]	PT# :PT-02 PCODE → R.HT : 1.200 m INPUT SRCH MEAS ALL
	Enter No [F4]	PT# :PT-02 PCODE =32 R.HT : 1.200 m [ALP] [SPC] [CLR] [ENT]
		PT# :PT-02 PCODE :SOKKIA R.HT → 1.200 m INPUT SRCH MEAS ALL

● Entering PCODE/ID from the list of PCODE

You can also enter PCODE/ID from the list of PCODE.

Operating procedure	Operation	Display
1 Move the arrow to the PCODE or ID in the DATA COLLECT mode, press the [F2](SRCH) key. 2 By pressing the following keys, the register number will increase or decrease. [▲] or [▼]: Increasing or Decreasing one by one [▶] or [◀]: By ten Increasing or Decreasing. *1) 3 Press the [F4](ENTER) key.	[F2]	PT# :PT-02 PCODE → R.HT : 1.200 m INPUT SRCH MEAS ALL
	[▲] or [▼] [▶] or [◀]	→001:PCODE01 002:PCODE02 EDIT --- CLR ENTER 031:PCODE31 →032:SOKKIA 033:HILTOP EDIT --- CLR ENTER
	[F4]	PT# :PT-02 PCODE :SOKKIA R.HT → 1.200 m INPUT SRCH MEAS ALL
*1) To edit the PCODE library, press the [F1](EDIT) key. To delete the PCODE registered with shown an arrow, press the [F3](CLR) key. PCODE can be edited in DATA COLLECT menu 2/2 or MEMORY MANAGER menu 2/3.		


7.3 Data Collect Offset Measurement mode

This mode is useful when it is difficult to set up the prism directly, for example at the center of a tree. Data Collect. Offset Measurement has four measuring methods.

- Angle offset measurement
- Distance offset measurement
- Plane offset measurement
- Column offset measurement

7.3.1 Angle Offset Measurement

Place the prism at the same horizontal distance from the instrument as that of point A_0 to measure.

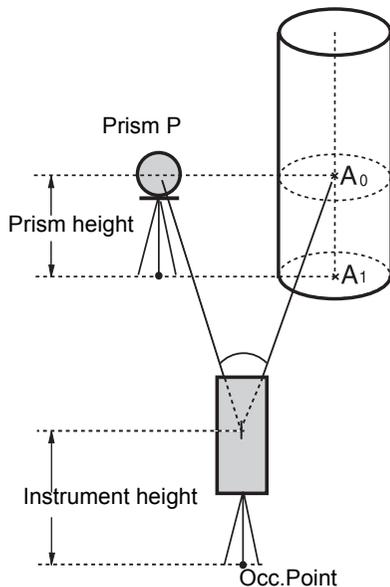

When measuring coordinates of ground point A_1 : Set the instrument height/prism height.

When measuring coordinates of point A_0 : Set the instrument height only. (Set the prism height to 0).

When sighting to A_0 , you can select one of two ways. One is to fix vertical angle to the prism position even up down the telescope position, and the other is to gear vertical angle to the up down of telescope movement. In case following the vertical angle to the movement of telescope, SD (Slope Distance) and VD (Vertical Distance) will be changed according to the movement of telescope.


To set this option, refer to Chapter 16 "SELECTING MODE".

Operating procedure	Operation	Display
1 Press the [F3](MEAS) key.	[F3]	<pre>PT# →PT-11 PCODE :SOKKIA R.HT : 1.200 m INPUT SRCH MEAS ALL VH *SD NEZ P1↓ OFFSET PTL P2↓</pre>
2 Press the [F4](P1↓) key, [F1](OFFSET) key.	[F4] [F1]	<pre>OFFSET 1/2 F1:ANG. OFFSET F2:DIST. OFFSET F3:PLANE OFFSET P↓</pre>
3 Press the [F1] key.	[F1]	<pre>OFFSET-MEASUREMENT HR: 120°30'40" HD: m >Sight ? [YES] [NO]</pre>
4 Collimate the prism.	Collimate P	
5 Press the [F3](YES) key. Continuous measuring starts.	[F3]	<pre>OFFSET-MEASUREMENT HR: 120°30'40" HD* [n] < m >measuring ...</pre>

<p>6 Collimate point A0 using the horizontal motion clamp and horizontal tangent screw.</p>	Collimate A0	<pre> OFFSET-MEASUREMENT HR: 120°30'40" SD* 12.345 m >OK? [YES] [NO] </pre>
<p>7 Show the horizontal distance of point A0.</p>	[▲]	<pre> OFFSET-MEASUREMENT HR: 123°30'40" SD: 12.345 m >OK? [YES] [NO] </pre>
<p>8 Show the relative elevation of point A0.</p>	[▲]	<pre> OFFSET-MEASUREMENT HR: 123°30'40" HD: 6.543 m >OK? [YES] [NO] </pre>
<p>● Each time pressing [▲] key, horizontal distance , relative elevation and slope distance are shown in sequence.</p>	[↙]	<pre> OFFSET-MEASUREMENT HR: 123°30'40" VD: 0.843 m >OK? [YES] [NO] </pre>
<p>9 Show N coordinate of point A0 or A1.</p>	[F3]	<pre> OFFSET-MEASUREMENT HR: 123°30'40" N : -12.345 m >OK? [YES] [NO] </pre>
<p>10 Press the [F3](YES) key.</p>		<pre> PT# →PT-12 PCODE :SOKKIA R.HT : 1.200 m INPUT SRCH MEAS ALL </pre>
<p>The data is recorded and the next measuring point is displayed.</p>		

7.3.2 Distance Offset Measurement

The measurement of a place apart from a prism is possible by inputting offset horizontal distance of front and back/right and left.

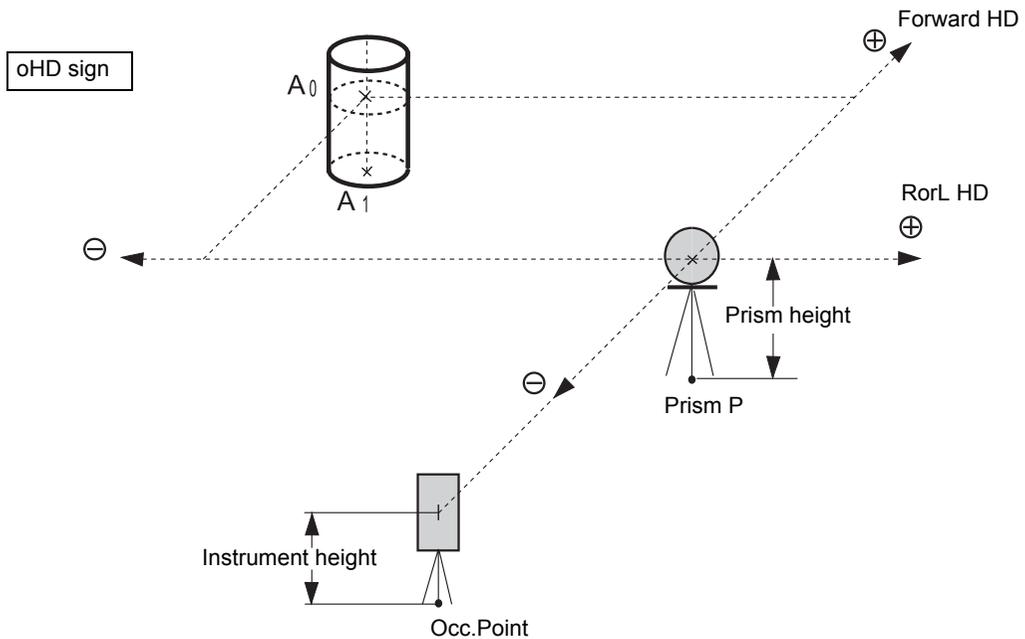

When measuring coordinates of ground point A_1 : Set the instrument height/prism height.

When measuring coordinates of point A_0 : Set the instrument height only.
(Set the prism height to 0).

Operating procedure	Operation	Display
1 Press the [F3](MEAS) key.	[F3]	<pre>PT# →PT-11 PCODE :SOKKIA R.HT : 1.200 m INPUT SRCH MEAS ALL VH *SD NEZ P1↓ OFFSET PTL P2↓</pre>
2 Press the [F4](P1↓) key, [F1](OFFSET) key.	[F4] [F1]	<pre>OFFSET 1/2 F1:ANG. OFFSET F2:DIST. OFFSET F3:PLANE OFFSET P↓</pre>
3 Press the [F2] key.	[F2]	<pre>DISTANCE OFFSET INPUT RorL HD oHD: 0.000 m --- --- [CLR] [ENT]</pre>
4 Enter Right and Left direction offset value.*1)	Enter HD [F4]	<pre>DISTANCE OFFSET INPUT FORWARD HD oHD: 0.000 m --- --- [CLR] [ENT]</pre>
5 Enter Forward direction offset value. *1)	Enter HD [F4]	<pre>PT# :PT-11 PCODE : SOKKIA R.HT : 1.200 m --- *SD NEZ ---</pre>

6 Collimate the prism.

7 Press the [F2] or [F3] key.
Example: [F3](NEZ) key
Measuring starts.

The data is recorded and the next measuring point is displayed.

Collimate P

[F3]

```
N*[n]      <<< m
E :        m
Z :        m
>measuring ...
>Calculating...
```




```
PT#      → PT-12
PCODE   : SOKKIA
R.HT    : 1.200 m
INPUT SRCH MEAS ALL
```

*1) To skip entering, press the [F3](SKP) key.

7.3.3 Plane Offset Measurement

Measuring will be taken for the place where direct measuring can not be done, for example distance or coordinate measuring for a edge of a plane.

Three random points (P1, P2, P3) on a plane will be measured at first in the plane offset measurement to determine the measured plane. Collimate the measuring point (P0) then the instrument calculates and displays coordinate and distance value of cross point between collimation axis and of the plane..

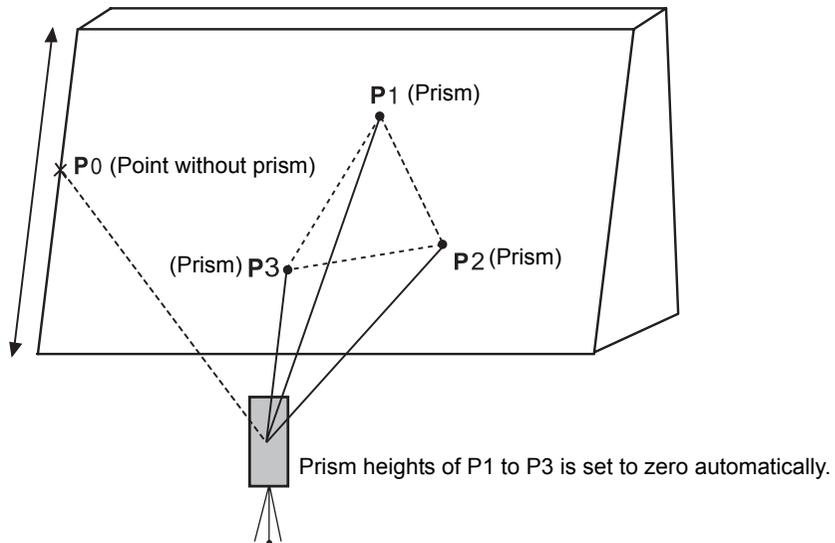


Operating procedure	Operation	Display
1 Press the [F3](MEAS) key.	[F3]	<pre>PT# →PT-11 PCODE :SOKKIA R.HT : 1.200 m INPUT SRCH MEAS ALL VH *SD NEZ P1↓ OFFSET PTL P2↓</pre>
2 Press the [F4](P1↓) key, [F1](OFFSET) key.	[F4] [F1]	<pre>OFFSET 1/2 F1:ANG.OFFSET F2:DIST.OFFSET F3:PLANE OFFSET P↓</pre>
3 Press the [F3](PLANE OFFSET) key.	[F3]	<pre>PLANE N001#: SD: m MEAS --- --- ---</pre>
4 Collimate prism P1, and press the [F1](MEAS) key. Measuring will start. After measuring, the display will show the second point measurement.	Collimate P1 [F1]	<pre>PLANE N001#: SD* [n] << m >Measuring...</pre> <p style="text-align: center;">↓</p>
5 Measure the second and third points in the same way.	Collimate P2 [F1]	<pre>PLANE N002#: SD: m MEAS --- --- ---</pre> <p style="text-align: center;">↓</p>

<p>The display changes to PT# input in the plane offset measurement. *1) Input point number if necessary.</p>	<p>Collimate P3 [F1]</p>	<pre>PLANE N003#: SD: m MEAS --- --- ---</pre>
<p>6 Press the [F4](MEAS) key. The instrument calculates and displays coordinate and distance value of cross point between collimation axis and of the plane. *2)</p>	<p>[F4]</p>	<p style="text-align: center;">↓</p> <pre>PLANE PT# →PT-11 PCODE :SOKKIA INPUT SRCH --- MEAS</pre> <pre>HR: 80°30'40" HD: 54.321 m VD: 10.000 m >OK? [YES] [NO]</pre>
<p>7 Collimate the edge (P0) of the plane. *3), 4)</p>	<p>Collimate P0</p>	<pre>HR: 75°30'40" HD: 54.600 m VD: -0.487 m >OK? [YES] [NO]</pre>
<p>8 To show the slope distance (SD), press the [] key. <ul style="list-style-type: none"> Each time pressing the [] key, horizontal distance, relative elevation and slope distance are shown in sequence. To show coordinate value of point P0, press the [] key. </p>	<p>[F3]</p>	<pre>V : 90°30'40" HR: 75°30'40" SD: 54.602 m >OK? [YES] [NO]</pre>
<p>9 Press the [F3](YES) key. The measured data will be recorded and the next offset point number will be displayed.</p>	<p>[ESC]</p>	<pre>PLANE PT# →PT-12 PCODE :SOKKIA INPUT SRCH --- MEAS</pre> <pre>PT# →PT-12 PCODE :SOKKIA R.HT : 1.200 m INPUT SRCH MEAS ALL</pre>
<p>*1) In case the calculation of plane was not successful by the measured three points, error displays. Start measuring over again from the first point. *2) Data display is the mode beforehand of offset measurement mode. *3) Error will be displayed when collimated to the direction which does not cross with the determined plane. *4) The reflector height of the target point P0 is set to zero automatically</p>		

7.3.4 Column Offset Measurement

If it is possible to measure circumscription point (P1) of column directly, the distance to the center of the column (P0), coordinate and direction angle can be calculated by measured circumscription points (P2) and (P3).

The direction angle of the center of the column is 1/2 of total direction angle of circumscription points (P2) and (P3).

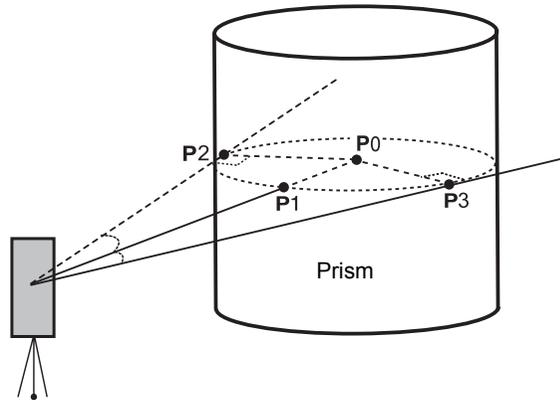

Operating procedure	Operation	Display
1 Press the [F3](MEAS) key.	[F3]	<pre>PT# →PT-11 PCODE :SOKKIA R.HT : 1.200 m INPUT SRCH MEAS ALL VH *SD NEZ P1↓ OFSET PTL P2↓</pre>
2 Press the [F4](P1↓) key, [F1](OFSET) key.	[F4] [F1]	<pre>OFFSET 1/2 F1:ANG.OFFSET F2:DIST.OFFSET F3:PLANE OFFSET P↓</pre>
3 Press the [F4](P1↓) key.	[F4]	<pre>OFFSET 2/2 F1:COLUMN OFFSET P↓</pre>
4 Press the [F1](COLUMN OFFSET) key.	[F1]	<pre>COLUMN OFFSET Center HD: m MEAS --- --- ---</pre>
5 Collimate the center of the column (P1) and press the [F1](MEAS) key. Measuring will start.	Collimate P1 [F1]	<pre>COLUMN OFFSET Center HD* [n] << m >Measuring...</pre>
After the measurement, angle measuring display of the left side (P2) will be shown.		↓
		<pre>COLUMN OFFSET Left HR: 120°30'40" --- --- --- SET</pre>

<p>6 Collimate the left side of the column (P2) and press the [F4](SET) key. After the measurement, angle measuring display of the right side (P3) will be shown.</p>	<p>Collimate P2 [F4]</p>	<pre> COLUMN OFFSET Right HR: 180°30'40" --- --- --- SET </pre>
<p>7 Collimate the right side of the column (P3) and press the [F4](SET) key. The distance between the instrument and center of the column (P0) will be calculated.</p>	<p>Collimate P3 [F4]</p>	<pre> COLUMN OFFSET HR: 150°30'40" HD: 43.321 m >OK? [YES] [NO] </pre>
<p>To show the relative elevation (VD), press the [▲] key. Each time pressing the [▲] key, horizontal distance, relative elevation and slope distance are shown in sequence. To show coordinate of point P0, press the [↖] key.</p>	<p>[▲]</p>	<pre> COLUMN OFFSET HR: 150°30'40" VD: 2.321 m >OK? [YES] [NO] </pre>
<p>8 Press the [F3](YES) key. The display returns to the next point number in data collect mode.</p>	<p>[F3]</p>	<pre> PT# →PT-12 PCODE :SOKKIA R.HT : 1.200 m INPUT SRCH MEAS ALL </pre>

7.4 NEZ Auto Calculation

As measured data is collected, coordinates are calculated and stored for traverse or topo collection. Automatic making out function of coordinate data sets up in CONFIG of data collect. Refer to Section 7.7 "Setting Parameter of Data Collect [CONFIG.]".

As a default, coordinate data calculated will be saved in a file of the same name as the measurement data file.

When the coordinate data file of the same name as the measurement data file does not exist, it will be generated automatically.

It is possible to change a file for saving coordinate data in the DATA COLLECT Menu 2/2 (F1: SELECT A FILE).


To calculate a coordinate data, it is necessary to add a point number in Data Collect execution.

When a coordinate data of the same point number exist already, it can be replaced with the new data by confirming display.

- **Coordinates will be calculated using the grid factor.**
To set the grid factor, see Section 6.2 "Setting the GRID FACTOR".

7.5 Point to Line Measurement

In this mode, a offsetting point from a certain determined line can be measured.

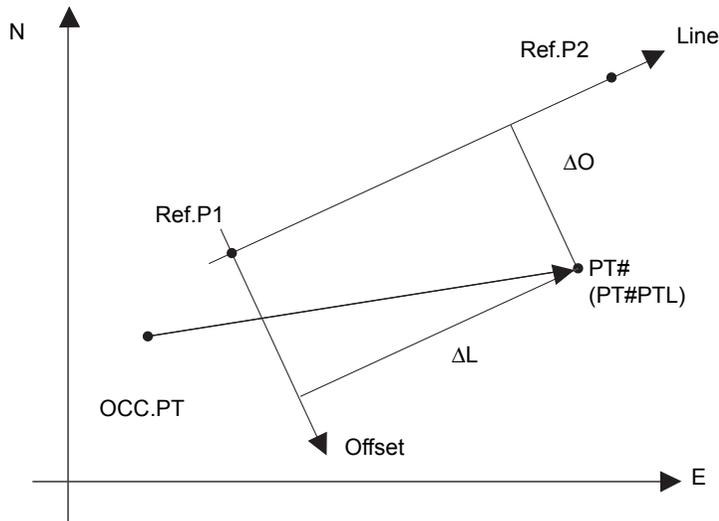

7.5.1 To change to the point to line measurement

Operating procedure	Operation	Display
1 Press the [F3](MEAS) key and press the [F4]key to get to the next soft key page.	[F3] [F4]	PT# →PT-01 PCODE :SOKKIA R.HT : 1.500 m INPUT SRCH MEAS ALL
		PT# →PT-01 PCODE :SOKKIA R.HT : 1.500 m VH *SD NEZ P1↓ OFSET PTL P2↓
2 Press the [F2](PTL) key.	[F2]	POINT TO LINE MODE [F1:ON] F2:OFF ENTER
3 Press the [F1](ON) key and press the [F4](ENTER) key. The input screen of a reference point 1 will appear.	[F4]	REF. POINT 1 PT#: _____ INPUT LIST --- ENTER
4 Enter the point 1 data and press the [F4](Enter). The input screen of a reference point 2 will appear.	Input data [F4]	REF. POINT 2 PT#: _____ INPUT LIST --- ENTER
5 Enter the point 2 data and press the [F4](Enter). The screen will return to data collect measurement. If the PTL measurement mode is available, 'PTL' will appear next to PT#.	Input data [F4]	PT#PTL→PT-01 PCODE :SOKKIA R.HT : 1.500 m INPUT SRCH MEAS ALL

7.5.2 Executing a point to line measurement

Operating procedure	Operation	Display
<p>Conduct data measurement according to the same procedure as with ordinary FS/SS (ALL can also be selected). However, when you conduct observation in the angle mode, PTL data will not be displayed (only the raw data will be recorded, upon which the operation will end).</p> <p>1 Press the [F3](MEAS) key.</p> <p>2 Press the [F2](SD) key. If the PTL mode is on, then, after the coordinate data is calculated, the PTL data will be displayed regardless of the coordinate check setting, etc.</p> <p>3 PTL measurement data will display. Confirm the data and press [F3](YES) key. The recorded data are measured data and coordinate data generated at the same time as a PTL data.</p>	<p>[F3]</p> <p>[F2]</p> <p>[F3]</p>	<pre>PT#PTL→PT-01 PCODE :SOKKIA R.HT : 1.500 m INPUT SRCH MEAS ALL</pre> <pre>PT#PTL→PT-01 PCODE :SOKKIA R.HT : 1.500 m VH *SD NEZ</pre> <pre>V : 90°10'20" HR: 120°30'40" SD* < m > Measuring...</pre> <pre>L: 44.789 m O: 33.456 m E: 2.321 m >REC? [YES] [NO]</pre> <pre>PT#PTL→PT-02 PCODE :SOKKIA R.HT : 1.500 m INPUT SRCH MEAS ALL</pre>
<ul style="list-style-type: none"> ● In the PTL measurement mode, NEZ Auto Calculation will be turned on compulsorily and the coordinate data will be stored into a coordinate file. 		

7.6 Editing PCODE Library [PCODE INPUT]

PCODE data can be entered into PCODE Library in this mode.

A PCODE is linked with a number of 1 to 50.

PCODE can be also edited in MEMORY MANAGER menu 2/3 in the same way.

Operating procedure	Operation	Display
<p>1 Press the [F2](PCODE INPUT) key from Data Collect menu 2/2.</p>	[F2]	<pre>DATA COLLECT 2/2 F1:SELECT A FILE F2:PCODE INPUT F3:CONFIG. P↓</pre>
<p>2 By pressing the following keys, the list will increase or decrease. [▲] or [▼]: Increasing or Decreasing one by one [▶] or [◀]: By ten Increasing or Decreasing.</p>	[▲] or [▼] [▶] or [◀]	<pre>→ 001:SOKKIA 002:TOKYO EDIT --- CLR ---</pre>
<p>3 Press the [F1](EDIT) key.</p>	[F1]	<pre>011:URAH → 012:AMIDAT 013:HILLTO EDIT --- CLR ---</pre>
<p>4 Enter PCODE and press the [F4](ENT) key. *1)</p>	Enter PCODE [F4]	<pre>011:URAH → 012:AMISUN 013:HILLTO EDIT --- CLR ---</pre>
<p>*1) Refer to Section 2.5 "How to Enter Alphanumeric characters".</p>		

7.7 Setting Parameter of Data Collect [CONFIG.]

In this mode, the following settings of data collect mode are possible.

- **Setting Items**

Menu	Selecting Item	Contents
F1: DIST MODE	FINE/CRS(1)/ CRS(10)	Select Fine/Coarse (1)/Coarse (10) mode in distance measurement mode. The unit to be displayed is as follows. Fine mode: 1mm (0.2mm) Coarse (1) mode: 1mm Coarse (10) mode: 10mm
F2: HD/SD	HD/SD	Select the distance measurement mode Horizontal distance or Slope distance.
F3: MEAS. SEQ.	N-TIMES/ SINGLE/REPEAT	Select to set measurement mode for distance measurement.
F1: DATA CONFIRM	YES/NO	It is possible to confirm the result of measuring data before the data is recorded.
F2: COLLECT SEQ.	[EDIT→MEAS]/ [MEAS→EDIT]	Select the procedure of data collection. [EDIT→MEAS]: Measurement is carried out after entering other data. [MEAS→EDIT]: Measurement is carried out before entering other data.
F3: NEZ AUTO. CALC	ON/OFF	It is possible to calculate coordinate value of data collected and store it into coordinate data file in every data collection.

- **How to Set Items**

Example Setting: DATA CONFIRM: YES

Operating procedure	Operation	Display
<p>1 Press the [F3] (CONFIG.) key from the data collect menu 2/2. The CONFIG menu 1/2 is shown.</p> <p>2 Press the [F4](P↓) key to display the CONFIG menu 2/2.</p> <p>3 Press the [F1] (DATA CONFIRM) key. [] indicates the current setting.</p> <p>4 Press the [F1] (YES) key.</p> <p>5 Press the [F4] (ENTER) key.</p>	[F3]	<pre>DATA COLLECT 2/2 F1:SELECT A FILE F2:PCODE INPUT F3:CONFIG. P↓</pre>
	[F4]	<pre>CONFIG. 1/2 F1:DIST MODE F2:HD/SD F3:MEAS. SEQ. P↓</pre>
	[F4]	<pre>CONFIG. 2/2 F1:DATA CONFIRM F2:COLLECT SEQ. F3:NEZ AUTO. CALC P↓</pre>
	[F1]	<pre>DATA CONFIRM F1:YES [F2:NO] ENTER</pre>
	[F1]	<pre>DATA CONFIRM [F1:YES] F2:NO ENTER</pre>
[F4]		

8 LAYOUT

LAYOUT mode has two functions which are setting of layout points and setting new points using coordinate data in the internal memory.

Also, if the coordinate data is not stored in the internal memory, this can be input from key board. The coordinate data is loaded from PC to the internal memory via RS-232C.

- The coordinate data

The coordinate data is memorized into a file.

For the internal memory, refer to Chapter 9 “MEMORY MANAGER MODE”.

The SET is able to store the coordinate data into the internal memory.

The internal memory is shared by the measured data and the coordinate data for layout.

Maximum 30 files can be generated.

- **The number of coordinate data**

(In case not using the internal memory in the data collect mode)


MAX. 24,000 points

Because the internal memory covers both data collection mode and layout mode, the number of coordinate data will be decreased when the data collection mode is used.

- | |
|---|
| <ol style="list-style-type: none">1) When turning off the power, ensure that you are in the main menu screen or main angle measurement mode.
This ensures completion of the memory access process and avoids possible damage to the stored data.2) It is recommended for safety to charge the battery (BT-G1S) beforehand and prepare fully charged spare batteries.3) When recording new point data, remember to consider the amount of internal memory available. |
|---|

● **Layout menu operation**

By pressing the [MENU] key, the instrument will be in MENU 1/3 mode.
Press the [F2](LAYOUT) key, the menu of layout 1/2 will be shown.

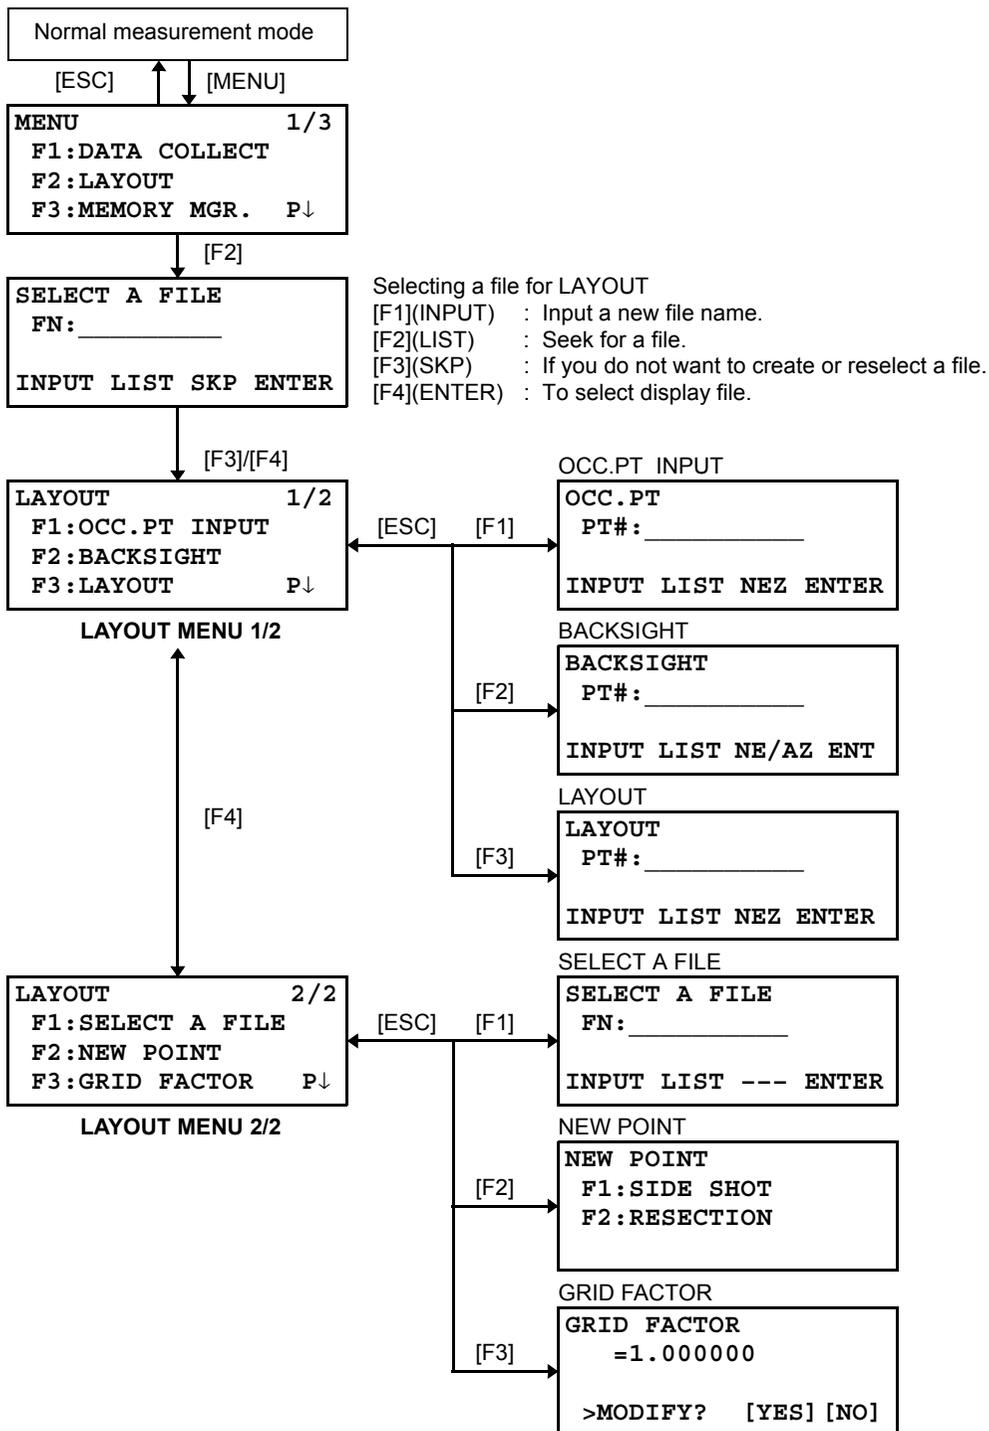

8.1 Preparation

8.1.1 Setting the GRID FACTOR

- Calculation Formula

- 1) Elevation Factor

$$\text{Elevation Factor} = \frac{R}{R + \text{ELEV.}}$$

R : The average radius of the earth
 ELEV. : The elevation above mean sea level

- 2) Scale Factor

Scale Factor: Scale Factor at the surveying station

- 3) Grid Factor

Grid Factor = Elevation Factor × Scale Factor

- Distance Calculation

- 1) Grid Distance

$$\text{HDg} = \text{HD} \times \text{Grid Factor}$$

HDg : Grid distance
 HD : Ground distance

- 2) Ground Distance

$$\text{HD} = \frac{\text{HDg}}{\text{Grid Factor}}$$

- How to Set Grid Factor

Operating procedure	Operation	Display
1 Press the [F3](GRID FACTOR) key from the Layout menu 2/2.	[F3]	LAYOUT 2/2 F1:SELECT A FILE F2:NEW POINT F3:GRID FACTOR P↓
2 Press the [F3](YES) key.	[F3]	GRID FACTOR =0.998843 >MODIFY? [YES] [NO]
3 Enter Elevation. *1) Press the [F4](ENT) key.	Enter ELEV. [F4]	GRID FACTOR ELEV.=1000 m SCALE:0.999000 --- --- [CLR] [ENT]
4 Enter Scale Factor in the same way. Grid Factor is displayed for 1 to 2 second and display returns to Layout menu 2/2.	Enter Scale [F4]	GRID FACTOR =1.000686
*1) Refer to Section 2.5 "How to Enter Alphanumeric characters". ● Input Range: Elevation : -9,999 to +9,999 meter (-32,805 to +3,2805 ft, ft+in) Scale Factor: 0.990000 to 1.010000		

8.1.2 Selecting Coordinate Data File

You can execute a Layout from selected coordinate data file, also you can record New point measured data into the selected coordinate data file.

- The only coordinate data file existing can be selected and you can not make a new file in this mode. For more information about File, refer to Chapter 9 "MEMORY MANAGER MODE".
- When LAYOUT MODE is begun, a file can be selected in the same way.

Operating procedure	Operation	Display
<p>1 Press the [F1](SELECT A FILE) key from the Layout menu 2/2.</p> <p>2 Press the [F2](LIST) key to display the list of coordinate data file.*1)</p> <p>3 Scroll file list by pressing the [▲] or [▼] key and select a file to use. *2), 3)</p> <p>4 Press the [F4](ENTER) key. The file will be set.</p>	[F1]	<pre>LAYOUT 2/2 F1:SELECT A FILE F2:NEW POINT F3:GRID FACTOR P↓</pre>
	[F2]	<pre>SELECT A FILE FN: _____ INPUT LIST --- ENTER</pre>
	[▲] or [▼]	<pre>COORDDATA /C0123 →*TOKBDATA /C0345 TOPCDATA /C0789 --- SRCH --- ENTER</pre>
	[F4]	<pre>*TOKBDATA /C0345 → TOPCDATA /C0789 SATIDATA /C0456 --- SRCH --- ENTER</pre>
		<pre>LAYOUT 2/2 F1:SELECT A FILE F2:NEW POINT F3:GRID FACTOR P↓</pre>
<p>*1) If you want to input file name directly, press the [F1](INPUT) key and enter a file name.</p> <p>*2) When a file has been selected already, '*' mark is indicated on left of current file name. For the file discrimination mark (*, @, &), refer to Section 9.3 "FILE MAINTENANCE".</p> <p>*3) Data in a file shown with arrow can be searched by pressing the [F2](SRCH) key.</p>		

8.1.3 Setting Occupied Point

Occupied point can be set by two setting methods as follows.

- 1) Setting from the coordinate data stored in the internal memory.
- 2) Direct key input of coordinate data.

- Example setting: Setting the occupied point from the internal coordinate data file

Operating procedure	Operation	Display
1 Press the [F1](OCC.PT INPUT) key from the Layout menu 1/2.	[F1]	OCC.PT PT#: _____ INPUT LIST NEZ ENTER
2 Press the [F1] (INPUT) key, enter PT# and press the [F4](ENT) key. *1)	[F1] Enter PT# [F4]	INSTRUMENT HEIGHT INPUT INS.HT= 0.000 m --- --- [CLR] [ENT]
3 Enter INS.HT in the same way. The display returns to layout menu 1/2.	Enter INS.HT [F4]	LAYOUT 1/2 F1:OCC.PT INPUT F2:BACKSIGHT F3:LAYOUT P↓
*1) Refer to Section 2.5 "How to Enter Alphanumeric characters".		

- Example setting: Setting Instrument point coordinates directly

Operating procedure	Operation	Display
1 Press the [F1](OCC.PT INPUT) key from the Layout menu 1/2.	[F1]	OCC.PT PT#: _____ INPUT LIST NEZ ENTER
2 Press the [F3] (NEZ) key.	[F3]	N→ 0.000 m E: 0.000 m Z: 0.000 m INPUT --- PT# ENTER
3 Press the [F1](INPUT) key and enter coordinate value. press the [F4](ENT) key. *1), 2)	[F1] Enter coord. [F4]	COORD.DATA INPUT PT#: _____ INPUT --- --- ENTER
4 Press the [F1](INPUT) key and enter PT#. Press the [F4](ENT) key. *2)	[F1] Enter PT# [F4]	INSTRUMENT HEIGHT INPUT INS.HT= 0.000 m --- --- [CLR] [ENT]
5 Enter Instrument Height in the same way. The display returns to layout menu 1/2.	Enter INS.HT [F4]	LAYOUT 1/2 F1:OCC.PT INPUT F2:BACKSIGHT F3:LAYOUT P↓
*1) Refer to Section 2.5 "How to Enter Alphanumeric characters".		
*2) It is possible to record the coordinate value. Refer to Chapter 16 "SELECTING MODE".		

8.1.4 Setting Backsight Point

The following three setting methods for Backsight point can be selected.


- 1) Setting from the coordinate data file stored in the internal memory.
- 2) Direct key input of coordinate data.
- 3) Direct key input of setting angle.

- Example setting: Setting the backsight point from the internal coordinate data file

Operating procedure	Operation	Display
1 Press the [F2](BACKSIGHT) key from the Layout menu 1/2.	[F2]	<pre>BACKSIGHT PT#: _____ INPUT LIST NE/AZ ENT</pre>
2 Press the [F1] (INPUT) key.	[F1]	<pre>BACKSIGHT PT#=BK-01 [ALP] [SPC] [CLR] [ENT]</pre>
3 Enter PT#, press the [F4](ENT) key. *1)	Enter PT# [F4]	<pre>BACKSIGHT H(B) = 0°00'00" >Sight ? [YES] [NO]</pre>
4 Sight the backsight point and press the [F3](YES) key. The display returns to the layout menu 1/2.	Sight BK [F3]	

*1) Refer to Section 2.6 "How to enter alphanumeric characters".

- With each pressing of [F3] key, method of inputting backsight is changed.

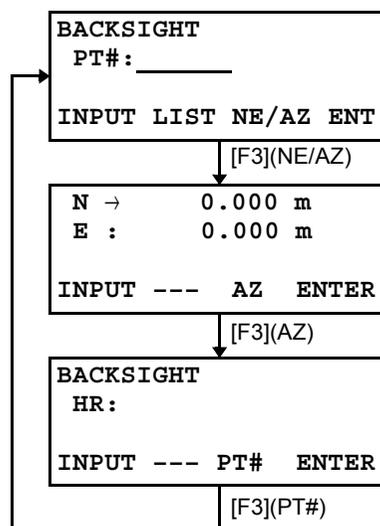

- Example setting: Setting the backsight point coordinates directly

Operating procedure	Operation	Display
1 Press the [F2](BACKSIGHT) key from the Layout menu 1/2.	[F2]	<pre> BACKSIGHT PT#: INPUT LIST NE/AZ ENT </pre>
2 Press the [F3] (NE/AZ) key.	[F3]	<pre> N→ 0.000 m E: 0.000 m INPUT --- AZ ENTER </pre>
3 Press the [F1](INPUT) key and enter coordinate value. Press the [F4](ENT) key. *1), 2)	[F1] Enter coord. [F4]	<pre> BACKSIGHT H(B) = 0°00'00" >Sight ? [YES] [NO] </pre>
4 Sight the backsight point.	Sight BK	
5 Press the [F3](YES) key. The display returns to the layout menu 1/2.	[F3]	<pre> LAYOUT 1/2 F1:OCC.PT INPUT F2:BACKSIGHT F3:LAYOUT P↓ </pre>
<p>*1) Refer to Section 2.5 "How to Enter Alphanumeric characters".</p> <p>*2) It is possible to record the coordinate value. Refer to Chapter 16 "SELECTING MODE".</p>		

8.2 Executing a Layout

The following methods can be selected for executing a Layout:

- 1) Recalling points from internal memory by point number.
- 2) Direct key input of coordinate values.

Example setting: Recalling point from internal memory.

Operating procedure	Operation	Display
		<pre>LAYOUT 1/2 F1:OCC.PT INPUT F2:BACKSIGHT F3:LAYOUT P↓</pre>
1 Press the [F3](LAYOUT) key from the layout menu 1/2.	[F3]	<pre>LAYOUT PT#: _____ INPUT LIST NEZ ENTER</pre>
2 Press the [F1](INPUT) key, and enter PT#. *1) Press the [F4](ENT) key. *2)	[F1] Enter PT# [F4]	<pre>REFLECTOR HEIGHT INPUT R.HT = 0.000 m --- --- [CLR] [ENT]</pre>
3 Enter reflector height in the same way. When the layout point is set, the instrument will start layout calculation. HR: Calculated horizontal angle of the layout point HD: Calculated horizontal distance from the instrument to the layout point	Enter R.HT [F4]	<pre>CALCULATED HR= 90°10'20" HD= 123.456 m ANGLE DIST --- ---</pre>
4 Collimate the prism, and press the [F1](ANGLE) key. PT#: Layout point HR: Measured (Actual) horizontal angle. dHR: Horizontal angle to be turned to the layout point = Actual horizontal angle - Calculated horizontal angle. Correct direction when dHR = 0°00'00"	Collimate P [F1]	<pre>PT#: LP-100 HR: 6°20'40" dHR: 23°40'20" DIST --- NEZ ---</pre>
5 Press the [F1](DIST) key. HD: Measuring (Actual) horizontal distance dHD: Horizontal distance to be turned to the layout point = Actual horizontal distance – Calculated horizontal distance. dZ: Vertical distance to be turned to the layout point = Actual vertical distance – Calculated vertical distance.	[F1]	<pre>HD* [t] < m dHD: m dZ: m MODE ANGLE NEZ NEXT</pre> <p style="text-align: center;">↓</p> <pre>HD* 143.84 m dHD: -13.34 m dZ: -0.05 m MODE ANGLE NEZ NEXT</pre>
6 Press the [F1](MODE) key. The fine mode measuring starts.	[F1]	<pre>HD* [r] < m dHD: m dZ: m MODE ANGLE NEZ NEXT</pre> <p style="text-align: center;">↓</p> <pre>HD* 156.835 m dHD: -3.327 m dZ: -0.046 m MODE ANGLE NEZ NEXT</pre>


8.2.1 Layout of Coordinates of Point to Line

The coordinate data of point to line can be used during execution of layout.

When a point name including PTL coordinates (including 'From' and 'To' data) is specified, the mode will change to PTL mode automatically.

There are two ways to enter the PTL coordinate data, Direct key input and Data transfer.

Refer to 9.4.2 "PTL (Point to Line) data input" and 9.7 "Data Communications".

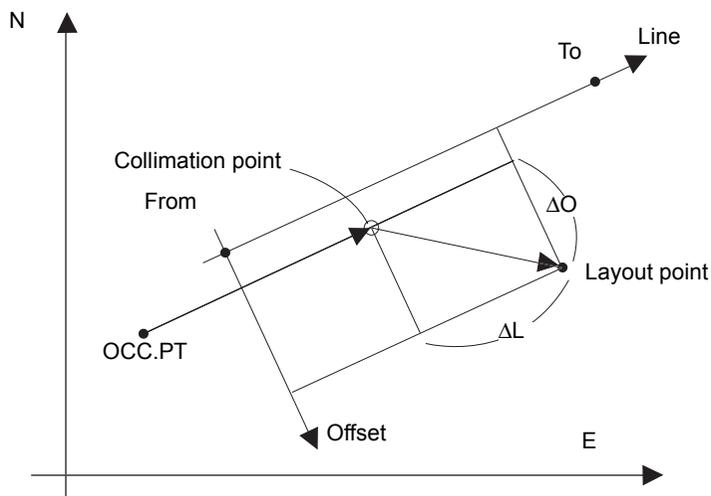


Operating procedure	Operation	Display
<p>1 Press the [F1](INPUT) key, and enter PT#. Press the [F4](ENT) key.</p> <p>2 Enter reflector height in the same way.</p> <p>When the layout point is set, the instrument will start layout calculation. The [F3](PTL) key will be assigned.</p> <p>3 Collimate the prism, and press the [F1](ANGLE) key.</p> <p>4 Press the [F1](DIST) key.</p> <p>HD: Measuring (Actual) horizontal distance dHD: Horizontal distance to be turned to the layout point = Actual horizontal distance – Calculated horizontal distance. dZ: Vertical distance to be turned to the layout point = Actual vertical distance – Calculated vertical distance.</p> <p>5 Press the [F2](PTL) key.</p> <p>The difference between Collimation point and Layout point distance on the coordinate system of the line determined will be displayed.</p>	[F1] Enter PT# [F4]	<pre>LAYOUT PT#: PT-21 INPUT LIST NEZ ENTER</pre>
	Enter R.HT [F4]	<pre>REFLECTOR HEIGHT INPUT R.HT : 1.500 m --- --- [CLR] [ENT]</pre>
	Collimate P [F1]	<pre>CALCULATED HR= 45°10'20" HD= 1.500 m ANGLE DIST PTL ---</pre>
	[F1]	<pre>PT#: LP-100 HR: 45°00'00" dHR: 0°00'00" DIST --- PTL ---</pre>
	[F2]	<pre>HD* 143.84 m dHD: -13.34 m dZ: -0.05 m MODE PTL NEXT</pre>
		<pre>dL: 0.005 m dO: 0.327 m dE: 0.046 m MODE ANGLE NEXT</pre>

8.3 Setting a New Point

New point is required for example when a layout point cannot be sighted from existing control points.

8.3.1 Side Shot Method

Set up the instrument at a known point, and measure the coordinate of the new points by the side shot method

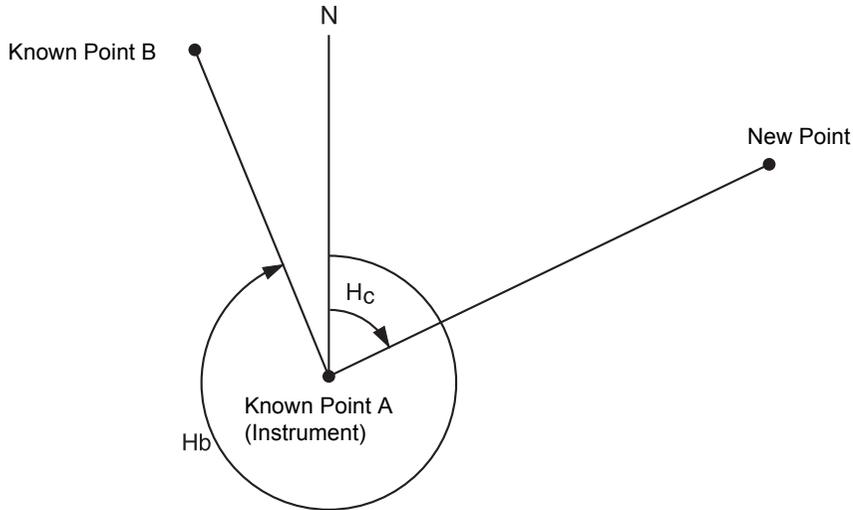

Operating procedure	Operation	Display
<p>1 Press the [F4](↓) key from the layout menu 1/2 to get the layout menu 2/2.</p> <p>2 Press the [F2](NEW POINT).</p> <p>3 Press the [F1](SIDE SHOT) key.</p> <p>4 Press the [F2](LIST) key to display the list of coordinate data file. *1)</p> <p>5 Scroll file list by pressing [▲] or [▼] key and select a file to use. *2), 3)</p>	[F4]	<pre>LAYOUT 1/2 F1:OCC.PT INPUT F2:BACKSIGHT F3:LAYOUT P↓</pre>
	[F4]	<pre>LAYOUT 2/2 F1:SELECT A FILE F2:NEW POINT F3:GRID FACTOR P↓</pre>
	[F2]	<pre>NEW POINT F1:SIDE SHOT F2:RESECTION</pre>
	[F1]	<pre>SELECT A FILE FN: _____ INPUT LIST ----ENTER</pre>
	[F2]	<pre>COORDDATA /C0123 →*TOKBDATA /C0345 TOPCDATA /C0789 --- SRCH --- ENTER</pre>
[▲] or [▼]	<pre>*TOKBDATA /C0345 → TOPCDATA /C0789 SATIDATA /C0456 --- SRCH --- ENTER</pre>	

<p>6 Press the [F4](ENTER) key. The file will be set .</p>	[F4]	<pre>SIDE SHOT PT#: _____ INPUT SRCH --- ENTER</pre>
<p>7 Press the [F1](INPUT) key, and enter the new point name. *4) Press the [F4](ENT) key.</p>	<p>[F1] Enter PT# [F4]</p>	<pre>REFLECTOR HEIGHT INPUT R.HT = 0.000 m --- --- [CLR] [ENT]</pre>
<p>8 Enter reflector height in the same way.</p>	<p>Enter R.HT [F4]</p>	<pre>REFLECTOR HEIGHT INPUT R.HT : 1.235 m >Sight ? [YES] [NO]</pre>
<p>9 Collimate the new point, and press the [F3](YES) key. Distance measuring starts.</p>	<p>Collimate [F3]</p>	<pre>HR: 123°40'20" HD* [n] < m VD: m > Measuring... < complete ></pre>
<p>10 Press the [F3](YES) key.*5) The name and coordinate value are stored into COORD.DATA. The input menu for next new point is displayed. PT# is automatically incremented.</p>	[F3]	<pre> ↓ N : 1234.567 m E : 123.456 m Z : 1.234 m >REC ? [YES] [NO] SIDE SHOT PT#:NP-101 INPUT SRCH --- ENTER</pre>
<p>*1) If you want to input file name directly, press the [F1](INPUT) key and enter a file name. *2) When a file has been selected already, "*" mark is indicated on left of current file name. For the file discrimination mark (*, @, &), refer to Chapter 9.3 "FILE MAINTENANCE". *3) Data in a file shown with arrow can be searched by pressing [F2](SRCH) key. *4) Refer to Section 2.5 "How to Enter Alphanumeric characters". *5) An error will be displayed when the internal memory is full.</p>		

8.3.2 Resection Method


Set up the instrument at a new point, and calculate the coordinate of the new point using the coordinate data of maximum seven known points and the measurements made to these points.

By following observation, resection is possible.

- Resection by distance measurement: 2 or more points must be measured
- Resection by angle measurement only: 3 or more points must be measured

An occupied point coordinate value will be calculated by the method of least squares.

(In case that 3 known points are measured by angle measurement only, the value would not be calculated by the method of least squares.)

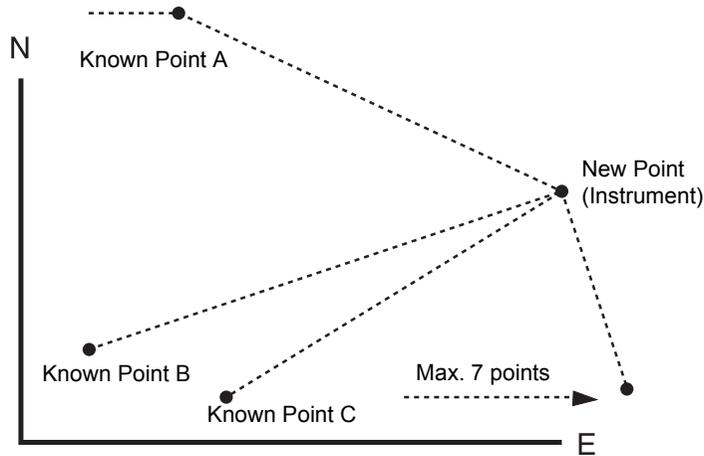

Operating procedure	Operation	Display
<p>1 Press the [F4](↓) key from the layout menu 1/2 to get the layout menu 2/2.</p> <p>2 Press the [F2](NEW POINT).</p> <p>3 Press the [F2](RESECTION) key.</p> <p>4 Press the [F1](INPUT) key, and enter the new point name. *1), 2) Press the [F4](ENT) key.</p>	[F4]	<pre>LAYOUT 1/2 F1:OCC.PT INPUT F2:BACKSIGHT F3:LAYOUT P↓</pre>
	[F4]	<pre>LAYOUT 2/2 F1:SELECT A FILE F2:NEW POINT F3:GRID FACTOR P↓</pre>
	[F2]	<pre>NEW POINT F1:SIDE SHOT F2:RESECTION</pre>
	[F2]	<pre>NEW POINT PT#: _____ INPUT SRCH SKP ENTER</pre>
	[F1] Enter PT# [F4]	<pre>INSTRUMENT HEIGHT INPUT INS.HT = 0.000 m --- --- [CLR] [ENT]</pre>

5 Enter instrument height in the same way.

6 Enter the known point A number. *3)

7 Enter reflector height.

8 Collimate the known point A, and press the [F3](ANG) or [F4](DIST) key.
Example: [F4](DIST)
Distance measuring starts.

Known point B entering display will be shown.

9 Same as procedure **6** to **8** proceed to the known point B.

When two points have been measured by the [F4](DIST) key, the RESIDUAL ERROR will be calculated. *4)

10 Select GRID FACTOR for calculation of RESIDUAL ERROR by pressing [F1] or [F2] key. *5)
Example: [F1]

11 Press the [F1](NEXT) key to measure other points.
Maximum seven points can be measured.

12 Same as procedure **6** to **8** proceed to the known point C.

Enter
INS.HT
[F4]

[F1]
Enter PT#
[F4]

Enter R.HT
[F4]

Collimate A
[F4]

```
NO01#
PT#: _____
INPUT LIST NEZ ENTER
```

```
REFLECTOR HEIGHT
INPUT
R.HT = 0.000 m
--- --- [CLR] [ENT]
```

```
REFLECTOR HEIGHT
INPUT
R.HT : 1.235 m
>Sight ? ANG DIST
```

```
HR: 123°40'20"
HD* < m
VD: m
> Measuring...
< complete >
```

↓

```
NO02#
PT#: _____
INPUT LIST NEZ ENTER
```

↓

```
SELECT GRID FACTOR
F1:USE LAST DATA
F2:CALC MEAS.DATA
```

[F1]

```
RESIDUAL ERROR
dHD= 0.015 m
dZ = 0.005 m
NEXT --- G.F CALC
```

[F1]

```
NO03#
PT#: _____
INPUT LIST NEZ ENTER
```

⋮

```
HR: 123°40'20"
HD* < m
VD: m
> Measuring...
< complete >
```

↓

```
HR: 123°40'20"
HD: 123.456 m
VD: 1.234 m
NEXT --- --- CALC
```

<p>13 Press the [F4](CALC) key. *6) Standard Deviation will be shown. Unit: (sec.) or (mGON) or (mMIL)</p>	[F4]	<table border="1"> <tr><td colspan="2">Standard Deviation</td></tr> <tr><td>=</td><td>1.23 sec.</td></tr> <tr><td>---</td><td>↓</td></tr> <tr><td>---</td><td>NEZ</td></tr> </table>	Standard Deviation		=	1.23 sec.	---	↓	---	NEZ		
Standard Deviation												
=	1.23 sec.											
---	↓											
---	NEZ											
<p>14 Press the [F2](↓) key. Standard Deviations of each coordinate will be shown. Unit: (mm) or (inch) The display will be changed alternately by pressing [F2](↓) or (↑) key.</p>	[F2]	<table border="1"> <tr><td>SD (n) :</td><td>1.23 mm</td></tr> <tr><td>SD (e) :</td><td>1.23 mm</td></tr> <tr><td>SD (z) :</td><td>1.23 mm</td></tr> <tr><td>---</td><td>↑</td></tr> <tr><td>---</td><td>NEZ</td></tr> </table>	SD (n) :	1.23 mm	SD (e) :	1.23 mm	SD (z) :	1.23 mm	---	↑	---	NEZ
SD (n) :	1.23 mm											
SD (e) :	1.23 mm											
SD (z) :	1.23 mm											
---	↑											
---	NEZ											
<p>15 Press the [F4](NEZ) key. Coordinate data of the new point will be shown.</p>	[F4]	<table border="1"> <tr><td>N :</td><td>65.432 m</td></tr> <tr><td>E :</td><td>876.543 m</td></tr> <tr><td>Z :</td><td>1.234 m</td></tr> <tr><td>>REC ?</td><td>[YES] [NO]</td></tr> </table>	N :	65.432 m	E :	876.543 m	Z :	1.234 m	>REC ?	[YES] [NO]		
N :	65.432 m											
E :	876.543 m											
Z :	1.234 m											
>REC ?	[YES] [NO]											
<p>16 Press the [F3](YES) key. *7) The new point data will be stored into the coordinate data file and the value of occupied coordinate data will change to that of the calculated NEW POINT. The display returns to new point menu.</p>	[F3]	<table border="1"> <tr><td colspan="2">NEW POINT</td></tr> <tr><td>F1:</td><td>SIDE SHOT</td></tr> <tr><td>F2:</td><td>RESECTION</td></tr> </table>	NEW POINT		F1:	SIDE SHOT	F2:	RESECTION				
NEW POINT												
F1:	SIDE SHOT											
F2:	RESECTION											
<p>*1) Refer to Section 2.5 "How to Enter Alphanumeric characters".</p> <p>*2) When there is no need to memorize the new point data, press the [F3](SKP) key.</p> <p>*3) To enter the known point coordinate data by direct key inputting, press the [F3](NEZ) key.</p> <p>*4) RESIDUAL ERROR; dHD (Horizontal distance between two known points) = Measured value – Calculated value dZ = (Z coordinate of the new point calculated from known point A) – (Z coordinate of the new point calculated from known point B)</p> <p>*5) [F1:USE LAST DATA]; RESIDUAL ERROR is calculated with GRID FACTOR already set. [F2:CALC MEAS.DATA]; RESIDUAL ERROR is calculated without GRID FACTOR already set. In this case, new GRID FACTOR is calculated from measured data and reset." •To see the GRID FACTOR value, press the [F3](G.F.) key.</p> <p>*6) In case that the all points are measured by angle measurement only, the following display will be shown. You can select Z coordinate calculation.</p> <div data-bbox="507 1178 857 1323" style="border: 1px solid black; padding: 5px; margin: 10px auto; width: fit-content;"> <p>CALC. Z COORD. F1: YES F2: NO</p> </div> <p>F1(YES) : N, E, Z coordinates will be calculated with measured angle data. F2(NO) : N and E coordinates will be calculated with measured horizontal angle data. Z coordinate would not be calculated. (Z coordinate value =0.000m)</p> <p>When the distance measurement is done even one point, Z coordinate will be calculated as a mean value of relative distance (vertical distance data).</p> <p>*7) The display shows ">SET ?" when [F3](SKP) key pressed in step 4. In this case, the new point data is not stored into the coordinate data file, only the value of occupied coordinate data changes to that of the calculated NEW POINT.</p>												

● Viewing PT# LIST

You can see the PT# List and enter the data from the List, also you can see coordinate data of a point.
[Example: Executing Layout Mode]

Operating procedure	Operation	Display
<p>1 While executing the LAYOUT mode, press the [F2](LIST) key. The arrow (→) indicates selected data.</p> <p>2 By pressing the following keys, the list will increase or decrease. [▲] or [▼]: Increasing or Decreasing one by one. [▶] or [◀]: By ten Increasing or Decreasing.</p> <p>3 To show the coordinate of the selected data, press the [F1](VIEW) key. It is still possible to scroll the PT# data by pressing [▲] or [▼] key.</p> <p>4 Press the [ESC] key. The display returns to the List.</p> <p>5 Press the [F4] (ENTER) key. The selected point number is set as PT#.</p>	[F2]	<pre>LAYOUT PT#: _____ INPUT LIST NEZ ENTER</pre>
	[▲] or [▼] [▶] or [◀]	<pre>[SOKKIA] →DATA-01 DATA-02 VIEW SRCH --- ENTER</pre>
	[F1]	<pre>DATA-49 →DATA-50 DATA-51 VIEW SRCH --- ENTER</pre>
	[ESC]	<pre>PT# DATA-50 N] 100.234 m E] 12.345 m Z] 1.678 m</pre>
	[F4]	<pre>DATA-49 →DATA-50 DATA-51 VIEW SRCH --- ENTER</pre>
		<pre>REFLECTOR HEIGHT INPUT R.HT = 0.000 m --- --- [CLR] [ENT]</pre>
<p>● The operation of [F2](SRCH) is same as the "SEARCH" in the MEMORY MANAGER MODE. For more information, refer to Chapter 9 "MEMORY MANAGER MODE".</p>		

9 MEMORY MANAGER MODE


The following items for internal memory are available in this mode.

- 1) FILE STATUS : Checking the number of stored data/Remaining internal memory capacity.
- 2) SEARCH : Searching the recorded data.
- 3) FILE MAINTAN. : Deleting files/Editing file name
- 4) COORD. INPUT : Inputting coordinate data into Coord. data file.
- 5) DELETE COORD.: Deleting coordinate data from Coord. data file.
- 6) PCODE INPUT : Inputting PCODE DATA into PCODE Library
- 7) DATA TRANSFER: Sending measured data or coordinate data or PCODE Library data/
Uploading coordinate data or PCODE Library data/Setting communication parameters
- 8) INITIALIZE : Initializing internal memory.

● **Memory manager menu operation**

By pressing the [MENU] key, the instrument will be in MENU 1/3 mode.

Press the [F3](MEMORY MGR.) key, the menu of MEMORY MGR. 1/3 will be shown.

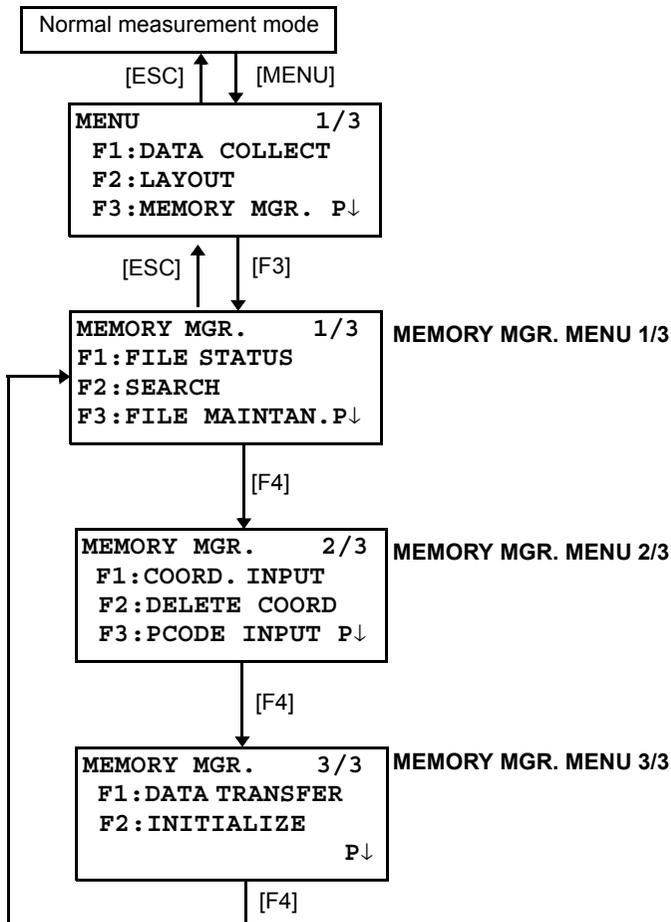

9.1 Display Internal Memory Status

This mode is used to check the internal memory status.

Operating procedure	Operation	Display
1 Press the [F3](MEMORY MGR.) key from the menu 1/3.	[F3]	<pre> MEMORY MGR. 1/3 F1:FILE STATUS F2:SEARCH F3:FILE MAINTAN P↓ </pre>
2 Press the [F1](FILE STATUS) key. The total number of stored measured data files and coordinate files are shown.	[F1]	<pre> FILE STATUS 1/2 MEAS. FILE : 3 COORD. FILE: 6 [.....] P↓ </pre> <p style="text-align: center;">↑ Remaining memory capacity</p>
3 Press the [F4](P↓) key. The total number of stored measured data and coordinate data in all files are shown.*1)	[F4]	<pre> DATA STATUS 2/2 MEAS. DATA :0100 COORD. DATA:0050 [.....] P↓ </pre>
<p>*1) Each coordinate file has one extra data for working area.</p> <ul style="list-style-type: none"> ● The FILE/DATA STATUS display will change alternately by pressing [F4](P↓) key. ● To return to MEMORY MGR. menu press the [ESC] key. 		

9.2 Searching Data

This mode is used to search the recorded file data in the DATA COLLECT or LAYOUT mode. The following 3 search methods in each type of files can be selected.

- 1: First data search
- 2: Last data search
- 3: Point number search(MEAS.DATA, COORD.DATA)
Number search (PCODE LIB.)

MEAS. DATA : Measured data in the data collect mode.

COORD. DATA : Coordinate data for layout, control points and new point data measured in the layout mode.

PCODE LIB. : The data which was registered with a number from 1 to 50 in Point code library. Point name (PT#, BS#), ID, PCODE and Height data (INS.HT, R.HT) can be corrected in the searching mode.

Measured value can not be corrected.

9.2.1 Measured Data Searching

Example: Point number searching

Operating procedure	Operation	Display
1 Press the [F3](MEMORY MGR.) key from the menu 1/3.	[F3]	<pre> MEMORY MGR. 1/3 F1:FILE STATUS F2:SEARCH F3:FILE MAINTAN P↓ </pre>
2 Press the [F2](SEARCH) key.	[F2]	<pre> SEARCH F1:MEAS. DATA F2:COORD. DATA F3:PCODE LIB. </pre>
3 Press the [F1](MEAS. DATA) key.	[F1]	<pre> SELECT A FILE FN: _____ INPUT LIST --- ENTER </pre>
4 Press the [F1](INPUT) key and enter File Name. Press the [F4](ENT) key. *1),2)	[F1] Enter FN [F4]	<pre> MEAS. DATA SEARCH F1:FIRST DATA F2:LAST DATA F3:PT# DATA </pre>
5 Press the [F3](PT# DATA) key.	[F3]	<pre> PT# DATA SEARCH PT#: _____ INPUT --- --- ENTER </pre>
6 Press the [F1](INPUT) key and enter PT#. Press the [F4](ENT) key. *1)	[F1] Enter PT# [F4]	<pre> PT# TOP-104 2/2 V 98°36'20" HR 160°40'20" TILT 0°00'00" ↓ </pre>
7 Press the [F4](↓) key to scroll data for selected point.	[F4]	<pre> PT# TOP-104 1/2 PCODE R.HT 1.200 m EDIT ↓ </pre>

*1) Refer to Section 2.6 "How to enter alphanumeric characters".

*2) To show the file list, press the [F2](LIST) key.

- "↓" represents data shown on the display is the stored data.
- Press the [▲] or [▼] key to scroll to next or previous point.
- To search MEAS. DATA of the same point number, press [◀] or [▶] key.

● **To edit the data in searching mode**

Point name (PT#, BS#), ID, PCODE and Height data (INS.HT, R.HT) can be corrected in the searching mode.

Measured value can not be corrected.

Operating procedure	Operation	Display
<p>1 Press the [F1](EDIT) key from last page of displayed data.</p> <p>2 Select the item to correct by pressing [▲] or [▼] key.</p> <p>3 Press the [F1](INPUT) key and enter data. *1) Press the [F4](ENT) key.</p> <p>4 Press the [F4](ENTER) key.</p> <p>5 Press the [F3](YES) key.</p>	<p>[F1]</p> <p>[▲] or [▼]</p> <p>[F1] Enter Data</p> <p>[F4] [F4]</p> <p>[F3]</p>	<pre>PT#]TOP-104 2/2 PCODE] R.HT] 1.000 m EDIT ↓</pre> <pre>PT# →TOP-104 PCODE : R.HT : 1.000 m INPUT --- --- ENTER</pre> <pre>PT# :TOP-104 PCODE : R.HT → 1.000 m INPUT --- --- ENTER</pre> <pre>PT# →TOP-104 PCODE : R.HT : 1.200 m >SAVE? [YES] [NO]</pre> <pre>PT#]TOP-104 2/2 PCODE] R.HT] 1.200 m EDIT ↓</pre>
<p>*1) Refer to Section 2.5 "How to Enter Alphanumeric characters".</p> <ul style="list-style-type: none"> ● When editing, ID and PCODE are not linked with PCODE LIBRARY. ● Even though the height data (INS.HT, R.HT) are corrected, the measured value can not be corrected. 		


9.2.2 Coordinate Data Searching

Example searching: Point number searching

Operating procedure	Operation	Display
1 Press the [F3](MEMORY MGR.) key from the menu 1/3.	[F3]	<pre> MEMORY MGR. 1/3 F1:FILE STATUS F2:SEARCH F3:FILE MAINTAN P↓ </pre>
2 Press the [F2](SEARCH) key.	[F2]	<pre> SEARCH F1:MEAS. DATA F2:COORD. DATA F3:PCODE LIB. </pre>
3 Press the [F2](COORD. DATA) key.	[F2]	<pre> SELECT A FILE FN: _____ INPUT LIST --- ENTER </pre>
4 Press the [F1](INPUT) key and enter File Name. Press the [F4](ENT) key. *1)	[F1] Enter FN [F4]	<pre> COORD. DATA SEARCH F1:FIRST DATA F2:LAST DATA F3:PT# DATA </pre>
5 Press the [F3](PT# DATA) key.	[F3]	<pre> PT# DATA SEARCH PT#: _____ INPUT --- --- ENTER </pre>
6 Press the [F1](INPUT) key and enter PT#. Press the [F4](ENT) key. *1)	[F1] Enter PT# [F4]	<pre> PT# TOP-104 1/2 N 100.234 m E 12.345 m Z 1.678 m ↓ </pre>
7 Press the [F4](↓) key to get the next page.	[F4]	<pre> PCODE TOPS 2/2 STR. ↓ </pre>

*1) Refer to Section 2.5 "How to Enter Alphanumeric characters".

- " | " represents data shown on the display is the stored data.
- Press the [▲] or [▼] key to scroll to next or previous point.
- To search COORD. DATA of the same point number, press the [◀] or [▶] key.
- PTL data will be shown below.

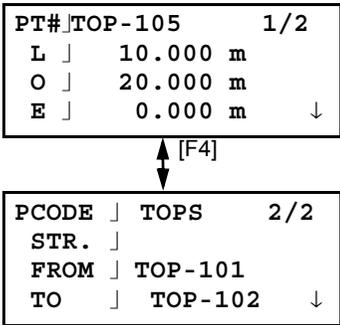

9.2.3 PCODE LIBRARY Searching

Example searching: Number searching

Operating procedure	Operation	Display
1 Press the [F3](MEMORY MGR.) key from the menu 1/3.	[F3]	<pre> MEMORY MGR. 1/3 F1:FILE STATUS F2:SEARCH F3:FILE MAINTAN P↓ </pre>
2 Press the [F2](SEARCH) key.	[F2]	<pre> SEARCH F1:MEAS. DATA F2:COORD. DATA F3:PCODE LIB. </pre>
3 Press the [F3](PCODE LIB.) key.	[F3]	<pre> PCODE DATA SEARCH F1:FIRST DATA F2:LAST DATA F3:No. SEARCH </pre>
4 Press the [F3](No. SEARCH) key.	[F3]	<pre> PCODE No. SEARCH No. = --- --- [CLR] [ENT] </pre>
5 Enter number.Press the [F4](ENT) key. *1) The number and linked data will be shown. *2)	Enter PT# [F4]	<pre> 011:NAKADAI →012:HILLTOP 013:ITABASH EDIT --- CLR --- </pre>
<p>*1) Refer to Section 2.5 "How to Enter Alphanumeric characters".</p> <ul style="list-style-type: none"> ● Press the [▲] or [▼] key to scroll to next or previous PCODE data. <p>*2) To correct the PCODE data, press the [F1](EDIT) key. To delete the PCODE data, press the [F3](CLR) key.</p>		

9.3.1 Rename a File

An existing file in internal memory can be renamed.

Operating procedure	Operation	Display
1 Press the [F3](FILE MAINTAN.) key from the Memory manager menu 1/3.	[F3]	→MEASD1 /M0123 COORD1 /C0056 REN SRCH DEL ---
2 Select a file by pressing [▲] or [▼] key.	[▲] or [▼]	MEASD1 /M0123 →COORD1 /C0056 COORD2 /C0098 REN SRCH DEL ---
3 Press the [F1](REN) key.	[F1]	MEASD1 /M0123 =COORD1 /C0056 COORD1 /C0098 [ALP] [SPC] [CLR] [ENT]
4 Enter new file name. Press the [F4](ENT) key. *1)	Enter FN [F4]	MEASD1 /M0123 →COORD5 /C0056 COORD1 /C0098 REN SRCH DEL ---
*1) Refer to Section 2.5 "How to Enter Alphanumeric characters". Existing file name can not be available. To return to the FILE MAINTAN. Menu, press the [ESC] key.		

9.3.2 Searching Data in a File

An existing file in internal memory can be searched.

Operating procedure	Operation	Display
1 Press the [F3](FILE MAINTAN.) key from the Memory manager menu 1/3.	[F3]	→MEASD1 /M0123 COORD1 /C0056 REN SRCH DEL ---
2 Select a file to search by pressing [▲] or [▼] key.	[▲] or [▼]	MEASD1 /M0123 →COORD1 /C0056 COORD2 /C0098 REN SRCH DEL ---
3 Press the [F2](SRCH) key.	[F2]	SEARCH [COORD1] F1:FIRST DATA F2:LAST DATA F3:PT# DATA
4 Select searching method by pressing the [F1] to [F3] key. *1)	[F1] to [F3]	
*1) Because procedures from next are same as procedures of Section 9.2 "Searching Data", refer to Section 9.2 "Searching Data" To return to the FILE MAINTAN. Menu, press the [ESC] key.		

9.3.3 Deleting a File

This mode erases a file from internal memory. Only one file can be erased at a time.

Operating procedure	Operation	Display
1 Press the [F3](FILE MAINTAN.) key from the Memory manager menu 1/3.	[F3]	<pre> →MEASD1 /M0123 COORD1 /C0056 REN SRCH DEL --- </pre>
2 Select a file to delete by pressing [▲] or [▼] key.	[▲] or [▼]	<pre> MEASD1 /M0123 →COORD1 /C0056 COORD2 /C0098 REN SRCH DEL --- </pre>
3 Press the [F3](DEL) key.	[F3]	<pre> MEASD1 /M0123 →COORD1 /C0056 COORD2 /C0098 >DELETE? [NO] [YES] </pre>
4 Confirm the deleting, and press the [F4](YES) key.	[F4]	<pre> MEASD1 /M0123 →COORD2 /C0098 COORD3 /C0321 REN SRCH DEL --- </pre>

● To return to the FILE MAINTAN. Menu, press the [ESC] key.

9.4 Coordinate Data Direct Key Input

9.4.1 Coordinate data input

Coordinate data for the layout point or control point can be input directly from the keyboard. This data can be stored into a file in the internal memory.

Operating procedure	Operation	Display
1 Press the [F3](MEMORY MGR.) key from the menu 1/3.	[F3]	MEMORY MGR. 1/3 F1:FILE STATUS F2:SEARCH F3:FILE MAINTAN P↓
2 Press the [F4](P↓) key.	[F4]	MEMORY MGR. 2/3 F1:COORD. INPUT F2:DELETE COORD. F3:PCODE INPUT P↓
3 Press the [F1](COORD. INPUT) key.	[F1]	SELECT A FILE FN: _____ INPUT LIST --- ENTER
4 Press the [F1](INPUT) key and enter File Name you want to input. Press the [F4](ENT) key. *1)	[F1] Enter FN [F4]	COORD. DATA INPUT F1:NEZ F2:PTL
5 Select the kind of coordinates. NEZ: Coordinate data PTL: The coordinate data for point to line	[F1]	COORD. DATA INPUT PT#: _____ INPUT --- --- ENTER
6 Press the [F1](INPUT) key and enter PT#. Press the [F4](ENT) key. *1)	[F1] Enter PT# [F4]	N→ 100.234 m E: 12.345 m Z: 1.678 m INPUT --- --- ENTER
7 Enter Coordinate data. Press the [F4](ENT) key. *1)	Enter data [F4]	COORD. DATA INPUT PCODE: _____ INPUT LIST --- ENTER
8 Enter PCODE and press the [F4](ENTER). Next input display is shown, point number (PT#) is automatically incremented.	[F1] Enter PCODE [F4]	COORD. DATA INPUT PT#:SOKKIA-102 INPUT --- --- ENTER
*1) Refer to Section 2.5 "How to Enter Alphanumeric characters".		

9.4.2 PTL (Point to Line) data input

PTL Coordinate data for the layout point or control point can be input directly from the keyboard. This data can be stored into a file in the internal memory.

Operating procedure	Operation	Display
<p>1 Press the [F3](MEMORY MGR.) key from the menu 1/3.</p>	[F3]	<pre>MEMORY MGR. 1/3 F1:FILE STATUS F2:SEARCH F3:FILE MAINTAN P↓</pre>
<p>2 Press the [F4](P↓) key.</p>	[F4]	<pre>MEMORY MGR. 2/3 F1:COORD. INPUT F2:DELETE COORD. F3:PCODE INPUT P↓</pre>
<p>3 Press the [F1](COORD. INPUT) key.</p>	[F1]	<pre>SELECT A FILE FN: _____ INPUT LIST --- ENTER</pre>
<p>4 Press the [F1](INPUT) key and enter File Name you want to input. Press the [F4](ENT) key. *1)</p>	[F1] Enter FN [F4]	<pre>COORD. DATA INPUT F1:NEZ F2:PTL</pre>
<p>5 Select the kind of coordinates. NEZ: Coordinate data PTL: The coordinate data for point to line</p>	[F2]	<pre>COORD. DATA INPUT PT#: _____ INPUT --- --- ENTER</pre>
<p>6 Press the [F1](INPUT) key and enter PT#. Press the [F4](ENT) key. *1)</p>	[F1] Enter PT# [F4]	<pre>L→ m O: m E: m INPUT --- --- ENTER</pre>
<p>7 Enter PTL data. Press the [F4](ENT) key. *1) L: Line O: Offset E: Elevation</p>	Enter data [F4]	<pre>PCODE→ _____ FROM: _____ TO : _____ INPUT LIST --- ENTER</pre>
<p>Enter PCODE, FROM and TO data and press the [F4](ENTER). *2) Next input display is shown, point number (PT#) is automatically incremented.</p>	[F1] Enter PCODE [F4]	<pre>COORD. DATA INPUT PT#:SOKKIA-102 INPUT --- --- ENTER</pre>

*1) Refer to Section 2.5 “How to Enter Alphanumeric characters”.

*2) When the inputted point name data as FROM or TO, does not exist in the same file, an error will be displayed.

9.5 Delete a Coordinate Data from a File

Coordinate data in a file can be erased.

Operating procedure	Operation	Display
1 Press the [F3](MEMORY MGR.) key from the menu 1/3.	[F3]	<pre> MEMORY MGR. 1/3 F1:FILE STATUS F2:SEARCH F3:FILE MAINTAN P↓ </pre>
2 Press the [F4](P↓) key.	[F4]	<pre> MEMORY MGR. 2/3 F1:COORD. INPUT F2:DELETE COORD. F3:PCODE INPUT P↓ </pre>
3 Press the [F2](DELETE COORD.) key.	[F2]	<pre> SELECT A FILE FN: _____ INPUT LIST --- ENTER </pre>
4 Press the [F1](INPUT) key and enter File Name. Press the [F4](ENT) key. *1)	[F1] Enter FN [F4]	<pre> DELETE COORD. PT#: _____ INPUT LIST --- ENTER </pre>
5 Press the [F1](INPUT) key and enter PT#. Press the [F4](ENT) key. *1)	[F1] Enter PT# [F4]	<pre> N: 100.234 m E: 12.345 m Z: 1.678 m >DELETE? [YES] [NO] </pre>
6 Confirm the data and press the [F3](YES) key. Deleting starts. The display will return to the previous display.	[F3]	
*1) Refer to Section 2.5 "How to Enter Alphanumeric characters".		

9.6 Editing PCODE Library

PCODE data can be entered into PCODE Library in this mode.
 A PCODE is linked with a number of 1 to 50
 PCODE can be also edited in DATA COLLECT menu 2/3 in the same way.

Operating procedure	Operation	Display
1 Press the [F3](MEMORY MGR.) key from the menu 1/3.	[F3]	<pre> MEMORY MGR. 1/3 F1:FILE STATUS F2:SEARCH F3:FILE MAINTAN. P↓ </pre>
2 Press the [F4](P↓) key.	[F4]	<pre> MEMORY MGR. 2/3 F1:COORD. INPUT F2:DELETE COORD. F3:PCODE INPUT P↓ </pre>
3 Press the [F3](PCODE INPUT) key.	[F3]	<pre> →001:SOKKIA 002:TOKYO EDIT --- CLR --- </pre>
4 By pressing the following keys, the list will increase or decrease. [▲] or [▼]: Increasing or Decreasing one by one [▶] or [◀]: By ten Increasing or Decreasing.	[▲] or [▼] [▶] or [◀]	<pre> 011:URAH →012:AMIDAT 013:HILLTO EDIT --- CLR --- </pre>
5 Press the [F1](EDIT) key.	[F1]	<pre> 011:URAH →012=AMIDAT 013:HILLTO [ALP] [SPC] [CLR] [ENT] </pre>
6 Enter PCODE and press the [F4](ENT) key. *1)	Enter PCODE [F4]	<pre> 011:URAH →012:AMISUN 013:HILLTO EDIT --- CLR --- </pre>
*1) Refer to Section 2.5 "How to Enter Alphanumeric characters".		

9.7 Data Communications

You can send a data file stored in the internal memory to a computer directly. Also, you can directly load a coordinate data file and PCODE Library data to the internal memory from the computer.

9.7.1 Sending Data

Example: Sending a Measured data file

Operating procedure	Operation	Display
1 Press the [F3](MEMORY MGR.) key from the menu 1/3.	[F3]	<pre> MEMORY MGR. 1/3 F1:FILE STATUS F2:SEARCH F3:FILE MAINTAN P↓ </pre>
2 Press the [F4](P↓) key twice.	[F4] [F4]	<pre> MEMORY MGR. 3/3 F1:DATA TRANSFER F2:INITIALIZE P↓ </pre>
3 Press the [F1](DATA TRANSFER) key.	[F1]	<pre> DATA TRANSFER F1:GTS FORMAT F2:SSS FORMAT </pre>
4 Select data format. GTS format: The conventional data SSS format: Including PCODE data, 'From' and 'To' data for Point to Line.	[F1]	<pre> DATA TRANSFER F1:SEND DATA F2:LOAD DATA F3:COMM. PARAMETERS </pre>
5 Press the [F1] key.	[F1]	<pre> SEND DATA F1:MEAS. DATA F2:COORD. DATA F3:PCODE DATA </pre>
6 Select the type of data to send by pressing [F1]-[F3] key. Example: [F1](MEAS. DATA)	[F1]	<pre> SELECT A FILE FN: _____ INPUT LIST --- ENTER </pre>
7 Press the [F1](INPUT) key and enter File Name you want to send. Press the [F4](ENT) key. *1), 2)	[F1] Enter FN [F4]	<pre> SEND MEAS. DATA >OK ? --- --- [YES] [NO] </pre>
8 Press the [F3](YES) key.*3) The sending starts. The display will return to menu.	[F3]	<pre> SEND MEAS. DATA < Sending Data!> STOP </pre>
<p>*1) Refer to Section 2.5 "How to Enter Alphanumeric characters".</p> <p>*2) To scroll the data, press the [▲] or [▼] key.</p> <p>● To show the file list, press the [F2](LIST) key.</p> <p>*3) To cancel the sending, press the [F4](STOP) key.</p>		

9.7.2 Loading Data

Coordinate data files and PCODE Library data can be loaded from PC.
 Example: Loading a coordinate data file

Operating procedure	Operation	Display
<p>1 Press the [F3](MEMORY MGR.) key from the menu 1/3.</p>	<p>[F3]</p>	<pre>MEMORY MGR. 1/3 F1:FILE STATUS F2:SEARCH F3:FILE MAINTAN P↓</pre>
<p>2 Press the [F4](P↓) key twice.</p>	<p>[F4] [F4]</p>	<pre>MEMORY MGR. 3/3 F1:DATA TRANSFER F2:INITIALIZE P↓</pre>
<p>3 Press the [F1](DATA TRANSFER) key.</p>	<p>[F1]</p>	<pre>DATA TRANSFER F1:GTS FORMAT F2:SSS FORMAT</pre>
<p>4 Press the [F1](GTS FORMAT) key.</p>	<p>[F1]</p>	<pre>DATA TRANSFER F1:SEND DATA F2:LOAD DATA F3:COMM. PARAMETERS</pre>
<p>5 Press the [F2] key.</p>	<p>[F2]</p>	<pre>LOAD DATA F1:COORD. DATA F2:PCODE DATA</pre>
<p>6 Select the type of data to load by pressing [F1] or [F2] key. Example: [F1](COORD. DATA)</p>	<p>[F1]</p>	<pre>COORD. FILE NAME FN: _____ INPUT --- --- ENTER</pre>
<p>7 Press the [F1](INPUT) key and enter New File Name you want to receive. Press the [F4](ENT) key. *1)</p>	<p>[F1] Enter FN [F4]</p>	<pre>LOAD COORD. DATA >OK ? --- --- [YES] [NO]</pre>
<p>8 Press the [F3](YES) key.*2) The loading starts. The display will return to menu.</p>	<p>[F3]</p>	<pre>LOAD COORD. DATA < Loading Data!> STOP</pre>

*1) Refer to Section 2.5 "How to Enter Alphanumeric characters".
 *2) To cancel the loading, press the [F4](STOP) key.

9.7.3 Setting Parameter of Data Communications

● Items of the Parameter

Item	Selecting Item	Contents
F1: Protocol	[ACK/NAK], [ONE WAY]	Setting Protocol [ACK/NAK] or [ONE WAY] communication
F2: Baud rate	1200, 2400, 4800, 9600, 19200, 38400	Setting transfer speed 1200/2400/4800/9600 /19200/ 38400 baud rate
F3: Char./Parity	[7/EVEN], [7/ODD], [8/NON]	Setting data length and parity. [7bit, even], [7bit, odd], [8bit,none]
F1: Stop Bits	1, 2	Setting Stop 1 bit or 2bits

● Example Setting Baud rate: 19200

Operating procedure	Operation	Display
1 Press the [F3](MEMORY MGR.) key from the menu 1/3.	[F3]	<pre> MEMORY MGR. 1/3 F1:FILE STATUS F2:SEARCH F3:FILE MAINTAN P↓ </pre>
2 Press the [F4](P↓) key twice.	[F4] [F4]	<pre> MEMORY MGR. 3/3 F1:DATA TRANSFER F2:INITIALIZE P↓ </pre>
3 Press the [F1](DATA TRANSFER) key.	[F1]	<pre> DATA TRANSFER F1:GTS FORMAT F2:SSS FORMAT </pre>
4 Press the [F1](GTS FORMAT) key.	[F1]	<pre> DATA TRANSFER F1:SEND DATA F2:LOAD DATA F3:COMM. PARAMETERS </pre>
5 Press the [F3](COMM. PARAMETERS) key.	[F3]	<pre> COMM. PARAMETERS 1/2 F1:PROTOCOL F2:BAUD RATE F3:CHAR./PARITY P↓ </pre>
6 Press the [F2](BAUD RATE) key. [] indicates present setting.	[F2]	<pre> BAUD RATE [1200] 2400 4800 9600 19200 38400 ENTER </pre>
7 Select the items by pressing [▲] or [▼], [◀] and [▶] keys. *1)	[▶] [▼]	<pre> BAUD RATE 1200 2400 4800 9600 [19200] 38400 ENTER </pre>
8 Press the [F4](ENTER) key.	[F4]	<pre> COMM. PARAMETERS 1/2 F1:PROTOCOL F2:BAUD RATE F3:CHAR./PARITY P↓ </pre>

*1) To cancel setting, press the [ESC] key.

9.8 Initialization

This mode is used to initialize the internal memory.

Following data can be initialized.

FILE DATA: All files of measuring data and coordinate data

PCODE DATA: PCODE LIST

ALL DATA: FILE DATA and PCODE DATA

Note that the following data are not initialized even if initialization is executed.

: Coordinates of the instrument, Instrument height and Reflector height.

Example Initialization: ALL DATA (FILE data and PCODE data)

Operating procedure	Operation	Display
<p>1 Press the [F3](MEMORY MGR.) key from the menu 1/3.</p>	<p>[F3]</p>	<pre>MEMORY MGR. 1/3 F1:FILE STATUS F2:SEARCH F3:FILE MAINTAN. P↓</pre>
<p>2 Press the [F4](P↓) key twice.</p>	<p>[F4] [F4]</p>	<pre>MEMORY MGR. 3/3 F1:DATA TRANSFER F2:INITIALIZE P↓</pre>
<p>3 Press the [F2](INITIALIZE) key.</p>	<p>[F2]</p>	<pre>INITIALIZE F1:FILE AREA F2:PCODE LIST F3:ALL DATA</pre>
<p>4 Select the data to initialize by pressing one of the [F1] to [F3] key. Example: [F3](ALL DATA)</p>	<p>[F3]</p>	<pre>INITIALIZE DATA ERASE ALL DATA ! >OK ? [NO] [YES]</pre>
<p>5 Confirm the erase data, press the [F4](YES) key. Initializing will start. The display returns to menu.</p>	<p>[F4]</p>	<pre>INITIALIZE DATA <Initializing!> ↓ MEMORY MGR. 3/3 F1:DATA TRANSFER F2:INITIALIZE P↓</pre>

10 SET AUDIO MODE

The light acceptance quantity level for the EDM (SIGNAL), the atmospheric correction value (PPM) and correction value of prism constant (PSM) are displayed in this mode.

When reflected light from the prism is received a buzzer sounds. This function is good for easy collimation when the target is difficult to find.

Operating procedure	Operation	Display
<p>1 Make sure the mode is in the distance measurement mode on page 1.</p> <p>2 Pressing the [F3](S/A) key, mode changes to set audio mode.</p> <p>The display indicates correction value of prism constant (PSM), atmospheric correction (PPM) and reflection light level (SIGNAL).</p>	[F3]	<div style="border: 1px solid black; padding: 5px; margin-bottom: 5px;"> HR: 120°30'40" HD* 123.456 m VD: 5.678 m MEAS MODE S/A P1↓ </div> <div style="border: 1px solid black; padding: 5px;"> SET AUDIO MODE PSM:0.0 PPM 0.0 SIGNAL: [] PRISM PPM T-P --- </div>
<ul style="list-style-type: none"> ● When receiving reflected light, buzzer sounds. It is possible to stop the sound, see Chapter 16 "SELECTING MODE". ● The [F1] to [F3] keys are used for setting atmospheric correction and prism constant. ● To return to normal measuring mode, press the [ESC] key. 		

11 SETTING THE PRISM CONSTANT VALUE

Set the prism constant correction value of the prism used to the SET beforehand.
Once you set the correction value for prism constant, it is retained after power is OFF.

Operating procedure	Operation	Display															
1 Press the [F3](S/A) key from distance measurement or coordinates measurement mode.	[F3]	<pre>SET AUDIO MODE PSM:0.0 PPM 0.0 SIGNAL: [] PRISM PPM T-P ---</pre>															
2 Press the [F1](PRISM) key.	[F1]	<pre>PRISM CONST. SET PRISM =0.0 mm --- --- [CLR] [ENT]</pre>															
3 Input the Prism constant correction value. *1) *2)	Enter data																
4 Press the [F4](ENTER) key. The display returns to set audio mode.	[F4]	<pre>SET AUDIO MODE PSM:14.0 PPM 0.0 SIGNAL: [] PRISM PPM T-P ---</pre>															
<p>*1) Refer to Section 2.5 "How to Enter Alphanumeric characters". *2) e.g.</p> <table border="1"> <thead> <tr> <th>Prism name</th> <th>Prism constant value</th> <th><u>Prism constant correction value</u></th> </tr> </thead> <tbody> <tr> <td>AP01AR</td> <td>40</td> <td>-40</td> </tr> <tr> <td>AP01AR + AP01S</td> <td>30</td> <td>-30</td> </tr> <tr> <td>OR1PA</td> <td>30</td> <td>-30</td> </tr> <tr> <td>CP01</td> <td>0</td> <td>0</td> </tr> </tbody> </table> <p>● Input range: -99.9mm to +99.9mm,0.1mm step</p>			Prism name	Prism constant value	<u>Prism constant correction value</u>	AP01AR	40	-40	AP01AR + AP01S	30	-30	OR1PA	30	-30	CP01	0	0
Prism name	Prism constant value	<u>Prism constant correction value</u>															
AP01AR	40	-40															
AP01AR + AP01S	30	-30															
OR1PA	30	-30															
CP01	0	0															

12 SETTING ATMOSPHERIC CORRECTION

The velocity of light through air is not constant and depends on the atmospheric temperature and pressure. The atmospheric correction system of this instrument corrects automatically when the correction value is set. 15°C/59°F, and 1013.25hPa/760mmHg/29.9 inHg is as a standard value for Oppm in this instrument. The values are kept in the memory even after power is OFF.

12.1 Calculation of Atmospheric Correction

The followings are the correction formulas.

Unit; meter

$$Ka = \left\{ 279.67 - \frac{79.535 \times P}{273.15 + t} \right\} \times 10^{-6}$$

Ka: Atmospheric correction value
P: Ambient atmospheric pressure (hPa)
t: Ambient Atmospheric temperature (°C)

The distance L (m) after atmospheric correction is obtained as follow.

$$L = l (1 + Ka)$$

l: Measured distance when atmospheric correction is not set.

Example: In case Temperature +20°C, Air pressure 847hPa, *l* = 1000 m

$$Ka = \left\{ 279.67 - \frac{79.535 \times 847}{273.15 + 20} \right\} \times 10^{-6}$$

$$\cong + 50 \times 10^{-6} \text{ (50 ppm)}$$

$$L = 1000 (1 + 50 \times 10^{-6}) = 1000.050 \text{ m}$$

12.2 Setting of Atmospheric Correction Value

- **How to Set Temperature and Pressure Value Directly**

Measure the temperature and air pressure surrounding the instrument beforehand.

Example: Temperature: +26°C, Pressure: 1017 hPa

Operating procedure	Operation	Display
1 Press the [F3](S/A) key to set Set Audio Mode from distance or coordinate measurement mode.	[F3]	<pre> SET AUDIO MODE PSM:0.0 PPM 0.0 SIGNAL: [] PRISM PPM T-P --- </pre>
2 Press the [F3](T-P) key.	[F3]	<pre> TEMP. & PRES. SET TEMP. = 15.0 °C PRES. : 1013.2 hPa --- --- [CLR] [ENT] </pre>
3 Input Temp.value and Pressure value.*1) Mode returns to Set Audio mode.	Enter Temp. Enter Pres.	<pre> TEMP. & PRES. SET TEMP. : 26.0 °C PRES. = 1017.0 hPa --- --- [CLR] [ENT] </pre>
<p>*1) Refer to Section 2.5 "How to Enter Alphanumeric characters".</p> <ul style="list-style-type: none"> ● Range: Temp. -30 to +60°C (0.1°C step) or -22 to +140°F (0.1°F step) Pres. 560 to 1066.0hPa (0.1hPa step), 420 to 800mmHg (0.1mmHg step) or 16.5 to 31.5inHg (0.1inHg step) ● When the atmospheric correction value which is calculated from the input temperature and pressure values exceeds the range ± 999.9ppm, the operating procedure returns to step 3 automatically. Input values again. 		

- **How to Set the Atmospheric Correction Value Directly**

Measure the temperature and air pressure to find atmospheric correction value (PPM) from the chart or correction formula.

Operating procedure	Operation	Display
1 Press the [F3](S/A) key to set Set Audio Mode from distance or coordinate measurement mode.	[F3]	<pre> SET AUDIO MODE PSM:0.0 PPM 0.0 SIGNAL: [] PRISM PPM T-P --- </pre>
2 Press the [F2](PPM) key. Current setting value is displayed.	[F2]	<pre> PPM SET PPM = 0.0 ppm --- --- [CLR] [ENT] </pre>
3 Enter atmospheric correction value. *1) Mode returns to Set Audio mode.	Enter Data [F4]	
*1) Refer to Section 2.5 "How to Enter Alphanumeric characters". <ul style="list-style-type: none"> ● Input range: -999.9ppm to +999.9ppm,0.1ppm step 		

Atmospheric Correction Chart (For your reference)

The atmospheric correction value is obtained easily with the atmospheric correction chart. Find the measured temperature in horizontal, and pressure in vertical on the chart. Read the value from the diagonal line, which represents the required atmospheric correction value.


Example:

The measured temperature is +26°C



The measured pressure is 1013 hPa

There fore,


The correction value is +10ppm

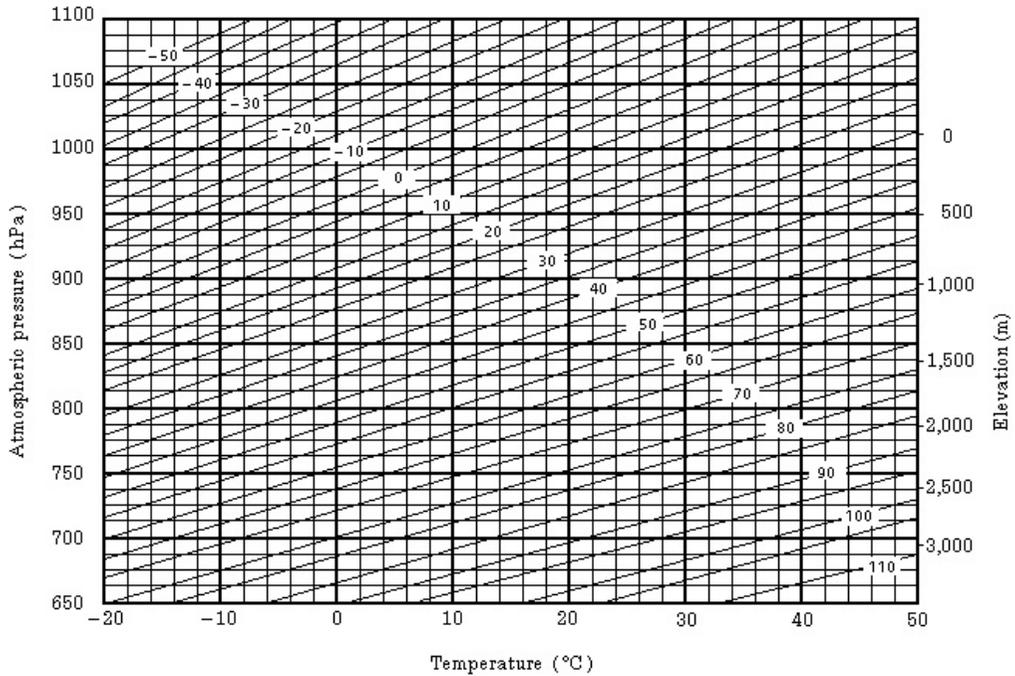

12 SETTING ATMOSPHERIC CORRECTION

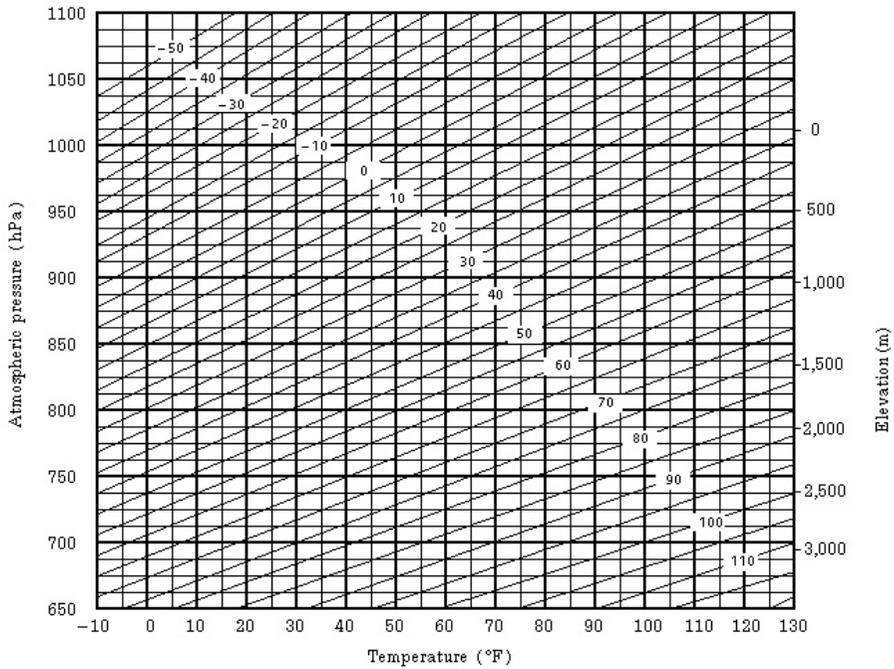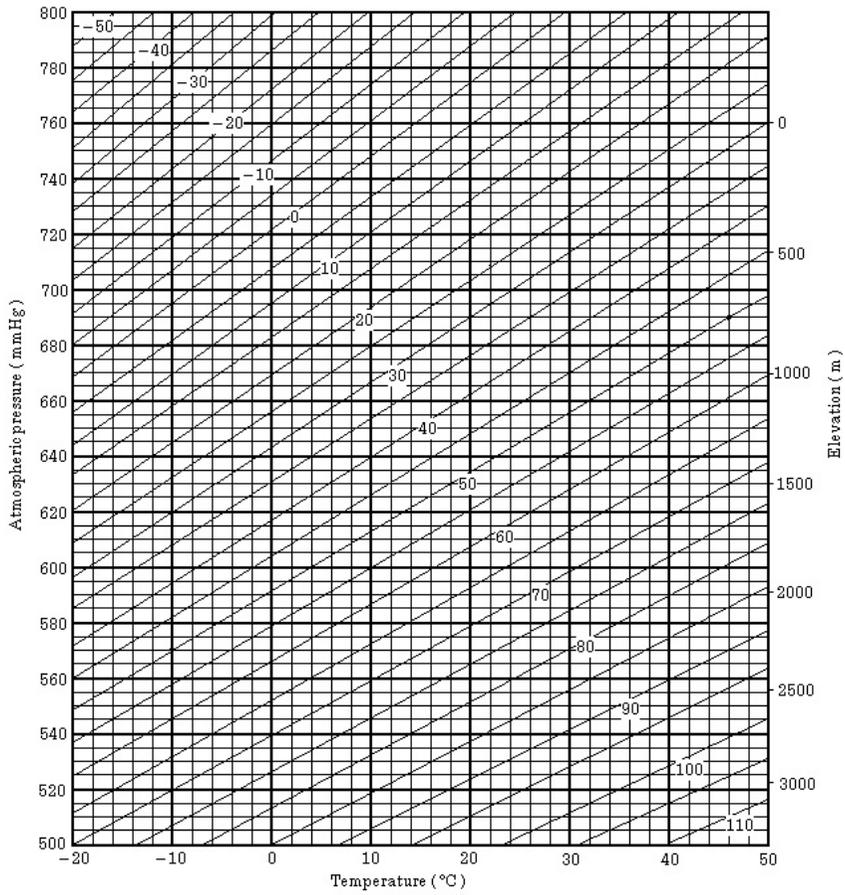

12 SETTING ATMOSPHERIC CORRECTION

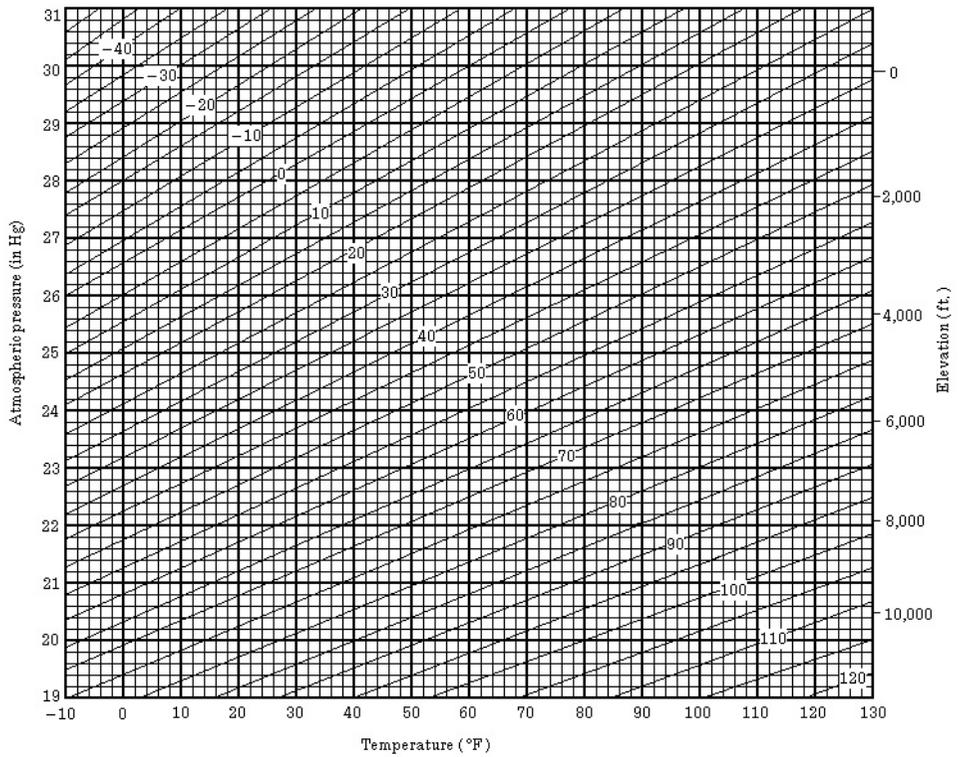


13 CORRECTION FOR REFRACTION AND EARTH CURVATURE

The instrument measures distance, taking into account correction for refraction and earth curvature.

13.1 Distance Calculation Formula

Distance Calculation Formula; with correction for refraction and earth curvature taken into account. Follow the Formula below for converting horizontal and vertical distances.

- Horizontal distance $D = AC(\alpha)$ or $BE(\beta)$
- Vertical distance $Z = BC(\alpha)$ or $EA(\beta)$
- $D = L\{\cos\alpha - (2\theta - \gamma) \sin\alpha\}$
- $Z = L\{\sin\alpha + (\theta - \gamma) \cos\alpha\}$
- $\theta = L \cdot \cos\alpha / 2R$ Earth curvature correcting item
- $\gamma = K \cdot L \cos\alpha / 2R$ Atmospheric refraction correcting item
- $K = 0.14$ or 0.2 Coefficient of refraction
- $R = 6372\text{km}$ Radius of earth
- α (or β)..... Altitude angle
- L Slope distance

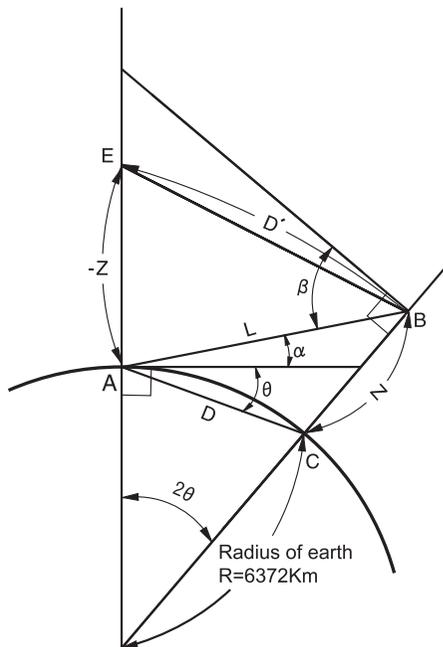

- The conversion formula for horizontal and vertical distances is as follows when correction for refraction and earth curvature is not applied.
 $D = L \cdot \cos\alpha$
 $Z = L \cdot \sin\alpha$


Note: The coefficient of the instrument has been set at 0.14 before shipment (K=0.14). if the "K" value is to be changed, refer to 16 "SELECTING MODE".

14 POWER SOURCE AND CHARGING


14.1 On-board Battery BT-G1S

- **To remove**

- 1 Confirm that the instrument is turned off before removing the battery.
Push the battery locking lever and pull out the BT-G1S on-board battery as shown below.

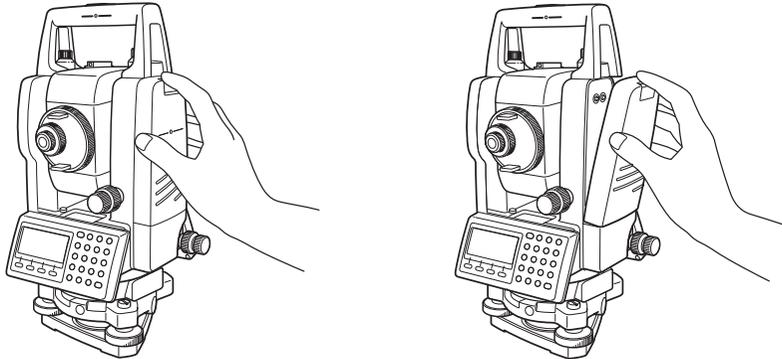

- **To charge**

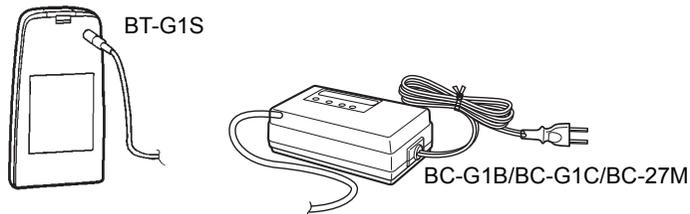

- 1 Plug the charger into the outlet. Use an AC cable compatible with the power supply voltage in use.
- 2 Connect the charger connector to the battery, then charging will start.
Preparatory charging will start. (The red lamp of the charger will blink.)
When the preparatory charging is completed, the charging status will be switched to quick charging automatically. (The red lamp of the charger will light.)
- 3 Charging will take approximately 1.8 hours. (The green lamp will illuminate.)
- 4 After charging, remove the battery from the charger.
- 5 Remove the charger from the outlet.

- **To refresh**

Press the refresh switch after starting charging above steps (1, 2), then discharging will start. Confirm the yellow lamp illuminates.

After discharging is finished, charging will start automatically.

Time discharging battery charged fully is approximately 10 hours.

- **For refreshing**

Rechargeable battery can be used repeatedly by charging. If charging is repeated by the state that capacity of the battery still left, operating time of the battery may shorten. In this case, the voltage of the battery will be recovered by refreshing and operating time can be improved.

- **About Preparatory charging**

Before quick charging, the battery is charged using small amount current to measure its temperature and voltage.

When the temperature and voltage is within a range, the charging status will change to quick charging.

The lamp of charger

Red blinking : Preparatory charging /Waiting until internal temperature falls

Red ON : Charging
Red lamp will illuminate during charging.

Green ON : Charging completed
Green lamp will illuminate after completely charging.

Yellow ON : Discharging
Yellow lamp will illuminate and discharging will start by pressing the refresh (discharge) switch.

Red quick flashing : Abnormal outbreaks
Red lamp will flash when the battery life is over or the battery is broken down.
Replace the battery to new one.

- **To install**

- 1 Place the base of the on-board battery into the SET, push the on-board battery toward the instrument side till the battery clicks into position.

- Do not charge or discharge continuously, otherwise the battery and the charger may be deteriorated. If charging or discharging is necessary, use the charger after stopping charge for approximately 30 minutes.
- Do not charge the battery or discharge the battery in right after the battery is charged, it causes deterioration of the battery in rare cases.
- The charger may develop heat while charging, there is no problem of it.

- Note:
- 1 Recharging should take place in a room with an ambient temperature range of 10°C to 40°C (50°F to 104°F).
 - 2 If charging is done at high temperature, charging time of the battery may take longer.
 - 3 Exceeding the specified charging time may shorten the life of the battery and should be avoided if possible.
 - 4 The battery source will discharge when stored and should be checked before using with instrument.
 - 5 Be sure to charge as stored battery source every 3 or 4 months and store in a place at 30°C and below when it will not used for a long period.
If you allow the battery to be completely discharged, it will have an effect on the overall performance for proper charging in the future.
Keep batteries charged at all times.
 - 6 For further information, see APPENDIX 2 "Precaution when Charging or Storing Batteries".

15 DETACH/ATTACH OF TRIBRACH


The instrument is easily detached or attached to the tribrach, with a tribrach locking lever loosened or tightened for this purpose.

● Detachment

- 1) Loosen the tribrach locking lever, by revolving it 180° or 200g in the counterclockwise direction (which will point the triangle mark upwards).
- 2) Grip the carrying handle firmly with one hand while holding the tribrach with the other. Then lift the instrument straight upwards and off.

● Attachment

- 1) Hold the instrument by the carrying handle, with one hand, and carefully lower it on top of the tribrach while, at the same time, coinciding the alignment piece with the tribrach alignment groove on the instrument and tribrach respectively.
- 2) When fully seated, revolve the tribrach locking lever 180° or 200g clockwise (which will point the triangle mark downwards again).

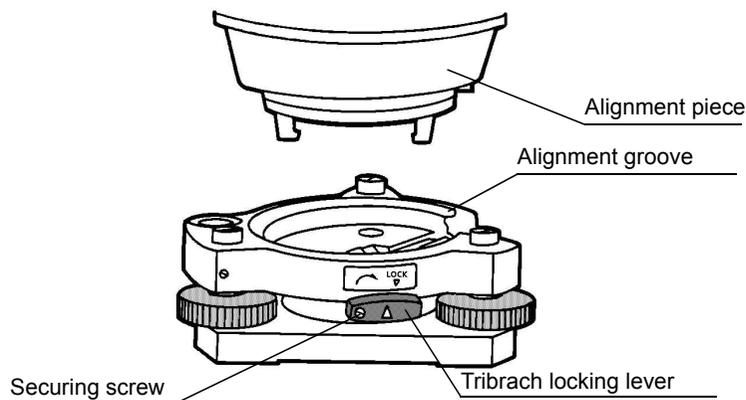

● Locking the Tribrach Locking Lever

The tribrach locking lever can be locked, to prevent it be accidentally removed, especially if the upper instrument section is not being detached very often. Simply tighten the securing screw on the locking lever with the accessory screwdriver, found in the case.

16 SELECTING MODE

16.1 Items of the Selecting Mode

The following modes are available.

Menu	Items	Selecting item	Display
1: UNIT SET	TEMP. & PRES.	°C/°F hPa/mmHg/inHg	Select the unit of temperature for atmospheric correction. Select the unit of air pressure for atmospheric correction.
	ANGLE	DEG (360°)/ GON (400G)/ MIL (6400M)	Choose degree, gon or mil unit for measuring angle.
	DISTANCE	METER/FEET/ FEET and inch	Choose measuring unit for distance meter, feet or feet and inch
	FEET	US SURVEY/ INTERNATIONAL	Select the meter/feet conversion factor. US SURVEY feet 1m=3.280833333333333 ft. INTERNATIONAL feet 1m=3.280839895013123 ft.
2: MODE SET	POWER ON MODE	ANGLE MEAS./ DISTANCE MEAS.	Select to set the measurement mode for angle or distance when the power is turned on.
	FINE/CRS/ TRK	FINE/COARSE/ TRACK	Select Fine/Coarse/Tracking mode in distance measurement mode, when the power is turned on.
	HD&VD/SD	HD&VD/SD	Specify which is displayed first, horizontal and vertical distance or slope distance, when the power is turned on.
	V ANGLE Z0/ H0	Zenith 0/ Horizontal 0	Choose the vertical angle reading from zenith or from level.
	N-TIMES/ REPEAT	N-TIMES/ REPEAT	Select the measurement mode for distance when the power is turned on.
	TIMES OF MEAS.	0~99	Set N (number of times) for times of distance measurement. When setting number of times as 1, it is single measurement.
	NEZ/ENZ	NEZ/ENZ	Select a coordinate displaying order either NEZ or ENZ.
	HA MEMORY	ON/OFF	Horizontal angle set can be retained after the power is turned off.
	ESC KEY MODE	DATA COLLECT/ LAYOUT/REC/ OFF	You can select a function of the [ESC] key. DATA COLLECT/LAYOUT: It is possible to enter data input mode (in DATA COLLECT) or Layout Menu from normal measuring mode directly. REC: While executing normal or offset measuring, the measuring data can be output. OFF: Returns to normal function.
	COORD. CHECK	ON/OFF	Select coordinate displaying ON or OFF when setting a point.

	EDM OFF TIME	0-99	The time when EDM is cut off from distance measurement is completed can be changed. This function is effective for shortening the first time measuring time when distance measurement is started from distance measurement completing state. (Default: 3minutes) 0: After completing distance measurement, EDM is cut off immediately. 1-98: EDM is cut off after 1~98 minutes. 99: EDM is always switched ON.
	FINE READING	0.2/1mm	Select 1mm or 0.2mm for the minimum reading unit in the distance mode (FINE mode).
	OFFSET V ANG	FREE/HOLD	Select Vertical angle setting in the Angle Offset measurement mode. FREE: Vertical angle varies by the angle of the telescope. HOLD: Vertical angle is fixed even if the angle of the telescope changes.
3: OTHERS SET	H-ANGLE BUZZER	ON/OFF	Specify whether the buzzer sounds or not for every horizontal angle 90°.
	S/A BUZZER	ON/OFF	Specify whether the buzzer sounds or not in the set audio mode.
	W-CORRECTION	OFF/K=0.14/ K=0.20	Set correction for refraction and earth curvature, coefficient of refraction as; K=0.14, K=0.20 or no correction.
	NEZ MEMORY	ON/OFF	It is possible to retain the coordinate of instrument point, the instrument height and prism height after power off.
	REC TYPE	REC-A/REC-B	Select REC-A or REC-B for data output. REC-A: The measurement is made again and this new data is output. REC-B: The data being displayed is output.
	CR, LF	ON/OFF	It is possible to output the data with carriage return and line feed.
	NEZ REC FORM	STANDARD/ STANDARD (12dig)/ with RAW with RAW (12dig)	Select the format of the record coordinates data STANDARD: 11 digits standard data STANDARD (12dig): 12 digits standard data with RAW: 11digits standard data with raw data with RAW (12dig): 12digits standard data with raw data
	MANUAL NEZ REC	ON/OFF	In the layout mode or data collect mode, it is possible to record coordinates entered directly from the keyboard.
	LANGUAGE *	ENGLISH/ OTHER *	Select the displaying language.
	ACK MODE	STANDARD/ OMITTED	Set the procedure of the communication with external device. STANDARD: Normal procedure OMITTED: Even though the [ACK] is omitted from the external device, the data is not sent again.
	GRID FACTOR	USE G.F./ DON'T USE	Select using GRID FACTOR in calculation of measurement data.

CUT & FILL	STANDARD/ CUT&FILL	In the layout mode, CUT & FILL can be displayed instead of dZ.
ECHO BACK	ON/OFF	It is possible to output the data of echo back type.
CONTRAST MENU	ON/OFF	When the instrument is turned ON, it is possible to display the screen which you can adjust contrast of the display and confirm the prism constant (PSM) and atmospheric correction value (PPM).
PASSWORD *2)	ON / OFF	When the instrument is turned ON, the screen to request the password will appear. *3)

*1) LANGUAGE selection is different in each country.

*2) Applicable only to the instruments with security function

*3) If you forget a password, the instrument needs repair to cancel the password. Please contact your local dealer.

16.2 How to Set Selecting Mode

<Example>: Setting unit in hPa, °F, NEZ MEMORY: ON

Operating procedure	Operation	Display
1 While pressing [F2] key, turn power ON.	[F2] + Power ON	PARAMETERS 2 F1:UNIT SET F2:MODE SET F3:OTHERS SET
2 Press [F1](UNIT SET) key.	[F1]	UNIT SET 1/2 F1:TEMP. & PRES. F2:ANGLE F3:DISTANCE P↓
3 Press [F1](TEMP. & PRES.) key.	[F1]	TEMP. & PRES. UNIT TEMP. : °C PRES. : mmHg °C °F --- ENTER
4 Press [F2](°F) key, and press [F4](ENTER) key.	[F2] [F4]	TEMP. & PRES. UNIT TEMP. : °F PRES. : mmHg hPa mmHg inHg ENTER
5 Press [F1](hPa) key, and press [F4] (ENTER) key. Returns to unit set menu.	[F1] [F4]	UNIT SET 1/2 F1:TEMP. & PRES. F2:ANGLE F3:DISTANCE
6 Press [ESC] key. Returns to PARAMETERS 2 menu.	[ESC]	PARAMETERS 2 F1:UNIT SET F2:MODE SET F3:OTHERS SET
7 Press [F3](OTHERS SET) key.	[F3]	OTHERS SET 1/5 F1:H-ANGLE BUZZER F2:S/A BUZZER F3:W-CORRECTION P↓
8 Press [F4](P↓) key, to get the function in page 2.	[F4]	OTHERS SET 2/5 F1:NEZ MEMORY F2:REC TYPE F3:CR,LF P↓

9 Press [F1] key.	[F1]	<table border="1"> <tr> <td>NEZ MEMORY</td> <td>[OFF]</td> </tr> <tr> <td>[ON]</td> <td>[OFF] --- ENTER</td> </tr> </table>	NEZ MEMORY	[OFF]	[ON]	[OFF] --- ENTER				
NEZ MEMORY	[OFF]									
[ON]	[OFF] --- ENTER									
10 Press [F1](ON) key, and press [F4] (ENTER) key. Returns to OTHERS SET menu.	[F1] [F4]	<table border="1"> <tr> <td>OTHERS SET</td> <td>2/5</td> </tr> <tr> <td>F1:NEZ MEMORY</td> <td></td> </tr> <tr> <td>F2:REC TYPE</td> <td></td> </tr> <tr> <td>F3:CR,LF</td> <td>P↓</td> </tr> </table>	OTHERS SET	2/5	F1:NEZ MEMORY		F2:REC TYPE		F3:CR,LF	P↓
OTHERS SET	2/5									
F1:NEZ MEMORY										
F2:REC TYPE										
F3:CR,LF	P↓									
11 Power off	Power OFF									
<ul style="list-style-type: none"> Up or down arrow key can be used when there are four or more selection items. 										

17 CHECK AND ADJUSTMENT

17.1 Checking and adjusting of instrument constant

 
Normally, the instrument constant does not have discrepancy. It is recommended you measure and compare with an accurately measured distance at a location where the precision is specifically monitored on a consistent basis. If such a location is not available, establish your own base line over 20m (when purchasing the instrument) and compare the data measured with the newly purchased instrument.

In both cases note that the setup displacement of the instrument position over the point, the prism, baseline precision, poor collimation, atmospheric correction, and correction for refraction and earth curvature determine the inspection precision. Please keep in mind these points.

Also, when providing a base line in a building, please note that differences in temperature greatly affect the length measured.

If a difference of 5mm or over is the result from the comparative measurement, the following procedure as shown below could be used to change the instrument constant.

- 1) Provide point C on a straight line, connecting straight line AB which is almost level and about 100m long. Measure straight lines AB, AC and BC.




- 2) Obtain the instrument constant by repeating 1) above several times.
Instrument constant = $AC+BC-AB$
- 3) When there is error between written instrument constant value and calculated value, review Section 17.4 "How to Set the Instrument Constant Value"
- 4) Once again, measure at a calibrated baseline and compare results.
- 5) If using above procedure and no difference is found from the instrument constant at the factory or a difference of over 5mm is found, contact your local dealer.

Note: The seal with which the value is written is stuck on the lower part of the instrument, or the battery removal side of the instrument.


17.2 Checking the Optical Axis

To check if the optical axis of EDM and theodolite are matched, follow the procedure below. It is especially important to check after adjustment of the eyepiece reticle is carried out.

- 1) Position the Instrument and prism with about 2m apart and face them at each other.
(At this time, the power is ON.)

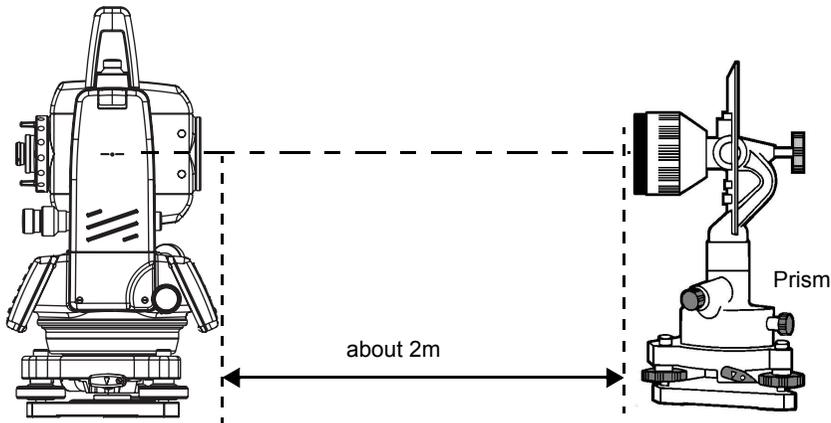


- 2) Sight through the eyepiece and focus to the prism. Then center the prism on the cross hairs.

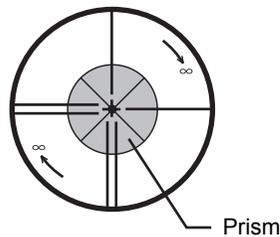

- 3) Set to the measure mode to distance measurement or set audio.
- 4) Sight through the eyepiece and focus the (blinking) red light spot by turning the focusing knob in the direction of infinity (clockwise). If displacement of the reticle cross hairs is within one-fifth of the diameter of the round red light spot both vertically and horizontally, adjustment will not be required.

Note: If displacement is more than one-fifth in the above case, and still remains so after rechecking the original line of sight, the instrument must be adjusted by competent technicians. Please contact your local dealer to adjust the instrument.

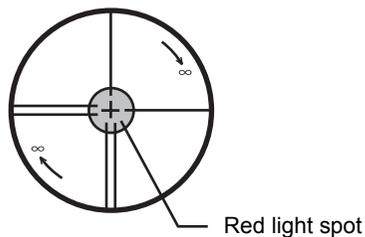

17.3 Checking/Adjusting the Theodolite Functions


● Pointers on the Adjustment

- 1) Adjust the eyepiece of the telescope properly prior to any checking operation which involves sighting through the telescope.
Remember to focus properly, with parallax completely eliminated.
- 2) Carry out the adjustments in the order of item numbers, as the adjustments are dependent one upon another. Adjustments carried out in the wrong sequence may even nullify previous adjustment.
- 3) Always conclude adjustments by tightening the adjustment screws securely (but do not tighten them more than necessary, as you may strip the threads, twist off the screw or place undue stress on the parts).
Furthermore, always tighten by revolving in the direction of tightening tension.
- 4) The attachment screws must also be tightened sufficiently, upon completion of adjustments.
- 5) Always repeat checking operations after adjustments are made, in order to confirm results.

● Notes on the Tribrach

Note that the angle measuring precision may be effected directly if the tribrach has not been installed firmly.

- 1) If any leveling screw becomes loose and slack or if collimation is unstable due to the looseness of leveling screws, adjust by tightening the adjusting screws (in 2 places) installed over each leveling screw with a screwdriver
- 2) If there is any slack between the leveling screws and the base, loosen the set screw of the holding ring and tighten the holding ring with adjusting pin, until it is properly adjusted. Re-tighten the set screw on completing the adjustment.

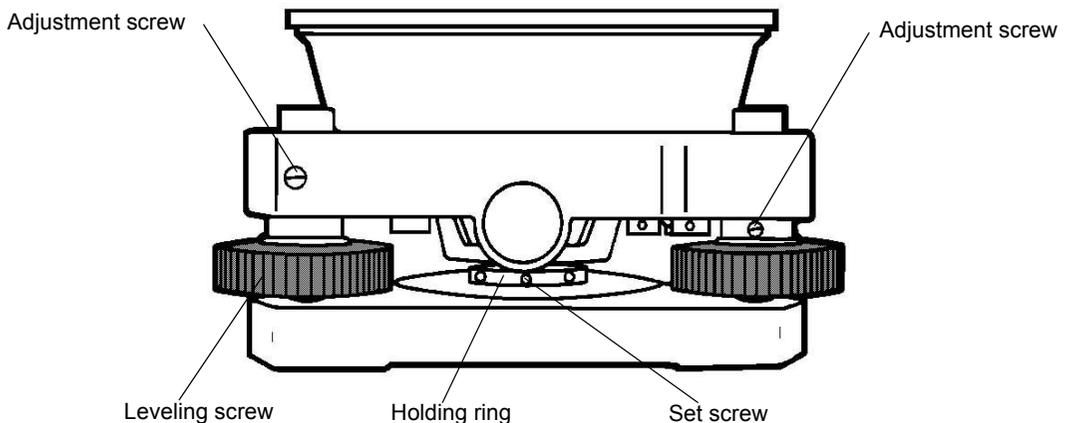


17.3.1 Checking/Adjusting the Plate Level

Adjustment is required if the axis of the plate level is not perpendicular to the vertical axis.


● **Check**

- 1) Place the plate level parallel to a line running through the centers of two leveling screws, say, A and B. Use these two leveling screws only and place the bubble in the center of the plate level.
- 2) Rotate the instrument 180° or $200g$ around the vertical axis and check bubble movement of the plate level. If the bubble has been displaced, then proceed with the following adjustment.

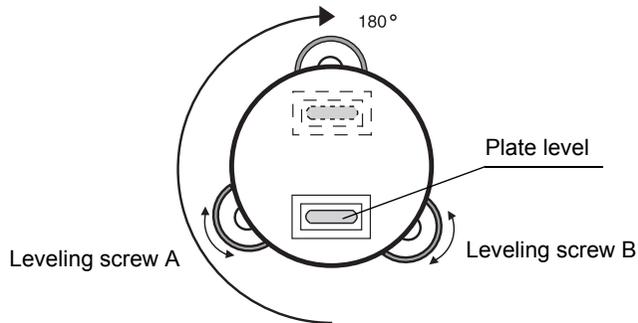

● **Adjustment**

- 1) Adjust the level adjustment capstan screw, with the accessory adjusting pin and return the bubble towards the center of the plate level. Correct only one-half of the displacement by this method.
- 2) Correct the remaining amount of the bubble displacement with the leveling screws.
- 3) Rotate the instrument 180° or $200g$ around the vertical axis once more and check bubble movement. If the bubble is still displaced, then repeat the adjustment.

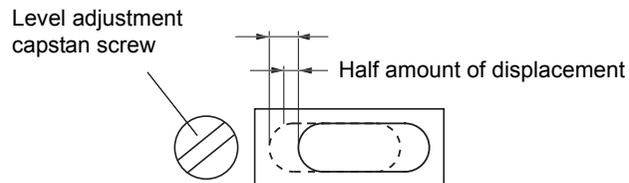

17.3.2 Checking/Adjusting the Circular Level


Adjustment is required if the axis of the circular level is also not perpendicular to the vertical axis.

● **Check**

- 1) Carefully level the instrument with the plate level only. If the bubble of the circular level is centered properly, adjustment is not required. Otherwise, proceed with the following adjustment.

● **Adjustment**

- 1) Shift the bubble to the center of the circular level, by adjusting three capstan adjustment screws on the bottom surface of the circular level, with the accessory adjusting pin.

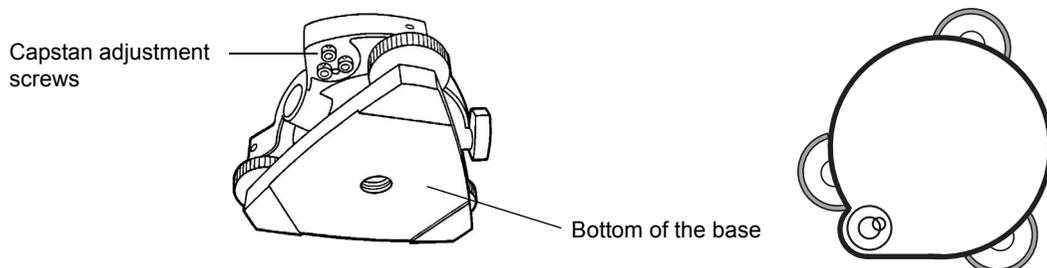


17.3.3 Adjustment of the Vertical Cross-hair

Adjustment is required if the vertical cross-hair is not in a plane perpendicular to the horizontal axis of the telescope (since it must be possible to use any point on the hair for measuring horizontal angles or running lines).


● **Check**

- 1) Set the instrument up the tripod and carefully level it.
- 2) Sight the cross-hairs on a well defined Point A at a distance of, at least, 50 meters (160ft.) and clamp horizontal motion.
- 3) Next swing the telescope vertically using the vertical tangent screw, and check whether the point travels along the length of the vertical cross-hair.
- 4) If the point appears to move continuously on the hair, the vertical cross-hair lies in a plane perpendicular to the horizontal axis (and adjustment is not required).
- 5) However, if the point appears to be displaced from the vertical cross-hair, as the telescope is swung vertically, then proceed with the following adjustment.

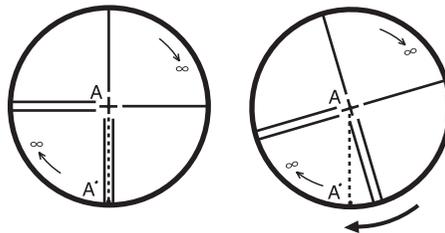

● **Adjustment**

- 1) Unscrew the cross-hair adjustment section cover, by revolving it in the counterclockwise direction, and take it off. This will expose four eyepiece section attachment screws.

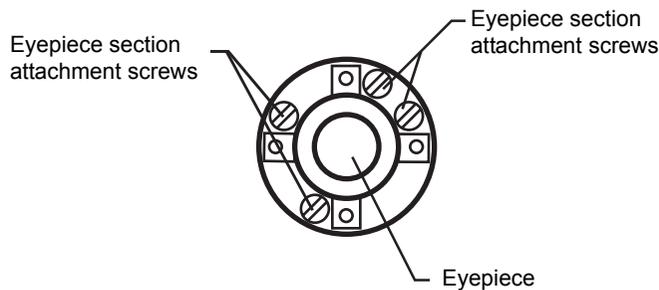

- 2) Loosen all four attachment screws slightly with the accessory screw-drive (while taking note of the number of revolutions).
Then revolve the eyepiece section so that the vertical cross-hair coincides to Point A'.
Finally, re-tighten the four screws by the amount that they were loosened.
- 3) Check once more and if the point travels the entire length of the vertical cross-hair, further adjustment is not required.





Note: Perform following adjustment after completing the above adjustment.
Section 17.3.4 "Collimation of the Instrument", Section 17.3.6 "Adjustment of Vertical Angle 0 Datum".

17.3.4 Collimation of the Instrument

Collimation is required to make the line of sight of the telescope perpendicular to the horizontal axis of the instrument, otherwise, it will not be possible to extend a straight line by direct means.



● **Check**

- 1) Set the instrument up with clear sights of about 50 to 60 meters (160 to 200 ft.) on both sides of the instrument.
- 2) Level the instrument properly with the plate level.
- 3) Sight Point A at approximately 50 meters (160 ft.) distance.
- 4) Loosen the vertical motion clamp only, and rotate the telescope 180° or 200g around the horizontal axis, so that the telescope is pointed in the opposite direction.
- 5) Sight Point B, at equal distance as Point A and tighten the vertical motion clamp.
- 6) Loosen the horizontal motion clamp and rotate the instrument 180° or 200g around the vertical axis. Fix a sight on Point A once more and tighten the horizontal motion clamp.
- 7) Loosen the vertical motion clamp only and rotate the telescope 180° or 200g around the horizontal axis once more and fix a sight on Point C, which should coincide with previous Point B.
- 8) If Points B and C do not coincide, adjust in the following manner.

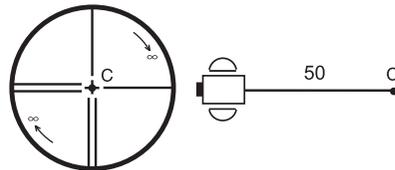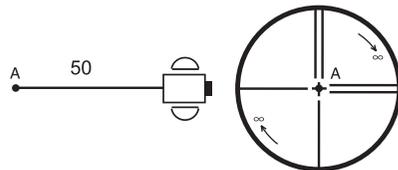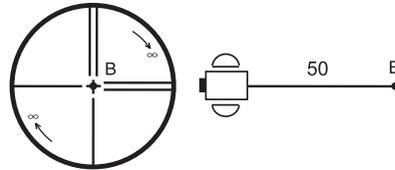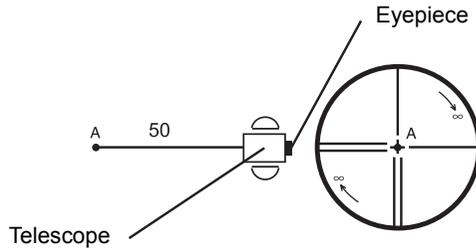

● **Adjustment**

- 1) Unscrew the cross-hair adjustment section cover.
- 2) Find Point D at a point between Points C and B, which should be equal to 1/4th the distance between Points B and C and measured from Point C. This is because the apparent error between Points B and C is four times the actual error since the telescope has been reversed twice during the checking operation.
- 3) Shift the vertical cross-hair line and coincide it with Point D, by revolving the left and right capstan adjustment screws with the adjusting pin. Upon completing the adjustment, repeat the checking operation once more.
If Points B and C coincide, further adjustment is not required. Otherwise, repeat the adjustment.

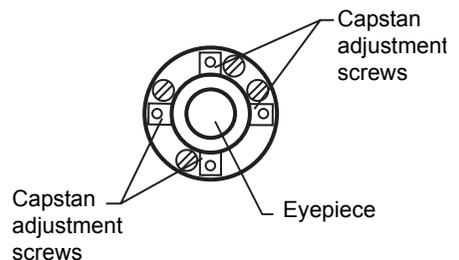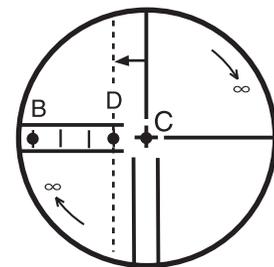

- Note: 1 First, loosen the capstan adjustment screw on the side to which the vertical cross-hair line must be moved. Then tighten the adjustment screw on the opposite side by an equal amount which will leave the tension of the adjustment screws unchanged. Revolve in the counterclockwise direction to loosen and in the clockwise direction to tighten, but revolve as little as possible.
- 2 Perform following adjustment after completing above adjustment. Section 17.3.6 "Adjustment of Vertical Angle 0 Datum", Section 17.2 "Checking the Optical Axis".

17.3.5 Checking/Adjusting the Optical Plummet Telescope


Adjustment is required to make the line of sight of the optical plummet telescope coincide with the vertical axis (otherwise the vertical axis will not be in the true vertical when the instrument is optically plumbed).

● **Check**

- 1) Coincide the center mark and the point. (See Chapter 2 "PREPARATION FOR MEASUREMENT".)
- 2) Rotate the instrument 180° or 200g around the vertical axis and check the center mark. If the point is properly centered in the center mark, adjustment is not required. Otherwise, adjust in the following manner.

● **Adjustment**

- 1) Take off the adjustment section cover of the optical plummet telescope eyepiece. This will expose four capstan adjustment screws which should be adjusted with the accessory adjusting pin to shift the center mark to the point. However, correct only one-half of the displacement in this manner.

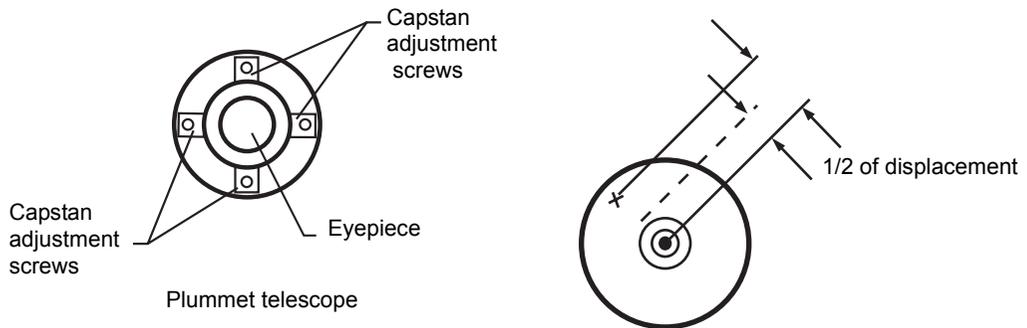

- 2) Use the leveling screws and coincide the point and center mark.
- 3) Rotate the instrument 180° or 200g around the vertical axis once more and check the center mark. If it is coincided to the point, then further adjustment is not required. Otherwise, repeat the adjustment.

- Note: First, loosen the capstan adjustment screw on the side to which the center mark must be moved. Then tighten the adjustment screw on the opposite side by an equal amount which will leave the tension of the adjustment screws unchanged. Revolve in the counterclockwise direction to loosen and in the clockwise direction to tighten, but revolve as little as possible.

17.3.6 Adjustment of Vertical Angle 0 Datum

If when measuring the vertical angle of target A at telescope position normal (direct) and reverse settings, the amount of normal and reverse measurements combined is other than 360° (ZENITH-0), half of the difference from 360° is the error amount from corrected 0 setting. Carry out adjustment. As adjustment for vertical angle 0 setting is the criteria for determining instrument coordinate origin, use special care for adjustment.

Operating procedure	Operation	Display
1 Level the instrument properly with the plate level.		
2 While pressing the [F1]key, turn power switch ON.	[F1] + Power ON	ADJUSTMENT MODE 1/2 F1:V ANGLE 0 POINT F2:INST. CONSTANT F3:V0 AXIS P↓
3 Press the [F1] key.	[F1]	V0 ADJUSTMENT <STEP-1> FRONT V: 90°00'00" ENTER
4 Collimate target A from the telescope properly in normal setting.	Collimate A (Normal)	
5 Press the [F4](ENTER) key.	[F4]	V0 ADJUSTMENT <STEP-2> REVERSE V: 270°00'00" ENTER
6 Collimate target A in reverse telescope setting.	Collimate A (Reverse)	
7 Press the [F4](ENTER) key. Measured value is set and carry out normal angle measurement.	[F4]	<SET!> ↓ V : 270°00'00" HR: 120°30'40" OSET HOLD HSET P1↓
8 Check that the total amount of normal and reverse angular travel is 360° collimating the target A by normal and reverse positions.		

17.4 How to Set the Instrument Constant Value

To set the Instrument constant which is obtained in Section 17.1 "Check and adjusting of instrument constant", follow as below.

Operating procedure	Operation	Display
1 While pressing the [F1] key, turn power switch ON.	[F1] + POWER ON	ADJUSTMENT MODE 1/2 F1:V ANGLE 0 POINT F2:INST. CONSTANT F3:V0 AXIS P↓
2 Press the [F2] key.	[F2]	INST. CONSTANT SET INST. CONSTANT = - 0.6 mm --- --- [CLR] [ENT]
3 Enter the constant value. *1), 2)	Enter value [F4]	INST. CONSTANT SET INST. CONSTANT : - 0.7 mm INPUT --- --- ENTER
4 Turn power switch OFF.	Power OFF	

*1) Refer to Section 2.5 "How to Enter Alphanumeric characters".
*2) To cancel the setting, press the [ESC] key.

17.5 Adjustment of Compensation Systematic Error of Instrument

Operating procedure	Operation	Display
1 Level the instrument properly with the plate level.	[F1] + Power ON	ADJUSTMENT MODE 1/2 F1:V ANGLE 0 POINT F2:INST. CONSTANT F3:V0 AXIS P↓
2 While pressing the [F1] key, turn power switch ON.		
3 Press the [F3] key.	[F3]	V0 AXIS F1:MEASUREMENT F2:CONSTANT LIST
4 Press the [F1] key.	[F1]	V0/AXIS ADJUSTMENTS ↓ ERROR CORRECTION (A) COLLIMATION (B) H AXIS ↓
5 Collimate target A (around 0° in horizontal within ±3°) in normal telescope setting (FACE (1)).	Collimate A (Normal)	FRONT FACE1 /0 V: 89°55'50" LEVEL ±0 SKIP SET
6 Press the [F4](SET) key. *1) The sample display shows that the measurement is made 5 times in FACE 1.	[F4]	
7 Turn the telescope in reverse telescope setting (FACE (2)).	Turn telescope	REVERSE FACE2 5/5 V: 270°04'20" LEVEL ±0 SET
8 Collimate target A.	Collimate A (Reverse)	↓
9 Press the [F4](SET) key. Repeat the procedures in step 8 and 9 so that the count of measured times matches to the one in FACE (1). *2), 3), 4) The title display will be shown automatically.	[F4]	(B) HORIZONTAL AXIS ↓
10 Collimate target B (more than ±10° from the level) in reverse telescope setting (FACE (2). *5)	Collimate B (Reverse)	REVERSE FACE 2 /0 V: 270°04'20" LEVEL ±10° SET
11 Press the [F4](SET) key. *5)	[F4]	
12 Turn the telescope in normal telescope setting (FACE (1)).	Turn telescope	FRONT FACE 1 5/5 V: 89°55'50" LEVEL ±10° SKIP SET
13 Collimate target B.	Collimate B (Normal)	↓
	[F4]	

<p>14 Press the [F4](SET) key. Repeat the procedures in step 13 and 14 so that the count of measured times matches to the one in FACE(2). Then the display returns to main menu.</p> <ul style="list-style-type: none"> To show the constant list of systematic error of instrument <p>1 Press the [F3] key from Adjustment Mode menu 1/2.</p> <p>2 Press the [F2] key. Correction values are displayed.</p> <p>3 Press the [F1] key. The display returns to previous menu.</p>	<p>[F3]</p> <p>[F2]</p> <p>[F1]</p>	<div style="border: 1px solid black; padding: 5px; text-align: center;">COMPLETE</div> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> ADJUSTMENT MODE 1/2 F1:V ANGLE 0 POINT F2:INST. CONSTANT F3:V0 AXIS P↓ </div> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> V0 AXIS F1:MEASUREMENT F2:CONSTANT LIST </div> <div style="border: 1px solid black; padding: 5px; margin-top: 10px;"> VCo: -1°57'12" HCo: -0°00'20" HAx: -0°00'20" EXIT </div>
<p>*1) It is able to get the average value from 1 to 10 measurements. To get the average, repeat the procedures in steps 5, 6 or 10, 11. The measured times is counted in the second line of display.</p> <p>*2) The compensation values of 1) Error of vertical axis (X, Y tilt sensor offset), 2) Collimation error, and 3) Error of vertical angle 0datum will be set and memorized internally.</p> <p>*3) The operating procedure steps to set compensation value of 4) Error of horizontal axis.</p> <p>*4) Pressing the [F1](SKIP) key enables to set next step without changing the last compensated value.</p> <p>*5) Pressing the [F1](SKIP) key makes end of setting without changing compensation value.</p>		

17.6 Reference frequency check mode

The beam modulated by the reference frequency of EDM is emitted continuously.
This mode is used for frequency test mainly.


Operating procedure	Operation	Display
1 While pressing the [F1] key, turn power switch ON.	[F1] + POWER ON	ADJUSTMENT MODE 1/2 F1:V ANGLE 0 POINT F2:INST. CONSTANT F3:V0 AXIS P↓
2 Press the [F4](P↓) key to get the function as in page 2.	[F4]	ADJUSTMENT MODE 2/2 F1:FRQ CHECK MODE P↓
3 Press the [F1](FRQ CHECK MODE) key.	[F1]	FRQ CHECK MODE EXIT
4 Press the [F1](EXIT) key. The display will return to Adjustment mode menu 2/2.	[F1]	ADJUSTMENT MODE 1/2 F1:V ANGLE 0 POINT F2:INST. CONSTANT F3:V0 AXIS P↓

18 PRECAUTIONS

- 1) For transportation, hold by the handle or yoke of the instrument. Never hold by the lens barrel as it can affect the fixing bracket inside and reduce the accuracy of the instrument.
- 2) Never expose the instrument without a filter to direct sunlight. It may damage the components inside the instrument.
- 3) Never leave the instrument unprotected in high temperature. The temperature inside instrument may easily reach up to 70°C or above and will reduce the service life.
- 4) The instrument should be stored in the room temperature range of minus 30°C to plus 60°C.
- 5) When a high degree of precision is required for measurement, provide shade against direct sunlight for the instrument and tripod.
- 6) Any sudden change of temperature to the instrument or prism may result in a reduction of measuring distance range, i.e. when taking the instrument out from a heated vehicle.
- 7) When opening the carrying case and taking out the instrument, place the case horizontally, then open the case.
- 8) When returning the instrument to its case, be sure to match the white positioning marks provided with the case and place the instrument with the eyepiece upward.
- 9) For transportation, provide dampening or a cushion appropriately to avoid sudden shock or vibration.
- 10) For cleaning the instrument after use, remove dust using a cleaning brush, then wipe off with a cloth.
- 11) For cleaning the lens surface, use a cleaning brush to remove the dust, then use a clean lintless cotton cloth. Moisten it with alcohol (or mixture with ether) to wipe gently in a rotational motion from the center out.
- 12) Even if any abnormality occurs, never attempt to disassemble or lubricate the instrument yourself. Always consult with your local dealer.
- 13) To remove the dust on the case, never use thinner or benzine. Use a clean cloth moistened with neutral detergent.
- 14) Check each part of the tripod after extended use. Parts (screws or clamps) may work themselves free.


19 OPTIONAL ACCESSORIES

The following are optional accessories which are sold separately from the SET.

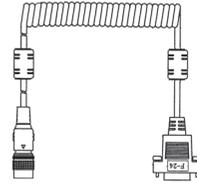


Interface cable F-24

 Cable for communicating an external instrument and SET by the serial signal connector.




Trough compass, Model 6

 Shock proof construction. No clamp is necessary when carrying the instrument.




Solar reticle, Model 6

A reticle designed for collimation of the sun. Can be used together with Solar Filter.

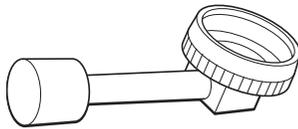


Diagonal eyepiece, Model 10

Observation in an easy posture will be provided up to the zenith position

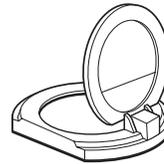

Solar filter, Model 6

A filter designed exclusively for direct collimation of the sun. Solar filter of flap-up type.

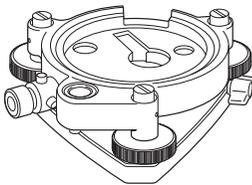


Optical plummet tribrach


This is detachable tribrach having built-in optical plummet telescope.
(Compatible with Wild)

20 BATTERY SYSTEM

In case of On-board battery

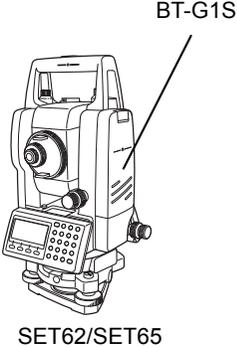

Charging

 

Charging time


Approx. 1.8h




Quick
BC-G1B for AC120V use
BC-G1C for AC220V use
BC-27M for AC220V use

21 TARGET SYSTEM

The following are all special accessories (sold separately).
Arrangement according to your needs is possible.

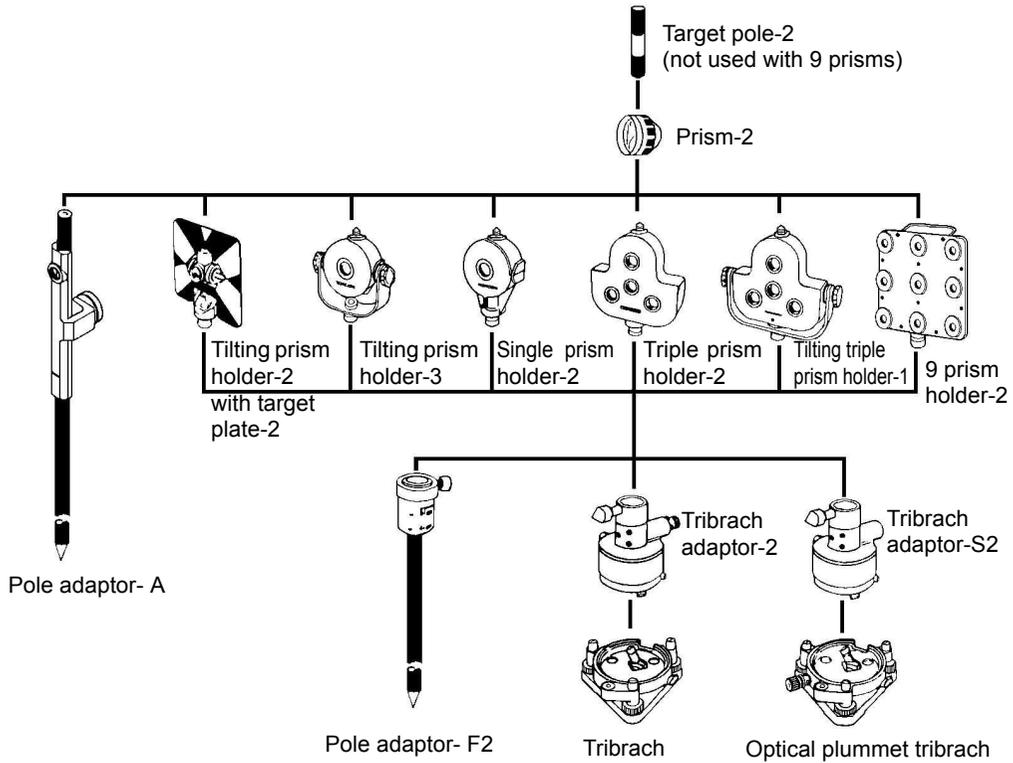

It is possible to change the combination according purpose.

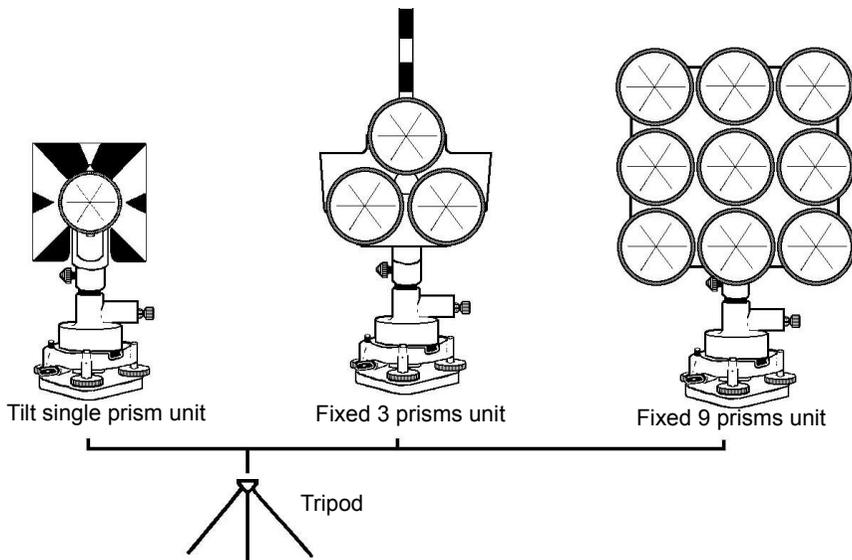

Use the above prisms after setting them at the same height as the instruments. To adjust the height of prism set, change the position of 4 fixing screws.

22 ERROR DISPLAYS

Error code	Description	Countermeasures
3 points required	When area calculating, there are less than 3 points coordinate data in selected file.	Confirm the file data and calculate again.
CALC ERROR	Calculation is impossible from the data input.	Confirm the input data.
DELETE ERROR	When deleting coordinate data, it can not be done successful.	Confirm the data and delete again.
E35	Displayed when REM measurement carried out to the range from zenith or nadir $\pm 6^\circ$.	Operate in the range out of $\pm 6^\circ$ from the zenith or nadir.
E60's	Any abnormality occurs with EDM (distance measuring system).	Repair is required.
E71	Displayed when vertical angle 0 position is set with incorrect procedure.	Confirm the procedure and readjust.
E72	Displayed when Vertical angle -position is adjusted in wrong position.	Repair is required.
E73	The instrument was not leveled when Vertical angle 0-position is adjusted.	Level the instrument then carry the adjustment work.
E80's	Mainly at the time data transmission between SET and external instrument.	Confirm operation procedure is correct or the connection cables are correct.
E90's	Abnormality in internal memory system.	Repair is required.
FILE EXISTS	The same file name exists.	Use another file name.
FULL FILES	When making a file, 30 files already exist.	If necessary, send or delete files.
FAILED INITIALIZE	Initializing can not be done successful.	Confirm initializing data and try to initialize again.
LIMIT OVER	Limit of input data exceeded.	Input again.
MEMORY ERROR	Any abnormality occurs with internal memory.	Initialize the internal memory.
MEMORY POOR	Shortage of capacity of the internal memory.	Download data from internal memory to PC.
NO DATA	The data is not found in the search mode	Confirm the data and search again.
NO FILE	There is no file in internal memory.	If necessary, make files.
FILE NOT SELECTED	When using a file, no file is selected.	Confirm the file and select a file.
P1-P2 distance too short	When in point to line measurement, the horizontal distance between first point and second point is within 1m.	The horizontal distance between first point and second point must be more than 1m.

CIRCULAR ERROR	Known points and occupied point are on the same circle at the resection mode.	Take the different point.
PT# EXIST	Same new point name is already memorized in the memory.	Confirm the new point name and input again.
PT# DOES NOT EXIST	When you enter incorrect name or PT# does not exist in the internal memory.	Enter the correct name or enter point in the internal memory.
RANGE ERROR	When setting a new point, calculation is impossible from the measured data.	Measure again.
Tilt Over	Instrument tilts over more than 3 minutes.	Level the instrument properly.
V ANGLE ERROR H ANGLE ERROR VH ANGLE ERROR	Abnormality in angle measuring system.	If this error code continues to display, repair is required.

- If error still persist after attempting to clear them, contact your local dealer.

23 SPECIFICATIONS

Telescope

Length	: 150mm
Objective lens	: 45mm (EDM 50mm)
Magnification	: 30×
Image	: Erect
Field of view	: 1°30'
Resolving power	: 3.0"
Minimum focus	: 1.3m
Reticle illumination	: Provided

Distance measurement

Measurement range

Prism	Atmospheric conditions	
	Condition 1	Condition 2
Mini prism	900m (3,000ft)	----
1 prism	2,000m (6,600ft)	2,300m (7,500ft)
3 prisms	2,700m (8,900ft)	3,100m (10,200ft)
9 prisms	3,400m (11,200ft)	4,000m (13,200ft)

Condition 1: Slight haze with visibility about 20km (12.5miles) moderate sunlight with light heat shimmer.

Condition 2: No haze with visibility about 40km (25 miles), overcast with no heat shimmer.

Measurement accuracy : $\pm(2\text{mm} + 2\text{ppm} \times D)$ m.s.e.
D: Measuring distance (mm)

Least Count in Measurement

Fine measurement mode	: 1mm (0.005ft.)/0.2mm (0.001ft.)
Coarse measurement mode	: 10mm (0.02ft.)/1mm (0.005ft.)
Tracking measurement mode	: 10mm (0.02ft.)
Measurement Display	: 12 digits : max. display 99999999.9999

Measurement Time

Fine measurement mode	: 1mm : 1.2sec. (Initial 4 sec.)
	: 0.2mm : 2.8sec. (Initial 5 sec.)
Coarse measurement mode	: 0.7sec. (Initial 3 sec.)
Tracking measurement mode	: 0.4sec. (Initial 3 sec.)
	(The initial time will be different by a condition and setting EDM off time.)

Atmospheric Correction Range : -999.9 ppm to +999.9 ppm, in 0.1 ppm increments

Prism Constant Correction Range : -99.9 mm to +99.9 mm, in 0.1 mm increments

Coefficient Factor : Meter/Feet
International feet 1meter = 3.28083989501 ft.
US SURVEY feet 1meter = 3.28083333333 ft.

Electronic Angle Measurement

Method	: Absolute reading
Detecting system:	
Horizontal angle	: 2 sides
Vertical angle	: 1 side
Minimum reading	: 5" / 1" (1mgon/0.2mgon) reading
Accuracy (Standard deviation based on ISO 17123-3 : 2001)	
SET62	: 2" (0.6mgon)
SET65	: 5" (1.5mgon)
Measuring time	: Less than 0.3 sec.
Diameter of circle	: 71mm

Tilt Correction (Automatic index)

Tilt sensor	: Automatic vertical and horizontal compensator
Method	: Liquid type
Compensating Range	: $\pm 3'$
Correction unit	: 1" (0.1mgon)

Others

Instrument height	: 176mm (6.93in) Base unit detachable (Height from the tribrach dish to the center of telescope)
-------------------	---

Level sensitivity

Circular level	: 10"/2mm
Plate level	: 30"/2mm

Optical Plummet Telescope

Magnification	: 3×
Focusing range	: 0.5m to infinity
Image	: Erect
Field of view	: 5°(ϕ 114mm/1.3m)

Dimension	: 184(W)×172(D)×336(H) mm (7.2(W)×6.8(D)×13.2(H) in)
-----------	---

Weight

Instrument	
(with battery)	: 4.9kg (10.8 lbs)
(without battery)	: 4.6kg (10.1 lbs)
Plastic carrying case	: 3.4kg (7.5 lbs)
	(Weight of the carrying case may be slightly different due to specific market.)

Durability

Protection against water and dust	: IP54(with BT-G1S) (Based on the standard IEC60529)
Ambient Temperature Range	: -20°C to +50°C (-4°F to +122°F)

Battery BT-G1S (This battery does not contain mercury.)

Out put voltage	: 7.2 V
Capacity	: 2300mAh(Ni-MH)
Number of cells	: 6
Maximum operating time (when fully recharged) at +20°C (+68°F)	
Including distance measurement	: 9hours (10,000 points)
Angle measurement only	: 40hours
Weight	: 0.3kg (0.7lbs)

Battery Charger BC-G1B/BC-G1C/BC-27M

Input voltage	: AC 120V (BC-G1B)/AC 220V (BC-G1C/BC-27M)
Frequency	: 60Hz/50Hz
Recharging time (at +20°C/+68°F)	
Battery BT-G1S	: 1.8 hours
Discharging time (at +20°C/+68°F)	
Battery BT-G1S	: 10 hours (in case of full charge)
Operating temperature	: +10°C to +40°C (+50°F to 104°F)
Charging signal	: Red lamp illumination
Refreshing signal	: Yellow lamp illumination
Finishing signal	: Green lamp illumination
Weight	: 0.5kg (1.1 lbs)

- Battery using time will vary depending on environmental conditions and operations done with SET.

24 REGULATIONS

Region/ Country	Directives/ Regulations	Labels/Declarations
U.S.A.	FCC-Class B	<p>NOTE: This equipment has been tested and found to comply with limits for a Class B digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference in a residential installation. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instructions, may cause harmful interference to radio communications.</p> <p>However, there is no guarantee that interference will not occur in a particular installation. If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by one or more of the following measures:</p> <ul style="list-style-type: none"> - Reorient or relocate the receiving antenna. - Increase the separation between the equipment and receiver. - Connect the equipment into an outlet on a circuit different from that to which the receiver is connected. - Consult the dealer or an experienced radio / TV technician for help. <p>Declaration of Conformity Model Number: SET62/SET65 Trade Name: TOPCON CORPORATION</p> <p>Manufacturer Name: TOPCON CORPORATION Address: 75-1, Hasunuma-cho, Itabashi-ku, Tokyo, 174-8580 JAPAN Country: JAPAN</p> <p>U.S.A. Representative Responsible party: TOPCON POSITIONING SYSTEMS, INC. Address: 7400 National Drive Livermore, CA94551, U.S.A Telephone number: 925-245-8300</p>
California, U.S.A.	Proposition 65	<div style="border: 1px solid black; padding: 5px;"> <p>WARNING : Handling the cord on this product or cords associated with accessories sold with this product, will expose you to lead, a chemical known to the State of California to cause birth defects or other reproductive harm. <i>Wash hands after handling.</i></p> </div>
California, U.S.A.	Perchlorate Material (CR Lithium Battery)	<div style="border: 1px solid black; padding: 5px;"> <p>This product contains a CR Lithium Battery which contains Perchlorate Material-special handling may apply. See http://www.dtsc.ca.gov/hazardouswaste/perchlorate/ Note ; This is applicable to California, U.S.A. only</p> </div>

Region/ Country	Directives/ Regulations	Labels/Declarations
California and NY, U.S.A.	Recycling Batteries	<p style="text-align: center;"><u>DON'T THROW AWAY RECHARGEABLE BATTERIES, RECYCLE THEM.</u></p> <p style="text-align: center;"><u>Topcon Positioning Systems Inc., United States Return Process for Used Rechargeable Nickel Metal Hydride, Nickel Cadmium, Small Sealed Lead Acid, and Lithium Ion, Batteries</u></p> <p>In the United States Topcon Positioning Systems Inc., has established a process by which Topcon customers may return used rechargeable Nickel Metal Hydride(Ni-MH), Nickel Cadmium(Ni-Cd), Small Sealed Lead Acid(Pb), and Lithium Ion(Li-Ion) batteries to Topcon for proper recycling and disposal. Only Topcon batteries will be accepted in this process.</p> <p>Proper shipping requires that batteries or battery packs must be intact and show no signs of leaking. The metal terminals on the individual batteries must be covered with tape to prevent short circuiting and heat buildup or batteries can be placed in individual plastic bag. Battery packs should not be disassembled prior to return.</p> <p>Topcon customers are responsible for complying with all federal, state, and local regulations pertaining to packing, labeling, and shipping of batteries. Packages must include a completed return address, be prepaid by the shipper, and travel by surface mode. <u>Under no circumstance should used/recyclable batteries be shipped by air.</u></p> <p>Failure to comply with the above requirements will result in the rejection of the package at the shipper's expense.</p> <p>Please remit packages to: Topcon Positioning Systems, Inc. C/O Battery Return Dept. 150 7400 National Dr. Livermore, CA 94551</p> <p style="text-align: center;"><u>DON'T THROW AWAY RECHARGEABLE BATTERIES, RECYCLE THEM.</u></p>
Canada	ICES-Class B	<p>This class B digital apparatus meets all requirements of the Canadian interference-Causing Equipment Regulations. Cet appareil numérique de la class B respecte toutes les exigences du Règlement sur le matériel brouilleur du Canada.</p> <p>This Class B digital apparatus complies with Canadian ICES-003 Cet appareil numérique de la Class B est conforme a la norme NMB-003 du Canada.</p>
Europe	EMC-Class B	<div style="border: 1px solid black; padding: 10px;">  <p>EMC NOTICE In industrial locations or in proximity to industrial power installations, this instrument might be affected by electromagnetic noise. Under such conditions, please test the instrument performance before use.</p> </div>
EU	WEEE Directive	<div style="border: 1px solid black; padding: 10px;">  <p>WEEE Directive This symbol is applicable to EU members states only.</p> <p>Following information is only for EU-member states: The use of the symbol indicates that this product may not be treated as household waste. By ensuring this product is disposed of correctly, you will help prevent potential negative consequences for the environment and human health, which could otherwise be caused by inappropriate waste handling of this product. For more detailed information about the take-back and recycling of this product, please contact your supplier where you purchased the product or consult.</p> <p style="text-align: right;">TOPCON CORPORATION</p> </div>
EU	EU Battery Directive	<div style="border: 1px solid black; padding: 10px;">  <p>EU Battery Directive This symbol is applicable to EU members states only.</p> <p>Battery users must not dispose of batteries as unsorted general waste, but treat properly.</p> </div>

Region/ Country	Directives/ Regulations	Labels/Declarations
Australia	C-Tick	
Republic of Korea	KC:Class B	<p>B급 기기 (가정용 방송통신기자재)</p> <p>이 기기는 가정용(B급) 전자파적합기기로서 주로 가정에서 사용하는 것을 목적으로 하며, 모든 지역에서 사용할 수 있습니다.</p>

APPENDIX

1 Dual Axis Compensation

Inclination of the vertical axis with respect to true vertical will result in incorrectly measured horizontal angles. The extent of the error in horizontal angle measurement due to axis tilt depends on three factors :

- the amount of the tilt of axis
- the elevation of the target
- the horizontal angle between the direction of tilt of the vertical axis and the target.

These factors are related by the following formula:

$$Hz_{err} = v \cdot \sin \alpha \cdot \tan h$$

where v = tilt of axis in arcseconds

α = azimuth angle between vert. axis direction and target

h = elevation of target

Hz_{err} = error in horizontal angle

Example: When the vertical axis is tilted by 30 arcseconds, the target is 10° above the horizon and rotated 90 in azimuth from the direction of the vertical axis error.

$$Hz_{err} = 30'' \cdot \sin 90^\circ \cdot \tan 10^\circ$$

$$Hz_{err} = 30'' \cdot 1 \cdot 0.176326 = 5.29''$$

From the above example it can be seen that horizontal angle errors will increase with steeper vertical sights (tangent will increase as vertical angle increases) and will be at a maximum when the target is at right angles (sin 90°=1) to the direction of the vertical axis error. Errors will be at a minimum when the sights are nearly horizontal (h=0, tan0=0) and in the same direction as the vertical axis error (α =0, sin0=0). Please refer to the table below to see the relationship between axis tilt (v) and elevation (h) and the error in horizontal angles which results from these factors.

v	h	0°	1°	5°	10°	30°	45°
0"	0"	0"	0"	0"	0"	0"	0"
5"	0"	0"	0.09"	0.44"	0.88"	2.89"	5"
10"	0"	0"	0.17"	0.87"	1.76"	5.77"	10"
15"	0"	0"	0.26"	1.31"	2.64"	8.66"	15"
30"	0"	0"	0.52"	2.62"	5.29"	17.32"	30"
1'	0"	0"	1.05"	5.25"	10.58"	34.64"	1'

It is clear from the table that dual axis compensation has the most benefit when the elevation of the target is greater than 30° and the axis is tilted more than $10''$. The entries indicated in bold in the table show, in fact, that for many common surveying applications i.e. target elevation $<30^\circ$ and axis error $<10''$, virtually no correction would be required. Dual axis compensation is especially suited then for applications where the sights are very steep.

Even though the compensators can correct horizontal angles for vertical axis errors, ***it is still important to use care in setting up the instrument.***

Centering error, for instance, cannot be corrected by the compensators. If the vertical axis is tilted by $1'$ with the instrument 1.4meters above the ground, a centering error of approx. 0.4mm will result. The maximum effect of this error at 10m is about $8''$ of horizontal angle error.

In order to maintain the increased accuracy possible through dual axis compensation, it is necessary to keep the compensators in proper adjustment. The compensators must agree with the actual level condition of the instrument. Through various environmental stresses, the agreement between the level condition sensed by the compensators and the true level condition of the instrument may be disturbed. In order to reestablish the correct relationship between the compensator and the true level condition of the instrument, it is necessary to carry out the vertical indexing procedure listed on see Chapter 17.3.6 "Adjustment of Vertical Angle 0 Datum". This adjustment will both reset the vertical index (cause a direct + indirect zenith reading to the same elevation to equal 360°) and zero the level reference for the horizontal compensator. While correct vertical angles can be obtained by averaging direct and indirect reading even when the index is improperly adjusted, the same is not true for horizontal angles. Since the vertical axis error is fixed for a given setup, its effect cannot be removed by averaging two readings.

For this reason, it is extremely important to maintain the vertical indexing adjustment to insure proper correction of the horizontal angles.

2 Precaution when Charging or Storing Batteries

The capacity of battery will be affected and its service life shortened in any of the following cases while it is recharged, discharged or stored.

1) Recharging

Fig. 1 shows how ambient temperature at recharging is related to charging efficiency or as affecting discharge capacity. As seen from the figure, charging at normal temperature is best, and the efficiency decreases as the temperature rises. It is best, therefore, to always recharge the battery at normal temperature to obtain full use of battery capacity and enjoy maximum operation per charge. And the service life of your battery will be shortened if it is frequently overcharged or recharged at high temperature.

Note: 0.1C charge means that the battery is recharged with 0.1 -time current as against its capacity.

2) Discharge

Fig. 2 shows discharge temperature characteristics. Discharge characteristics at high temperature are the same as those at normal temperatures. The battery is likely to have reduced discharge capacity as well as lower discharged voltage when discharged at low temperature. And the service life of your battery will be shortened if it is greatly overcharged.

Note: 1C discharge means one with 1 -time current over battery capacity.

3) Storage

See Fig. 3 for how storing period at different temperature levels is related to the remaining capacity. The battery will lose its capacity as storage temperature rises and the storage period increases. This does not mean, however, that the battery performance is damaged when the battery is stored. The battery, reduced in capacity, will be restored once it is recharged. Always recharge your battery before use. And recharge and discharge the battery 3 or 4 times to restore its capacity if it has been stored for a long period or at high temperature. Storing at high temperature can adversely affect the service life of your battery.

Your battery has been fully charged before leaving the factory, but its capacity may be affected considerably when it takes several months to reach you, if it is stored at high temperature area or passes through a high-temperature region. Then, the battery must be recharged and discharged 3~4 times to fully restore its capacity.

And the battery should always be stored at normal temperature or lower if it will not be used for any long period. This helps your battery have a longer service life.

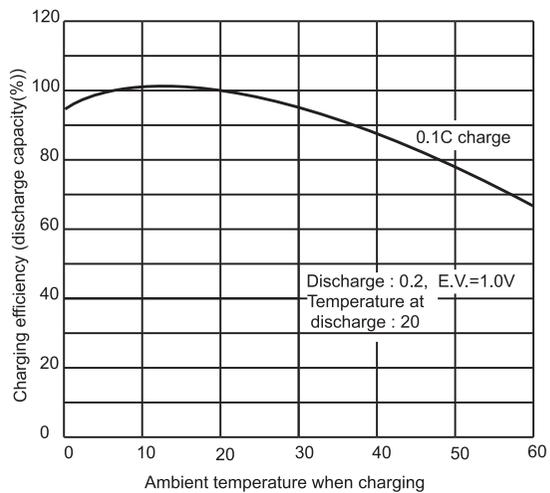


Fig.1 Recharging

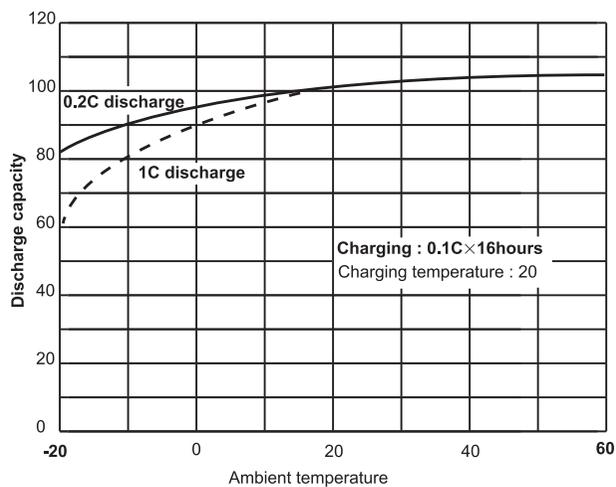


Fig. 2 Discharge

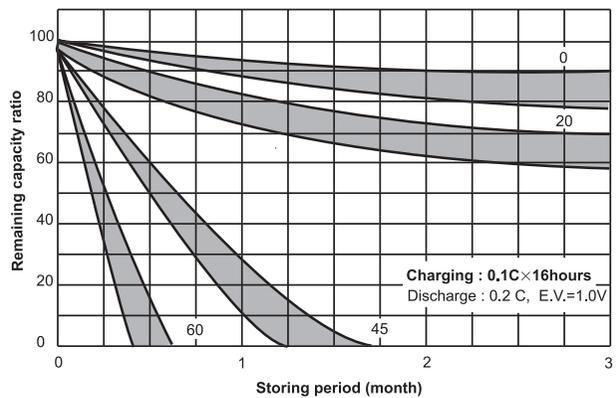


Fig. 3 Storage

TOPCON CORPORATION

75-1 Hasunuma-cho, Itabashi-ku, Tokyo 174-8580, Japan <http://www.topcon.co.jp>

Please see the attached address list or the following website for contact addresses.

GLOBAL GATEWAY <http://global.topcon.com/>
